



**South Dakota
Department of Transportation
Office of Research**



**U.S. Department
of Transportation
Federal Highway
Administration**

SD2014-20-F



Rehabilitation of Longitudinal Joints in Double-Tee Girder Bridges

**Study SD2014-20
Final Report**

Prepared by

**Department of Civil & Environmental Engineering
South Dakota State University
Brookings, SD 57007**

May 2018

DISCLAIMER

The contents of this report, funded in part through grant(s) from the Federal Highway Administration, reflect the views of the authors who are responsible for the facts and accuracy of the data presented herein. The contents do not necessarily reflect the official views or policies of the South Dakota Department of Transportation, the State Transportation Commission, or the Federal Highway Administration. This report does not constitute a standard, specification, or regulation.

The South Dakota Department of Transportation provides services without regard to race, color, gender, religion, national origin, age or disability, according to the provisions contained in SDCL 20-13, Title VI of the Civil Rights Act of 1964, the Rehabilitation Act of 1973, as amended, the Americans With Disabilities Act of 1990 and Executive Order 12898, Federal Actions to Address Environmental Justice in Minority Populations and Low-Income Populations, 1994. Any person who has questions concerning this policy or who believes he or she has been discriminated against should contact the Department's Civil Rights Office at 605.773.3540.

ACKNOWLEDGEMENTS

This work was performed under the direction of the SD2014-20 Technical Panel.

Aaron Breyfogle..... Research	Justin Cook..... Research
Cody Axlund.....Local Government Assistance	Mark Hoelscher FHWA
Dave MaddenBridge	Mark WileySDDOT
Harvey Fitzgerald..... Research	Ron BrenLocal Government Assistance
Jason Smith.....Concrete	Tom KallemeynBridge
Josh Olson..... Aberdeen Region	Toby Crow.....Associated General Contractors

This study was jointly funded by the South Dakota Department of Transportation (SDDOT) and the US Department of Transportation (USDOT) through the Mountain Plains Consortium (MPC) - University Transportation Center (UTC). Their support and guidance are appreciated. The authors are thankful to Dominique Corvez, Gaston Doiron, and Paul White of Lafarge North America, Inc., Christian Dahl of Headed Reinforcement Corp., In-Steel Wire Products, and Forterra Pipe & Precast for their collaboration and support. The assistance and valuable feedback are greatly appreciated from the following persons: Aaron Breyfogle of the Research Office at the SDDOT, Jared Gusso of Journey Construction, and Zachary Gutzmer of South Dakota State University.

TECHNICAL REPORT STANDARD TITLE PAGE

1. Report No. SD2014-20-F	2. Government Accession No.	3. Recipient's Catalog No.
4. Title and Subtitle Rehabilitation of Longitudinal Joints in Double-Tee Girder Bridges	5. Report Date 05/07/2018	
	6. Performing Organization Code	
7. Author(s) Lucas Bohn, Mostafa Tazarv, and Nadim Wehbe	8. Performing Organization Report No.	
9. Performing Organization Name and Address South Dakota State University Crothers Engineering Hall/Box 2219 Brookings, SD 57007	10. Work Unit No.	
	11. Contract or Grant No. 311238	
12. Sponsoring Agency Name and Address South Dakota Department of Transportation Office of Research 700 East Broadway Avenue Pierre, SD 57501-2586	13. Type of Report and Period Covered Final Report July 2015 – Aug 2017	
	14. Sponsoring Agency Code	
15. Supplementary Notes		
16. Abstract <p>Precast double-tee girders are common on county bridges in South Dakota (SD) because of the ease of construction, the short construction time, and the low cost. However, the longitudinal joints of these bridges are rapidly deteriorating, imposing girder replacement after only 45 years of service. Currently, there are more than 700 double-tee bridges in SD incorporating this joint detailing. The present study was conducted to develop, construct, and evaluate rehabilitation methods for this type of bridge. Current detailing between adjacent double-tee girders consists of discrete welded steel plate connections. A previous study showed that this detailing is insufficient for fatigue, service, and strength loads. Twenty joint rehabilitation detailing alternatives were proposed in the present study. Thirteen large-scale beams were tested to investigate the performance of the rehabilitation methods. Ultra-High Performance Concrete (UHPC) and Latex Modified Concrete (LMC) were selected as the filler materials. Subsequently, two joint concepts, "pocket" and "continuous," were developed based on the experimental and analytical studies. A full-scale 40-ft long double-tee bridge was constructed using conventional longitudinal joint detailing and was then initially tested under fatigue loads. Subsequently, the bridge was rehabilitated using the two proposed details, "pocket" joint with UHPC and "continuous" joint with LMC, each incorporated on one-half of the bridge. The rehabilitated specimen was tested under 600,000 cycles of AASHTO Fatigue loads. Stiffness tests were performed to monitor the degradation of the bridge. Finally, the specimen was monotonically loaded to failure. No significant damage, beyond initial shrinkage cracks in LMC, was observed throughout the fatigue testing. Furthermore, the stiffness of the bridge did not degrade. No damage or yielding of the reinforcement in the joint was observed throughout the strength testing. The rehabilitated bridge met all the AASHTO limit state requirements indicating sufficient performance. Overall, both proposed rehabilitation methods are structurally viable alternatives for double-tee bridge girders; however, only UHPC should be used as filler material</p>		

at this time. The rehabilitation cost of a double-tee bridge with pocket detailing is expected to be only 30% of the bridge's superstructure replacement cost.

17. Keywords Superstructure Bridges, Double-Tee Girders, Longitudinal Joints, Rehabilitation		18. Distribution Statement No restrictions. This document is available to the public from the sponsoring agency.	
19. Security Classification (of this report) Unclassified	20. Security Classification (of this page) Unclassified	21. No. of Pages 113	22. Price

TABLE OF CONTENTS

DISCLAIMER	II
ACKNOWLEDGEMENTS	III
TECHNICAL REPORT STANDARD TITLE PAGE.....	IV
TABLE OF CONTENTS.....	VI
LIST OF TABLES	X
LIST OF FIGURES	X
TABLE OF ACRONYMS.....	XV
1 EXECUTIVE SUMMARY.....	1
1.1 INTRODUCTION.....	1
1.2 PROBLEM DESCRIPTION	1
1.3 RESEARCH WORK	1
1.4 RESEARCH FINDINGS.....	2
1.5 RECOMMENDATIONS.....	3
1.5.1 <i>Recommendation 1: General</i>	3
1.5.2 <i>Recommendation 2: Rehabilitation Methods</i>	3
1.5.3 <i>Recommendation 3: Joint Preparation for Rehabilitation</i>	3
1.5.4 <i>Recommendation 4: Pocket Rehabilitation Method</i>	4
1.5.5 <i>Recommendation 5: Continuous Rehabilitation Method</i>	4
2 PROBLEM DESCRIPTION	5
3 RESEARCH OBJECTIVES.....	7
3.1 REVIEW AND EVALUATE LONGITUDINAL JOINT REHABILITATION METHODS.....	7
3.2 TEST LONGITUDINAL JOINT REHABILITATION DETAILING	7
3.3 RECOMMEND LONGITUDINAL JOINT REHABILITATION DETAILING.....	7
4 TASK DESCRIPTIONS	9
4.1 MEET WITH TECHNICAL PANEL.....	9
4.2 INTERVIEW SDDOT AND CONSTRUCTION COMPANY PERSONNEL	9
4.3 REVIEW BRIDGE INSPECTION DATA	9
4.4 PERFORM LITERATURE REVIEW.....	9
4.5 PREPARE TECHNICAL MEMORANDUM SUMMARIZING TASKS 1 TO 4	10

4.6	MEET WITH TECHNICAL PANEL	10
4.7	PREPARE TECHNICAL MEMORANDUM WITH JOINT DESIGNS, CONSTRUCTION METHODS, AND INSTRUMENTATION AND TESTING PLANS.....	10
4.8	CONSTRUCT AND INSTRUMENT TEST SPECIMENS	11
4.9	PERFORM FATIGUE AND ULTIMATE TESTS	11
4.10	COMPARE TEST RESULTS.....	11
4.11	PREPARE MARKETING BROCHURE	11
4.12	PREPARE FINAL REPORT	12
4.13	MAKE AN EXECUTIVE PRESENTATION.....	12
5	LITERATURE REVIEW.....	13
5.1	CONVENTIONAL DOUBLE-TEE LONGITUDINAL JOINTS	13
5.2	SOUTH DAKOTA DOUBLE-TEE BRIDGES.....	13
5.2.1	<i>Identification of Double-Tee Bridges for Joint Rehabilitation</i>	<i>14</i>
5.3	CONTINUOUS LONGITUDINAL JOINTS.....	15
5.4	DOWEL BAR RETROFIT	19
5.5	JOINT FILLER MATERIAL	20
5.5.1	<i>Ultra-High Performance Concrete (UHPC)</i>	<i>20</i>
5.5.2	<i>Latex Modified Concrete (LMC).....</i>	<i>21</i>
5.5.3	<i>Other Filler Materials</i>	<i>22</i>
5.6	JOINT REINFORCEMENT.....	23
5.7	DEMOLITION METHODS.....	24
5.7.1	<i>Hydro-Demolishing.....</i>	<i>24</i>
6	LONGITUDINAL JOINT REHABILITATION ALTERNATIVES.....	25
6.1	DOUBLE-TEE LONGITUDINAL JOINT REHABILITATION ALTERNATIVES.....	25
6.2	RATING SYSTEM, BEAM TESTS, AND ANALYTICAL STUDY	25
6.2.1	<i>Rating System.....</i>	<i>25</i>
6.2.2	<i>Beam Tests</i>	<i>27</i>
6.2.3	<i>Analytical Study.....</i>	<i>36</i>
6.3	PROPOSED REHABILITATION DETAILING	40

7	FULL-SCALE BRIDGE TEST SPECIMENS.....	44
7.1	DESIGN OF BRIDGE TEST SPECIMENS	44
7.1.1	<i>Conventional Bridge Test Specimen</i>	45
7.1.2	<i>Rehabilitated Bridge Test Specimen</i>	45
7.2	FABRICATION AND ASSEMBLY	47
7.2.1	<i>Conventional Bridge Joint Completion</i>	48
7.2.2	<i>Rehabilitated Bridge Joint Completion</i>	48
7.3	INSTRUMENTATION, TEST SETUP, AND LOADING PROTOCOLS.....	52
7.3.1	<i>Instrumentation</i>	52
7.3.2	<i>Test Setup</i>	53
7.3.3	<i>Loading Protocol</i>	54
8	EXPERIMENTAL FINDINGS	56
8.1	MATERIALS PROPERTIES.....	56
8.1.1	<i>Properties of Cementitious Materials</i>	56
8.1.2	<i>Properties of Prestressing Strands</i>	58
8.1.3	<i>Properties of Steel Reinforcement</i>	59
8.1.4	<i>Properties of Elastomeric Neoprene Bearing Pads</i>	59
8.2	BRIDGE TEST RESULTS	60
8.2.1	<i>Conventional Double-Tee Bridge Test Specimen</i>	60
8.2.2	<i>Rehabilitated Double-Tee Bridge Test Specimen</i>	65
8.3	PERFORMANCE OF DOUBLE-TEE BRIDGES UNDER DIFFERENT LIMIT STATES	78
8.3.1	<i>Double-Tee Bridge Test Specimens</i>	78
8.3.2	<i>Observed Damage</i>	78
8.3.3	<i>Fatigue Performance</i>	79
8.3.4	<i>Force-Displacement Relationships</i>	80
8.4	CONSTRUCTABILITY OF PROPOSED JOINT REHABILITATION METHODS	81
8.4.1	<i>Method of Demolishing</i>	82
8.4.2	<i>Construction of Rehabilitated Continuous Joint</i>	82
8.4.3	<i>Construction of Rehabilitated Pocket Joint</i>	82

8.5	COST OF DOUBLE-TEE BRIDGE LONGITUDINAL JOINT REHABILITATION	83
9	PROPOSED CONSTRUCTION SPECIFICATIONS	84
9.1	PREPARATION FOR DOUBLE-TEE LONGITUDINAL JOINT REHABILITATION	84
9.2	REHABILITATION METHODS FOR DOUBLE-TEE LONGITUDINAL JOINTS.....	84
9.2.1	<i>Pocket Detailing for Rehabilitation of Double-Tee Bridge Longitudinal Joints</i>	<i>85</i>
9.2.2	<i>Continuous Detailing for Rehabilitation of Double-Tee Bridge Longitudinal Joints.....</i>	<i>88</i>
10	CONCLUSIONS	91
11	RECOMMENDATIONS	93
11.1	RECOMMENDATION 1: GENERAL	93
11.2	RECOMMENDATION 2: REHABILITATION METHODS.....	93
11.3	RECOMMENDATION 3: JOINT PREPARATION FOR REHABILITATION	93
11.4	RECOMMENDATION 4: POCKET REHABILITATION METHOD.....	93
11.5	RECOMMENDATION 5: CONTINUOUS REHABILITATION METHOD	94
12	RESEARCH BENEFITS.....	95
13	REFERENCES.....	96

LIST OF TABLES

TABLE 5-1. UHPC TYPICAL MIX DESIGN (GRAYBEAL, 2010)	20
TABLE 5-2. UHPC TYPICAL MECHANICAL PROPERTIES (GRAYBEAL, 2010)	21
TABLE 5-3. LMC TYPICAL MIX DESIGN (BAER, 2013)	22
TABLE 6-1. DOUBLE-TEE BRIDGE LONGITUDINAL JOINT REHABILITATION ALTERNATIVES.....	26
TABLE 6-2. RATING OF DOUBLE-TEE BRIDGE LONGITUDINAL JOINT REHABILITATION ALTERNATIVES.....	27
TABLE 6-3. LARGE-SCALE BEAM TEST MATRIX.....	28
TABLE 6-4. MODE OF FAILURE AND LOAD CAPACITY FOR BEAM TEST SPECIMENS	32
TABLE 6-5. INPUT FOR POCKET SPRINGS IN FINITE ELEMENT ANALYSIS.....	38
TABLE 7-1. FULL-SCALE BRIDGE LOADING MATRIX	54
TABLE 8-1. PROPERTIES OF PRECAST GIRDER FRESH CONCRETE	56
TABLE 8-2. COMPRESSIVE STRENGTH OF GIRDER CONCRETE	57
TABLE 8-3. COMPRESSIVE STRENGTH OF NON-SHRINK GROUT	57
TABLE 8-4. COMPRESSIVE STRENGTH OF UHPC.....	58
TABLE 8-5. COMPRESSIVE STRENGTH OF LMC.....	58
TABLE 8-6. TENSILE PROPERTIES OF PRESTRESSING STRANDS.....	58
TABLE 8-7. TENSILE PROPERTIES OF STEEL WIRES USED IN JOINTS AND GIRDERS.....	59
TABLE 8-8. TENSILE PROPERTIES OF REINFORCING STEEL BARS USED IN UHPC POCKETS	59
TABLE 8-9. REHABILITATION VS. REPLACEMENT COSTS FOR 40-FT LONG DOUBLE-TEE BRIDGES	83

LIST OF FIGURES

FIGURE 2-1. CONVENTIONAL DOUBLE-TEE GIRDER LONGITUDINAL JOINT DETAIL (AFTER KONRAD, 2014)	5
FIGURE 2-2. REFLECTIVE CRACKING AND DETERIORATION OF DOUBLE-TEE GIRDER BRIDGES (KONRAD, 2014)	5
FIGURE 2-3. FULL-SCALE CONVENTIONAL DOUBLE-TEE GIRDER TEST SPECIMEN (AFTER KONRAD, 2014)	6
FIGURE 5-1. CONVENTIONAL DOUBLE-TEE GIRDER LONGITUDINAL JOINT DETAIL (AFTER KONRAD, 2014)	13
FIGURE 5-2. SOUTH DAKOTA DOUBLE-TEE BRIDGE AGE DISTRIBUTION	14
FIGURE 5-3. RECOMMENDED LONGITUDINAL JOINT DETAILING (AFTER JONES, 2001)	15
FIGURE 5-4. UHPC-FILLED DECK PANEL-TO-PANEL LONGITUDINAL JOINT DETAILING (AFTER GRAYBEAL, 2010).....	16

FIGURE 5-5. FAILURE OF LONGITUDINAL DECK PANEL-TO-PANEL JOINT WITH STRAIGHT BARS UNDER FATIGUE LOADING (AFTER GRAYBEAL, 2010)	17
FIGURE 5-6. CONTINUOUS JOINT DETAILING FOR DOUBLE-TEE BRIDGES (AFTER KONRAD, 2014).....	17
FIGURE 5-7. MEASURED LOAD-DISPLACEMENT RELATIONSHIP OF DOUBLE-TEE BRIDGES UNDER STRENGTH TESTING (AFTER KONRAD, 2014).....	18
FIGURE 5-8. TEST VARIABLES USED FOR PRECAST DECK PANEL CONNECTIONS (AFTER HABER AND GRAYBEAL, 2014).....	18
FIGURE 5-9. SURVEY RESULTS FOR VARIOUS LONGITUDINAL JOINT DETAILING (AFTER JONES ET AL., 2016).....	19
FIGURE 6-1. GEOMETRY OF BEAM TEST SPECIMENS	29
FIGURE 6-2. SPLICE DETAILING OF BEAM TEST SPECIMENS.....	30
FIGURE 6-3. CONSTRUCTION OF BEAM TEST SPECIMENS	31
FIGURE 6-4. LOAD-DISPLACEMENT RELATIONSHIPS FOR BEAM TEST SPECIMENS.....	33
FIGURE 6-5. BEAM TEST SPECIMENS AT FIRST CRACKING.....	34
FIGURE 6-6. BEAM TEST SPECIMENS AT FAILURE.....	35
FIGURE 6-7. TWO DOUBLE-TEE BRIDGE REHABILITATION CONCEPTS	36
FIGURE 6-8. FINITE ELEMENT ANALYSIS OF DOUBLE-TEE BRIDGE REHABILITATION CONCEPTS	37
FIGURE 6-9. EFFECT OF POCKET SPACING ON DOUBLE-TEE GIRDER LOAD DISTRIBUTION.....	39
FIGURE 6-10. CALCULATED AND MEASURED DOUBLE-TEE GIRDER LOAD DISTRIBUTION.....	39
FIGURE 6-11. REHABILITATED DOUBLE-TEE GIRDER LOAD DISTRIBUTION VS. SPAN LENGTH	40
FIGURE 6-12. PROPOSED REHABILITATION FOR DOUBLE-TEE BRIDGE TEST SPECIMEN- PLAN VIEW	42
FIGURE 6-13. PROPOSED UHPC POCKET DETAILING	42
FIGURE 6-14. PROPOSED UHPC INTERMEDIATE POCKET DETAILING	42
FIGURE 6-15. PROPOSED LMC CONTINUOUS JOINT DETAILING	43
FIGURE 6-16. PROPOSED CONTINUOUS JOINT SPLICE DETAILING	43
FIGURE 7-1. CROSS-SECTION OF TYPICAL DOUBLE-TEE GIRDER BRIDGES.....	44
FIGURE 7-2. DETAILING OF 23-IN. DEEP DOUBLE-TEE GIRDERS	44
FIGURE 7-3. PLAN VIEW OF CONVENTIONAL TEST SPECIMEN	45
FIGURE 7-4. CONVENTIONAL TEST SPECIMEN DETAILS	45
FIGURE 7-5. PLAN VIEW OF REHABILITATED TEST SPECIMEN	46
FIGURE 7-6. UHPC POCKET REHABILITATION DETAILING.....	46

FIGURE 7-7. UHPC INTERMEDIATE POCKET REHABILITATION DETAILING	46
FIGURE 7-8. LMC CONTINUOUS REHABILITATION DETAILING	46
FIGURE 7-9. FABRICATION OF DOUBLE-TEE GIRDERS	47
FIGURE 7-10. UNLOADING AND PLACEMENT OF GIRDERS	48
FIGURE 7-11. FABRICATION AND GROUTING OF CONVENTIONAL JOINT DETAILING	48
FIGURE 7-12. DEMOLITION OF LONGITUDINAL JOINT OF DOUBLE-TEE BRIDGE TEST SPECIMEN	49
FIGURE 7-13. REHABILITATED JOINT SURFACE PREPARATION IN DOUBLE-TEE BRIDGE TEST SPECIMEN.....	50
FIGURE 7-14. FORMWORK AND REINFORCEMENT OF REHABILITATED JOINTS IN DOUBLE-TEE BRIDGE TEST SPECIMEN.....	51
FIGURE 7-15. CASTING UHPC AND LMC IN REHABILITATED JOINTS OF DOUBLE-TEE BRIDGE TEST SPECIMEN	52
FIGURE 7-16. FULL-SCALE DOUBLE-TEE BRIDGE TEST SETUP	53
FIGURE 7-17. WATER DAMS ON REHABILITATED JOINT OF DOUBLE-TEE BRIDGE TEST SPECIMEN	54
FIGURE 7-18. APPLIED LOAD CONFIGURATION AND LOCATION	55
FIGURE 8-1. MEASURED FORCE-DISPLACEMENT RELATIONSHIP OF ELASTOMERIC BEARING PAD (AFTER MINGO, 2016)	60
FIGURE 8-2. STIFFNESS DEGRADATION DURING FATIGUE II TESTING OF CONVENTIONAL DOUBLE-TEE BRIDGE SPECIMEN.....	61
FIGURE 8-3. LONGITUDINAL JOINT RELATIVE DISPLACEMENT FOR CONVENTIONAL DOUBLE-TEE BRIDGE SPECIMEN DURING FATIGUE II TESTING.....	61
FIGURE 8-4. GIRDER-TO-GIRDER JOINT ROTATION FOR CONVENTIONAL DOUBLE-TEE BRIDGE SPECIMEN DURING FATIGUE II TESTING	62
FIGURE 8-5. GIRDER-TO-GIRDER JOINT CRACKING OF CONVENTIONAL DOUBLE-TEE BRIDGE SPECIMEN.....	62
FIGURE 8-6. FORCE-DISPLACEMENT RELATIONSHIP FOR CONVENTIONAL DOUBLE-TEE BRIDGE SPECIMEN DURING JOINT CRACK STRENGTH TESTING.....	63
FIGURE 8-7. GIRDER LOAD DISTRIBUTION FOR CONVENTIONAL DOUBLE-TEE BRIDGE SPECIMEN.....	63
FIGURE 8-8. MEASURED STRAINS OF LOADED GIRDER IN CONVENTIONAL DOUBLE-TEE BRIDGE SPECIMEN DURING JOINT CRACK STRENGTH TESTING.....	64
FIGURE 8-9. MEASURED STRAINS OF GIRDER B IN CONVENTIONAL DOUBLE-TEE BRIDGE SPECIMEN DURING JOINT CRACK STRENGTH TESTING.....	64
FIGURE 8-10. LONGITUDINAL JOINT RELATIVE DISPLACEMENT FOR CONVENTIONAL DOUBLE-TEE BRIDGE SPECIMEN DURING JOINT CRACK STRENGTH TESTING.....	65
FIGURE 8-11. GIRDER-TO-GIRDER JOINT ROTATION FOR CONVENTIONAL DOUBLE-TEE BRIDGE SPECIMEN DURING JOINT CRACK STRENGTH TESTING.....	65
FIGURE 8-12. TRANSVERSE CRACKS IN CONTINUOUS JOINT OF REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN PRIOR TO TESTING	66

FIGURE 8-13. DAMAGE OF CONTINUOUS JOINT OF REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING FATIGUE II TESTING ..	67
FIGURE 8-14. DAMAGE OF UHPC POCKET JOINTS OF REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING FATIGUE II TESTING	67
FIGURE 8-15. STIFFNESS DEGRADATION DURING FATIGUE II TESTING OF REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN.....	68
FIGURE 8-16. LONGITUDINAL JOINT RELATIVE DISPLACEMENTS FOR REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING FATIGUE II TESTING	68
FIGURE 8-17. GIRDER-TO-GIRDER JOINT ROTATION FOR REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING FATIGUE II TESTING	69
FIGURE 8-18. DAMAGE OF REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN AFTER FATIGUE I TESTING.....	69
FIGURE 8-19. STIFFNESS DEGRADATION FOR REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING FATIGUE I TESTING.....	70
FIGURE 8-20. LONGITUDINAL JOINT RELATIVE DISPLACEMENT FOR REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING FATIGUE I TESTING.....	70
FIGURE 8-21. GIRDER-TO-GIRDER JOINT ROTATION FOR REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING FATIGUE I TESTING	71
FIGURE 8-22. DAMAGE OF REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING STRENGTH TESTING.....	72
FIGURE 8-23. FORCE-DISPLACEMENT RELATIONSHIP FOR REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING STRENGTH TESTING.....	73
FIGURE 8-24. GIRDER LOAD DISTRIBUTION FOR REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN	73
FIGURE 8-25. MEASURED STRAINS OF LOADED GIRDER IN REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING STRENGTH TESTING.....	74
FIGURE 8-26. MEASURED STRAINS OF GIRDER B IN REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING STRENGTH TESTING .	75
FIGURE 8-27. MEASURED STRAINS OF TRANSVERSE REINFORCEMENT IN UHPC POCKETS OF REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING STRENGTH TESTING	75
FIGURE 8-28. MEASURED STRAINS OF TRANSVERSE REINFORCEMENT IN LMC CONTINUOUS JOINT OF REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING STRENGTH TESTING.....	76
FIGURE 8-29. MEASURED STRAINS OF JOINT LONGITUDINAL REINFORCEMENT IN REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING STRENGTH TESTING	76
FIGURE 8-30. GIRDER-TO-GIRDER JOINT RELATIVE DISPLACEMENT FOR REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING STRENGTH TESTING.....	77
FIGURE 8-31. GIRDER-TO-GIRDER JOINT ROTATION FOR REHABILITATED DOUBLE-TEE BRIDGE SPECIMEN DURING STRENGTH TESTING	77
FIGURE 8-32. TRANSVERSE CRACKS OF CONTINUOUS JOINT IN REHABILITATED DOUBLE-TEE BRIDGE.....	78
FIGURE 8-33. STIFFNESS DEGRADATION FOR DIFFERENT DOUBLE-TEE BRIDGES UNDER AASHTO FATIGUE II LOADING	80
FIGURE 8-34. STIFFNESS DEGRADATION FOR DIFFERENT DOUBLE-TEE BRIDGES UNDER AASHTO FATIGUE I LOADING	80

FIGURE 8-35. FORCE-DISPLACEMENT RELATIONSHIPS FOR LOADED GIRDERS OF DIFFERENT DOUBLE-TEE BRIDGES..... 81

FIGURE 8-36. JOINT PREPARATION FOR REHABILITATION..... 82

FIGURE 9-1. GEOMETRY REQUIREMENTS FOR PROPOSED UHPC POCKET JOINT REHABILITATION METHOD..... 86

FIGURE 9-2. DETAILING FOR PROPOSED UHPC POCKET JOINT REHABILITATION METHOD 87

FIGURE 9-3. GEOMETRY REQUIREMENTS FOR PROPOSED CONTINUOUS JOINT REHABILITATION METHOD..... 89

FIGURE 9-4. DETAILING FOR PROPOSED CONTINUOUS JOINT REHABILITATION METHOD..... 90

TABLE OF ACRONYMS

Acronym	Definition
AASHTO	American Association of State Highway and Transportation Officials
ABC	Accelerated Bridge Construction
ACI	American Concrete Institute
ADTT	Average Daily Truck Traffic
ASTM	American Society for Testing and Materials
BRM	Bridge Management Software
DOT	Department of Transportation
FEA	Finite Element Analysis
FHWA	Federal Highway Administration
ft	Foot/Feet
HPC	High Performance Concrete
hr	Hour/Hours
in.	Inch/Inches
kip	1000 pounds
klf	Kip per linear foot
ksi	kip per square inch
lb	Pound/Pounds
LRFD	Load and Resistance Factor Design
LMC	Latex Modified Concrete
LMC-VE	Very Early High Strength Latex Modified Concrete
MAP	Magnesium Ammonium Phosphate Grout
min	Minute/Minutes
MoDOT	Missouri Department of Transportation
MPC	Mountain Plains Consortium
SD	State of South Dakota, USA
SDDOT	South Dakota Department of Transportation
sec	Second
SDSU	South Dakota State University
TxDOT	Texas Department of Transportation
UHPC	Ultra-High Performance Concrete

Acronym	Definition
WSDOT	Washington State Department of Transportation
yd	Yards

1 EXECUTIVE SUMMARY

1.1 Introduction

Prefabricated bridge elements have become an essential part of Accelerated Bridge Construction (ABC), which is an emerging technology to expedite bridge construction. Among several prefabricated bridge girder types, precast prestressed double-tee girders are common on county bridges in South Dakota (SD) because of the ease of construction, the relatively short construction time, and the low overall cost.

The main goal of the present study was to explore different rehabilitation methods for existing double-tee girder bridges, since the long-term performance of the conventional double-tee longitudinal girder-to-girder joint detailing is not adequate. There are more than 700 double-tee bridges in SD that incorporate this type of joint detailing. A cost-effective longitudinal joint rehabilitation method for double-tee bridges is needed for implementation in SD. The proposed method should be simple in construction and improve the structural performance and durability of the joints.

1.2 Problem Description

Double-tee bridges are common on SD local roads. Conventional double-tee girder-to-girder joint detailing consists of discrete welded steel plate connections in a keyway filled with non-shrink grout. Based on the findings of a previous study at South Dakota State University (SDSU), bridges incorporating this detailing (which included all of the existing double-tee bridges at the time of this writing) may need rehabilitation or replacement. The problem is that longitudinal girder-to-girder joints are deteriorating rapidly and are insufficient, even for service loads (Wehbe et al., 2016). Several double-tee girders with only 40 years of service have been replaced because of this issue. A cost-effective, feasible, and structurally viable longitudinal joint rehabilitation method is needed to upgrade the existing double-tee bridges and to avoid girder or bridge replacement.

1.3 Research Work

Twenty joint rehabilitation detailing methods were proposed in the present study. Using a rating system adopted from the literature, four joints methods were selected for further investigation. Thirteen large-scale beams were tested to investigate the performance of the four selected rehabilitation methods. Ultra-high performance concrete (UHPC) and Latex Modified Concrete (LMC) were selected as the filler materials. Two joint rehabilitation methods, “pocket” and “continuous,” were developed based on the findings of the beam tests and an analytical study. Subsequently, a full-scale 40-ft long double-tee bridge, consisting of two interior girders, was constructed using the conventional longitudinal joint detailing then tested under 250,000 cycles of the AASHTO Fatigue II loading (equivalent to approximately 46 years of service), using a point load applied at the mid-span. The point load was offset in the transverse direction to maximize the joint shear demand. Furthermore, the conventional specimen was monotonically loaded to crack the longitudinal girder-to-girder joint.

Subsequently, the bridge was rehabilitated using two new details, “pocket” and “continuous,” each incorporated on one-half of the bridge length. The “pocket” joint consisted of discrete pockets reinforced with steel bars and filled with UHPC. A UHPC keyway was used to connect the pockets. The “continuous” joint was reinforced with wire mesh and filled with LMC. The rehabilitated specimen

was tested under fatigue and strength loading to evaluate the performance of the bridge and to obtain data to judge the suitability of the proposed joint rehabilitation alternatives. The specimen was first tested under 500,000 cycles of the AASHTO Fatigue II loading, which was equivalent to 91 years of service. Next, the joint was tested under an additional 100,000 cycles of the AASHTO Fatigue I loading to investigate the joint performance under higher demands. Stiffness tests with a load amplitude equal to the AASHTO Fatigue I loading were performed during the fatigue testing to monitor the degradation of the bridge. Finally, the specimen was monotonically loaded to failure.

1.4 Research Findings

Based on these analytical and experimental studies, the following conclusions can be drawn:

- Of 20 rehabilitation alternatives, those with continuous detailing are more durable.
- Thirteen large-scale beam tests showed that at least a 3-in. lap-splice is needed for joints with UHPC, and 5-in. lap-splice is needed for joints with LMC. The minimum splice length ensures bar fracture.
- Finite element analyses showed that the use of pocket detailing for the rehabilitation of double-tee bridge girder-to-girder joints is feasible. The joint geometry was optimized through the analytical study.
- The full-scale bridge test confirmed that the non-shrink grout used in the conventional longitudinal joint detailing cracks under the AASHTO Service I limit state loading. Therefore, current double-tee joint detailing is inadequate.
- Hammer-chipping was found to be a viable demolition method.
- Findings from the literature indicate that UHPC and LMC are durable materials. Therefore, these materials were included in the present experimental study. However, transverse shrinkage cracks and water leaks were observed in LMC of the continuous joint of the full-scale bridge before testing. The LMC shrinkage cracks were mainly due to a restrained boundary condition. The shrinkage cracks had no effect on the structural performance of the bridge, but it might cause durability issues if this material is incorporated in field. More durable filler materials such as UHPC may be used for the continuous detailing. No shrinkage cracks were observed for UHPC.
- Both rehabilitation longitudinal joint detailing, pocket and continuous, did not deteriorate through 500,000 cycles of the AASHTO Fatigue II loading and 100,000 cycles of the AASHTO Fatigue I loading. The rehabilitated bridge test specimen was subjected to a total of 110 years of service loads. The stiffness of the bridge remained constant throughout the fatigue testing.
- The first flexural crack in the stem of the loaded girder of the rehabilitated bridge was observed at 53.8 kips, which was higher than the Service I limit state of 51 kips.
- The rehabilitated bridge load carrying capacity of 113.9 kips was higher than the AASHTO Strength I limit state of 89 kips, indicating sufficient performance for the rehabilitated joints. The strength capacity of the rehabilitated specimen was 1.5 times higher than a conventional reference double-tee bridge test specimen.

- The force-displacement relationship of both girders of the rehabilitated bridge was essentially the same throughout strength testing, indicating monolithic behavior.
- No structural damage or yielding of the reinforcement was observed in both joint rehabilitation details during the strength testing.
- The failure mode of the rehabilitated bridge was crushing of concrete in the deck of both girders at 9.55 in. of displacement in a ductile manner. No damage of rehabilitated joints was observed at the girder failure.
- The rehabilitation cost of the pocket and continuous joint detailing for a 40-ft long, 30.6 ft wide double-tee bridge is respectively only 26% and 53% of the superstructure replacement cost of the same bridge.

Overall, both proposed rehabilitation methods are structurally viable. However, the UHPC pocket alternative is the cheapest and the most durable solution to extend the service life of double-tee bridge longitudinal joints for another 75 years.

1.5 Recommendations

Based on the findings of this study, the research team offers the following recommendations.

1.5.1 Recommendation 1: General

Longitudinal joints of prestressed double-tee girder bridges with a girder depth of 23 in. may be rehabilitated using the preparation and construction detailing specified in the following sections.

Experimental and analytical studies were performed only on 23-in. deep double-tee girder bridges because they are more common than 30-in. deep double-tee girder bridges in South Dakota.

1.5.2 Recommendation 2: Rehabilitation Methods

Both “pocket” and “continuous” detailing should be allowed for the rehabilitation of longitudinal joints of double-tee girder bridges.

Two methods for the rehabilitation of double-tee bridge longitudinal joints can be used in field: (1) “pocket” detailing in which discrete pockets reinforced with steel bars are formed and then are connected together through a longitudinally reinforced shear key, and (b) “continuous” detailing in which a continuous longitudinal joint is reinforced with wire mesh. The use of the pocket detailing method is more economical than the continuous detailing method. The pocket rehabilitation detailing cost is expected to be approximately 30% of double-tee bridge superstructure replacement cost.

1.5.3 Recommendation 3: Joint Preparation for Rehabilitation

The guidelines as detailed in Sec. 9.1 should be adopted for the preparation of longitudinal joints of double-tee girder bridges to be rehabilitated using either “pocket” or “continuous” detailing.

The joint preparation method described in Sec. 9.1 of the present report was exercised during the rehabilitation of a full-scale 40-ft long double-tee bridge test specimen. A contractor was hired to rehabilitate the bridge longitudinal joint. The proposed method of joint preparation was found simple and practical. The preparation for the pocket joints was faster and less involved compared to the continuous joint preparation.

1.5.4 Recommendation 4: Pocket Rehabilitation Method

The guidelines as detailed in Sec. 9.2.1 should be adopted for the rehabilitation of longitudinal joints of double-tee girder bridges using “pocket” detailing. Only Ultra-High Performance Concrete (UHPC) should be used as the joint filler material.

The rehabilitation of longitudinal joints of double-tee girder bridges incorporating “pocket” detailing should be performed in accordance to the requirements proposed in Sec. 9.2.1. The full-scale testing of a 40-ft long double-tee bridge in which its longitudinal joint was rehabilitated using UHPC filled pocket detailing showed that this rehabilitation method is viable and can meet all current AASHTO LRFD (2013) requirements. Other cementitious materials such as non-shrink grout, fiber reinforced grout, or Latex Modified Concrete (LMC) should not be used as the joint filler material due to durability issues.


1.5.5 Recommendation 5: Continuous Rehabilitation Method

The guidelines as detailed in Sec. 9.2.2 should be adopted for the rehabilitation of longitudinal joints of double-tee girder bridges using “continuous” detailing. Only Ultra-High Performance Concrete (UHPC) should be used as the joint filler material.


The rehabilitation of longitudinal joints of double-tee girder bridges incorporating “continuous” detailing should be performed in accordance to the requirements proposed in Sec. 9.2.2. The full-scale testing of a 40-ft long double-tee bridge in which its longitudinal joint was rehabilitated using LMC filled continuous detailing showed that this rehabilitation method is structurally viable meeting all current AASHTO LRFD (2013) requirements but LMC exhibited deep shrinkage cracks with water seepage. Except UHPC, any other cementitious materials such as non-shrink grout, fiber reinforced grout, or LMC should not be used as the joint filler material due to durability issues.

2 PROBLEM DESCRIPTION


The conventional joint detailing currently used for double-tee girders in South Dakota (SD) utilizes discrete welded connections spaced every 5 ft along the length of the bridge and embedded in a shear key filled with non-shrink grout (Figure 2-1).

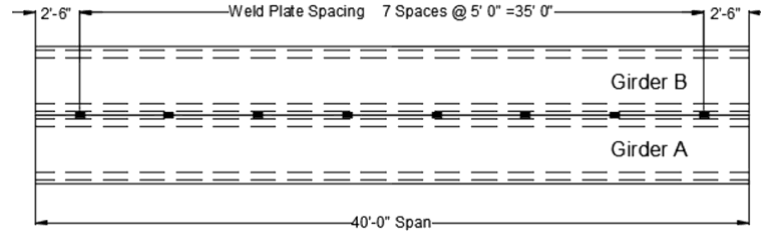

a. Plan View of Conventional Double-Tee Bridge Girder

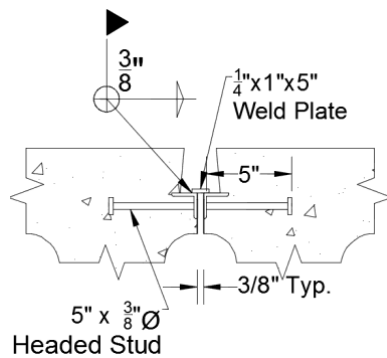


b. Section Detail of Welded Connection

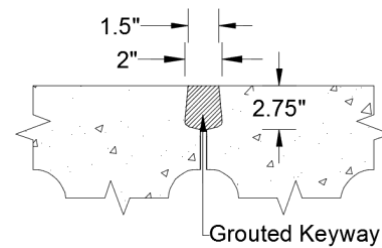

c. Section Detail of Grouted Keyway

Figure 2-1. Conventional Double-tee Girder Longitudinal Joint Detail (after Konrad, 2014)

A common problem with the existing double-tee bridges is the deterioration of the girder longitudinal joints. The inspection of bridges built less than 40 years ago has revealed that there are large reflective cracks along these joints causing corrosion of the reinforcement as well as the welded connections. The corrosion expedited the double-tee girder's rate of deterioration (Fig. 2-2).

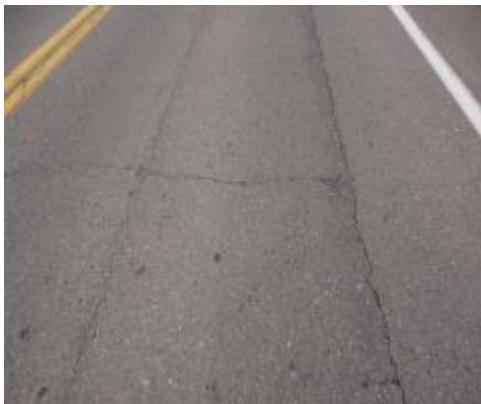

a. Reflective Cracking of Asphalt Overlay



b. Spalling and Corrosion from Underside of a Girder

Figure 2-2. Reflective Cracking and Deterioration of Double-Tee Girder Bridges (Konrad, 2014)

Wehbe et al. (2016) experimentally investigated the behavior of a full-scale conventional double-tee bridge under fatigue and strength loading (Fig. 2-3). The bridge test specimen consisted of two, 40-ft long interior double-tee girders connected longitudinally using the conventional joint detailing discussed above. The fatigue test was carried out by applying a 21-kip half-cycle loading at a frequency of one cycle per second to the mid-span with a slight offset to maximize the shear force demand on the joint. The strength testing was done by applying an increasing monotonic loading to the girders to failure. Water leaked through the girder-to-girder joint at a load cycle of 19,500 during the fatigue testing (equivalent to 3.5 years of service). The welded connections failed near the mid-span at 62,000 cycles of the fatigue loading (equivalent to 11 years of service). Furthermore, the two girders acted as individual members under the strength testing, indicating that the girder-to-girder joint is the weak link in the system. The study concluded that the current double-tee joint detailing is insufficient to meet current AASHTO service, fatigue, and strength limit state requirements.



Figure 2-3. Full-Scale Conventional Double-Tee Girder Test Specimen (after Konrad, 2014)

Currently, there are hundreds of double-tee bridges in SD utilizing conventional girder-to-girder joint detailing. A robust and cost-effective rehabilitation technique for double-tee longitudinal joints may extend the life of those bridges and provide long-term economic benefit to local governments. The present study was performed to identify potential rehabilitation methods and to assess their constructability, structural performance, and durability for implementation in SD.

3 RESEARCH OBJECTIVES

3.1 Review and Evaluate Longitudinal Joint Rehabilitation Methods

Twenty joint detailing alternatives for the rehabilitation of the longitudinal joint of double-tee girder bridges were proposed in the present study based on an extensive literature review. Of the 20 alternatives, continuous joint details were selected for further study since they are more durable than rebar dowel connections by minimizing the number of cold joints.

A rating system was adopted from the literature and was modified to identify the best rehabilitation alternatives (refer to Ch. 6 for more discussion on the rating system). The results from the rating showed that four of the 20 alternatives were favorable for further testing. Thirteen large-scale beam tests were carried out to investigate the performance of the selected joint rehabilitation details and to select the best for full-scale bridge testing. Subsequently, two joint rehabilitation concepts, “pocket” and “continuous,” were developed and analytically investigated using linear-elastic finite element analyses to optimize the selected joint detailing (refer to Ch. 6).

The proposed continuous and pocket joint rehabilitation details generally consist of exposing the transverse reinforcement of the deck (flange of double-tee girders), lap-slicing the double-tee flange wire mesh with new reinforcement, and using a filler material to complete the joint. Ultra-high performance concrete (UHPC) and latex modified concrete (LMC) were selected as the filler materials because of their improved strength and durability.

3.2 Test Longitudinal Joint Rehabilitation Detailing

A full-scale 40-ft long double-tee bridge consisting of two interior girders was constructed using the conventional longitudinal joint detailing. The bridge was then tested under 250,000 cycles of the AASHTO Fatigue II (AASHTO LRFD, 2013) loading using a point load applied at the mid-span (equivalent to 46 years of service). The point load was offset in the transverse direction to maximize the joint shear demand. Furthermore, the conventional specimen was monotonically loaded to crack the longitudinal girder-to-girder joint. Subsequently, the bridge was rehabilitated using the two proposed details, “pocket” and “continuous,” each incorporated on the one-half of the bridge length. The “pocket” joint consisted of discrete pockets reinforced with steel bars and filled with UHPC. A UHPC keyway was used to connect the pockets. The “continuous” joint was reinforced with wire mesh and filled with LMC.

The rehabilitated specimen was tested under fatigue and strength loading to evaluate the performance of the bridge and to obtain data in order to judge the suitability of the proposed joint rehabilitation alternatives. The specimen was first tested under 500,000 cycles of the AASHTO Fatigue II loading (equivalent to 91 years of service). Next, the bridge was tested under additional 100,000 cycles of the AASHTO Fatigue I loading (equivalent to 18 years of service). Stiffness tests were performed to monitor the degradation of the bridge during both types of fatigue testing. Finally, the specimen was monotonically loaded to failure.

3.3 Recommend Longitudinal Joint Rehabilitation Detailing

The feasibility and performance of two rehabilitation methods were investigated in the present study: (1) discrete pockets filled with UHPC and reinforced with steel bars, and (2) continuous joints filled

with LMC and reinforced with wire mesh. Of the two methods, only the UHPC pocket joint was found to be both structurally viable and durable. Even though the LMC continuous joint was structurally viable, it showed shrinkage cracks prior to testing, which may lead to serious durability issues in the field. Therefore, only the UHPC filled pocket joint detailing was recommended for the rehabilitation of double-tee bridge longitudinal joints. Continuous joint detailing may be accepted for field applications if the joint is filled with UHPC. Nevertheless, cost of the pocket detailing is minimal compared to the continuous joint detailing and the girder replacement.

4 TASK DESCRIPTIONS

The research work presented in this report was comprised of thirteen tasks. This chapter presents a description of activities performed in each task. Each section of this chapter covers one task of the project.

4.1 Meet with Technical Panel

Task 1: Meet with the technical panel to review project scope and work plan.

The first technical panel meeting was held on October 8, 2015. The research team presented the project scope and work plan, along with a preliminary literature review and a few potential rehabilitation alternatives. Presentation slides were uploaded on the SDDOT FTP research site.

4.2 Interview SDDOT and Construction Company Personnel

Task 2: Interview SDDOT and construction company personnel in South Dakota for feasible rehabilitation concepts.

A meeting with Journey Construction was held in October 2015 in Sioux Falls to discuss the feasibility of potential rehabilitation methods. Both continuous and pocket options were identified as constructible alternatives. A preliminary rehabilitation cost was provided by the company for comparison with a replacement cost.

4.3 Review Bridge Inspection Data

Task 3: Review bridge inspection data, including condition, pavement type, location, and chloride use, for in-service double-tee bridges in South Dakota.

The SDDOT provided access to the BrM bridge management website. This database was reviewed to collect condition information for double-tee bridges. The bulk of data in BrM was not sufficient to conclusively comment on which bridges are in immediate need of repair, but an empirical equation was proposed based on the previous test data to identify those bridges (see Sec. 5.1).

4.4 Perform Literature Review

Task 4: Perform literature review for possible concepts for rehabilitating the longitudinal joint, including joint designs, construction methods, and estimated cost for each method.

The research team conducted a comprehensive literature review on the design and performance of longitudinal joints and filler materials in new construction. No study was found on the rehabilitation of the longitudinal joint of existing precast members. Based on the findings of the literature review, 20 feasible rehabilitation detailing alternatives were developed and were evaluated using a rating system, which included constructability, durability, performance, inspectability, and cost. Chapter 5 includes a summary of the findings of the literature review, and Chapter 6 includes the results of the joint rehabilitation alternative rating.

4.5 Prepare Technical Memorandum Summarizing Tasks 1 To 4

Task 5: Prepare and submit a technical memorandum that describes existing double-tee bridges by age, condition, and sufficiency rating notes, proposes feasible rehabilitation methods, estimates implementation costs, and recommends rehabilitation on double-tee bridges where applicable.

A technical memorandum was prepared and submitted on February 9, 2016 to the technical panel for review. The memorandum included the results of Tasks 2 through 4. Since the bulk of information in the literature was not sufficient and the result of rating was not conclusive to identify the best joint rehabilitation detailing, an experimental program on large-scale beams was included in the report for the purpose of obtaining project panel feedback and approval. The report was reviewed by the panel, and a response to the panel was submitted. The final document was incorporated in the present report. The report and the response were uploaded on the SDDOT FTP research site.

4.6 Meet with Technical Panel

Task 6: Meet with the project technical panel to discuss the results of the literature review and technical memorandum and have the panel decide which concept(s) to advance to the testing phase.

A meeting with the technical panel was held on June 14, 2016 to discuss the findings of Tasks 2 through 5. Since the technical panel had approved the beam testing plan proposed in the technical memorandum (Sec. 4.5), the research team tested all the large-scale beams prior to this meeting. The findings of the beam tests were included in the presentation. Furthermore, two rehabilitation methods, pocket and continuous, were proposed for full-scale double-tee system testing based on the findings of all tasks. In addition, the panel approved the research team's proposed analytical program to optimize the detailing of the "pocket" rehabilitation method through finite element analyses.

It is worth mentioning that the construction of two 40-ft double-tee girders were completed prior to this meeting since the size and detailing of the double-tee girders must have matched with those tested in the previous study at South Dakota State University (SDSU) (see Sec. 4.10) for comparison. The construction details and stages were discussed in this meeting. Presentation slides were uploaded on the SDDOT FTP research site.

4.7 Prepare Technical Memorandum with Joint Designs, Construction Methods, and Instrumentation and Testing Plans

Task 7: Prepare a technical memorandum detailing joint designs, construction methods, and a complete instrumentation and testing plan for technical panel review.

A comprehensive testing plan for conventional and rehabilitated double-tee bridge specimens, including the joint rehabilitation detailing, instrumentation plan, test setup and procedure, loading protocol, and testing schedule was prepared and presented to the technical panel in two meetings held on June 14, 2016 and December 6, 2016. The panel approved the proposed testing plan in the meetings; thus, no technical memorandum was submitted under this task. Presentation slides for both meetings were uploaded on the SDDOT FTP research site.

4.8 Construct and Instrument Test Specimens

Task 8: Upon approval of the plan by the technical panel, proceed with construction and instrumentation of test girders, providing the technical panel at least two weeks' notice to allow technical panel members to observe the construction and instrumentation.

Two 40-ft long double-tee girders with conventional longitudinal joint detailing were constructed at the Forterra facility in Mitchell, South Dakota (SD). The girders were instrumented with strain gauges to measure the effective post-tensioning forces during construction. After shipping the double-girders to the Lohr Structures Laboratory at SDSU, load cells, displacement transducers, and additional strain gauges were utilized to measure the local and global response of both the conventional or rehabilitated bridge specimen. Instrumentation and construction of the test girders are discussed in Chapter 7 of the present report.

4.9 Perform Fatigue and Ultimate Tests

Task 9: Perform ultimate and fatigue loading of rehabilitated girders, providing the technical panel at least two weeks' notice to allow technical panel members to observe the testing.

The conventional double-tee specimen was first tested under fatigue loading. Subsequent to a monotonic testing to crack the conventional longitudinal joint at the end of the fatigue testing, the bridge was rehabilitated using the proposed methods. Then the bridge was tested under both fatigue and strength loading. The loading protocols were the same as those in the previous double-tee bridge tests at SDSU (Wehbe et al., 2016) used for comparison.

The technical panel was notified ahead of time of the testing schedule. Detailed information on the experimental work is presented in Chapter 7 of this report.

4.10 Compare Test Results

Task 10: Compare test results to results of the original and improved joint designs of SD2013-01 to draw conclusions on constructability, structural performance, and cost.

The experimental results from the conventional and rehabilitated test specimens were analyzed and evaluated in terms of system performance, constructability, and costs. Force-displacement relationship, stiffness degradation under AASHTO fatigue loading, observed damage, strain profiles, and joint rotations and slippage were discussed. Detailed information on the experimental results is presented in Chapter 8 of this report.

Furthermore, the research team met with the technical panel on May 24, 2017 and presented a summary of the results, rationale, and proposed construction guidelines. Presentation slides were uploaded on the SDDOT FTP research site.

4.11 Prepare Marketing Brochure

Task 11: Prepare a marketing brochure for local government highway officials including rationale for rehabilitation, guidance for determining when rehabilitation is appropriate, and a description of how rehabilitation is achieved.

A marketing brochure was prepared for local government highway officials. The brochure includes the need for rehabilitation and step-by-step construction guidelines to rehabilitate the longitudinal

joints of double-tee bridges. Chapter 9 of this report includes the joint rehabilitation guideline. A copy of the brochure was uploaded on the SDDOT FTP research site.

4.12 Prepare Final Report

Task 12: In accordance with Guidelines for Performing Research for the South Dakota Department of Transportation, prepare a final report and executive summary of the research methodology, findings, conclusions, and recommendations.

The present report is a comprehensive final report prepared by the research team according to SDDOT guidelines. The report documents all aspects of the project and lists recommendations on implementation of the alternative systems.

One additional document (Bohn, 2017) was included with the present report in case in-depth discussion of some subject matter is needed.

4.13 Make an Executive Presentation

Task 13: Make an executive presentation to the SDDOT Research Review Board at the conclusion of the project.


The research team made an executive presentation to the SDDOT Research Review Board on August 30, 2017.

5 LITERATURE REVIEW


The literature was reviewed to identify rehabilitation methods for girder-to-girder joints of precast members. In this chapter, a review of conventional double-tee bridge joint detailing is presented first. Second, the number of South Dakota (SD) double-tee bridges is presented with respect to their age. Third, a simple equation to identify bridge candidates for joint rehabilitation is introduced based on full-scale test data. Fourth, a summary of the findings of the literature review on precast member joint detailing and joint filler materials is presented.

5.1 Conventional Double-Tee Longitudinal Joints


Conventional double-tee longitudinal joint detailing (Fig. 5-1), which is common in SD, utilizes discrete welded steel plate connections spaced every 5 ft (Fig. 5-1b) and grouted longitudinal keyways (Fig. 5-1c) to complete the girder-to-girder connections.

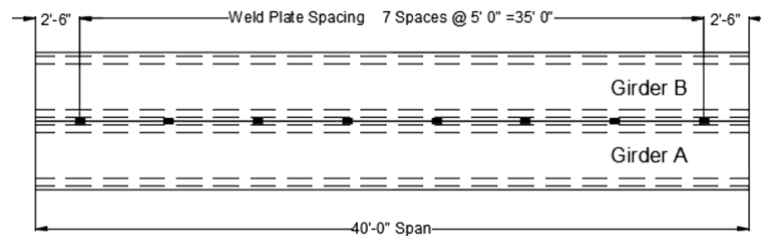

a. Plan View of Conventional Double-Tee Bridge

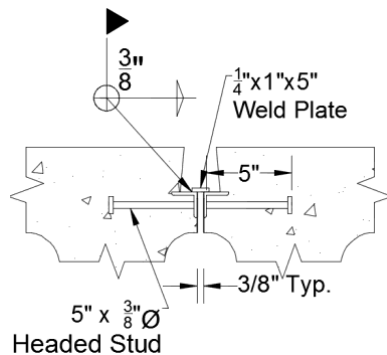

b. Section Detail of Welded Connection

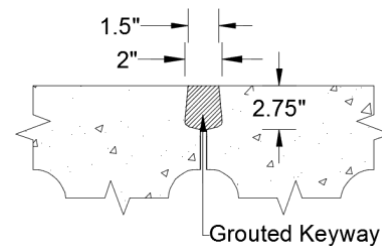

c. Section Detail of Grouted Keyway

Figure 5-1. Conventional Double-tee Girder Longitudinal Joint Detail (after Konrad, 2014)

A common problem with existing double-tee bridges is the deterioration of the girder longitudinal joints. The inspection of bridges built less than 40 years ago has revealed that there are large cracks along these joints causing corrosion of reinforcement, as well as corrosion of welded connections, thus expediting the rate of deterioration of the double-tee girders (e.g. Fig. 2-2). Previous experimental studies by Wehbe et al. (2016) showed that the current joint detailing is insufficient to meet AASHTO limit state requirements.

5.2 South Dakota Double-Tee Bridges

A database of SD bridges is available through Bridge Management software (BrM), which generally includes bridge location, geometry, age, and condition. This software was used to collect information

on double-tee bridges. More than 750 in-service double-tee bridges were identified. Figure 5-2 shows the age distribution of these bridges with a majority of them from 20- to 45-year old.

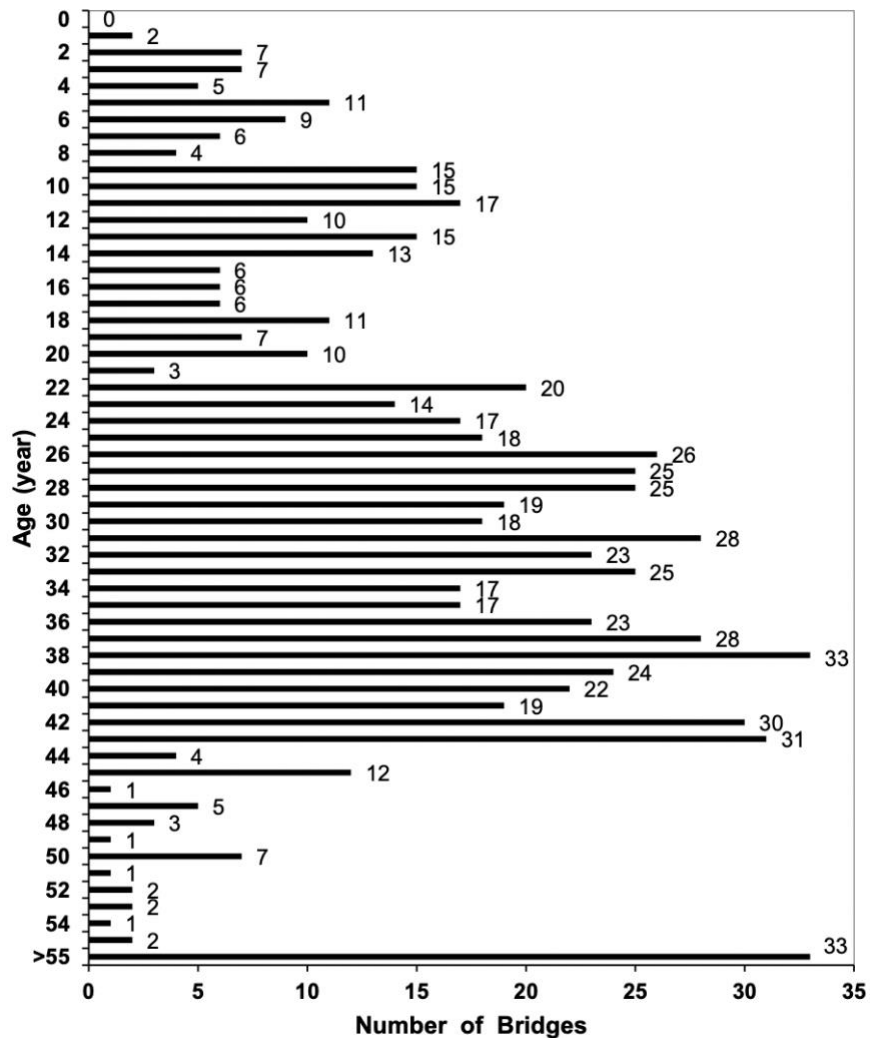


Figure 5-2. South Dakota Double-Tee Bridge Age Distribution

5.2.1 Identification of Double-Tee Bridges for Joint Rehabilitation

At the time of this writing, the BrM database for double-tee bridges is limited to general information that cannot help in identifying the level of damage of girder-to-girder joints. It is not feasible, therefore, to comment which double-tee bridge is in immediate need of joint rehabilitation using BrM database. An extensive research is needed to review all inspection reports to identify double-tee bridges in need of rehabilitation, which is beyond the scope of this project. Nevertheless, a simple equation was developed to further help bridge engineers and owners to identify potential double-tee bridges in which the girder-to-girder joint is most likely damaged and needs rehabilitation.

Based on the full-scale double-tee bridge test data, the number of cycles to fail a girder-to-girder welded connection in the conventional joint detailing under the fatigue loading was 62,000 (Wehbe and Konrad, 2016). Therefore, it is feasible to estimate the year in which welded connections of

double-tee girders fail. Equation 5-1 shows the estimated year of rehabilitation need for longitudinal joints of double-tee bridges in SD:

$$\text{Year to Rehabilitate Double-Tee Bridge Longitudinal Joints} = 170 / ADTT \quad (\text{Eq. 5-1})$$

where *ADTT* is the average daily truck traffic. Beckemeyer and McPeak (1995) provided *ADTT* values for three road types in SD with different traffic volumes: low (15), medium (50), and high (200). For example, a double-tee bridge with an *ADTT* of 15 probably needs joint rehabilitation after approximately 11 years of service. Note Wehbe and Konrad (2016) assumed *ADTT*=15 for double-tee bridges located on SD local roads.

5.3 Continuous Longitudinal Joints

The Texas Department of Transportation (TxDOT) frequently uses double-tee girders on many of the state medium span bridges where construction speed is a concern. Reflective cracking along the joint was the TxDOT’s concern. The connection detailing used in Texas in 2001 consisted of discrete welded connections anchored into the concrete with a headed stud every 5 ft. Jones (2001) conducted a study for TxDOT to investigate the behavior of the existing joint detailing and to study the feasibility of different double-tee girder-to-girder joints under distributed wheel loads. Two longitudinal connections (Fig. 5-3) were studied by Jones (2001): “simple” and “continuous.”

- The “simple” detail consisted of 0.5-in. steel plates anchored in the precast concrete and connected by a 1-in. diameter bar welded to the steel plates spaced every 5 ft. The narrow shear key was grouted from the top of the bridge.
- The “continuous” detail had reinforcement extending out of the double-tee girders into a joint between adjacent girders. The joint was filled with grout.

The “simple” connection detail was determined to be the most cost-effective alternative. Subsequently, the “simple” detail was tested for static and fatigue loading. Vehicle loads of 16 kips to a peak of 24 kips were applied to the specimen for a total of 1.5 million cycles. Overall, no sign of failure and degradation was reported.

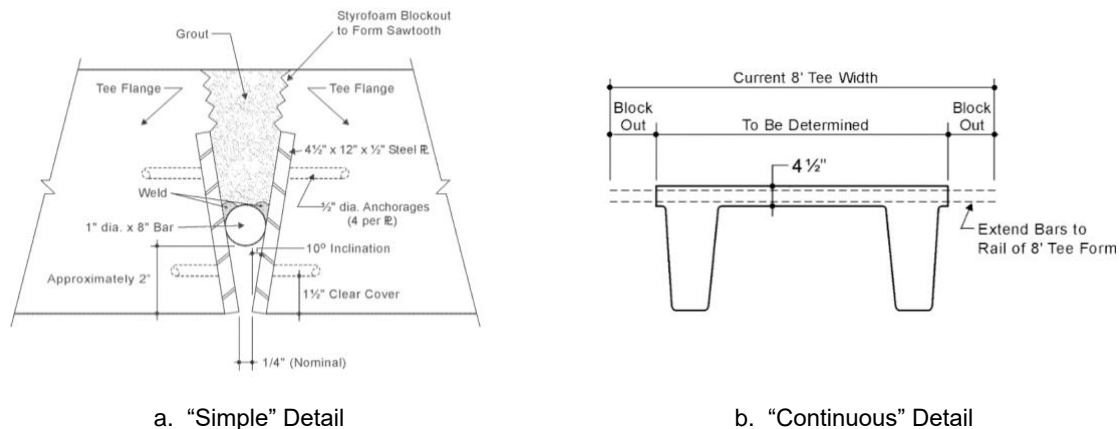


Figure 5-3. Recommended Longitudinal Joint Detailing (after Jones, 2001)

Graybeal (2010) tested six specimens in which precast deck panels were connected through continuous joints filled with ultra-high performance concrete (UHPC). The UHPC is an advanced

cementitious material developed in recent decades with superior properties such as higher strength, better durability, and improved ductility over conventional concrete. The UHPC also provides an excellent bond to the reinforcement as well as the existing concrete. Graybeal’s research was focused on the performance of the longitudinal and transverse connections under both fatigue and static wheel loads. The connections were fabricated utilizing straight lapped bars, headed bars, and intersecting hoop bars. Four specimens were built with transverse joints and two with longitudinal joints. Headed and straight bars were incorporated in the longitudinal connections (Fig. 5-4). Each specimen consisted of a female-female diamond shaped shear key that was 6-in. wide at the top and bottom. The lap-splices for the headed bar, the hooped bar, and the straight bar specimens were respectively 3.5, 3.9, and 5.9 in. Cyclic loads were applied using a servo-hydraulic controlled actuator with a load frequency of 6 Hz. A sinusoidal loading protocol was used to apply 2 and 16-kip forces for two million cycles and 2 and 21.3-kip forces for the remaining cycles to failure.

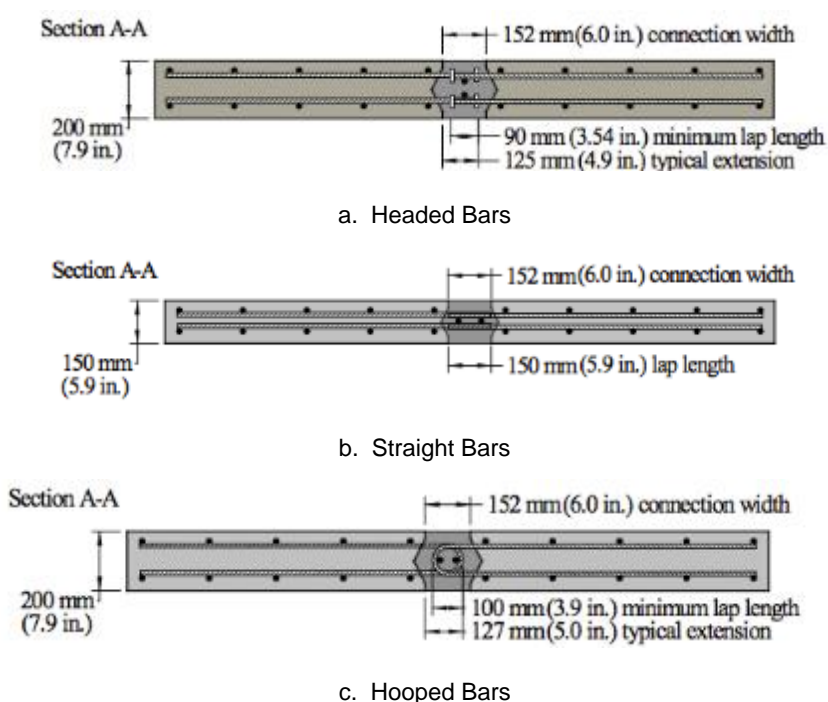


Figure 5-4. UHPC-Filled Deck Panel-to-Panel Longitudinal Joint Detailing (after Graybeal, 2010)

The specimens with the headed bar in the longitudinal connection withstood two million load cycles under 2- and 16-kip loads and nearly seven million cycles of 2- and 21.3-kip loads. Throughout the cyclic testing, no cracks or leaks were observed in the UHPC connections. The same result was observed for the longitudinal joints with the straight bars. However, additional cyclic loading was applied to fail the specimen. More than 10.5 million load cycles were applied before the bar crossing the connection interface fractured (Fig. 5.5). No evidence was observed of bond failure of the UHPC to concrete or UHPC to rebar.



Figure 5-5. Failure of Longitudinal Deck Panel-to-Panel Joint with Straight Bars under Fatigue Loading (after Graybeal, 2010)

Konrad (2014) studied the fatigue performance of the SD conventional (Fig. 5-1) and the new double-tee girder-to-girders joints (Fig. 5-6) through full-scale testing of double-tee bridges. The concern was reflective cracking of the longitudinal joints that might affect the structural performance of the bridge superstructure. The experimental results, based on AASHTO fatigue loading, showed that the discrete welded steel connections were inadequate. Bridges are designed for a lifespan of 75 years. Nevertheless, the test result of the conventional bridge showed joint failure at 62,000 load cycles, equivalent to 11.3 years of service. Figure 5-7a shows the measured girder load-displacement relationship for the conventional specimen. The failure mode was the headed stud pulling out from the girders (welded connection failure) at approximately 70 kips. The relative deflection between the two adjacent girders showed the inability of the welded connections to transfer the shear between girders. In other words, the conventional longitudinal joints acted as pin connections early in the test. The new continuous joint detailing (Fig. 5-6) was tested for more than 800,000 load cycles with insignificant stiffness degradation. The load carrying capacity of the specimen with continuous joint (Fig. 5-7b) was 1.5 times greater than the conventional specimen. The bridge with the new joint detailing failed in flexure. The results showed that the proposed connection can provide adequate load path between the double-tee girders, and the deck system acts monolithically.


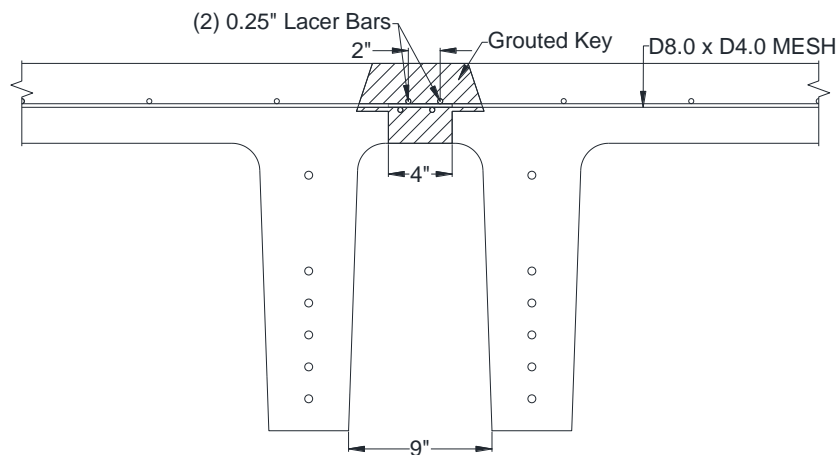


Figure 5-6. Continuous Joint Detailing for Double-Tee Bridges (after Konrad, 2014)

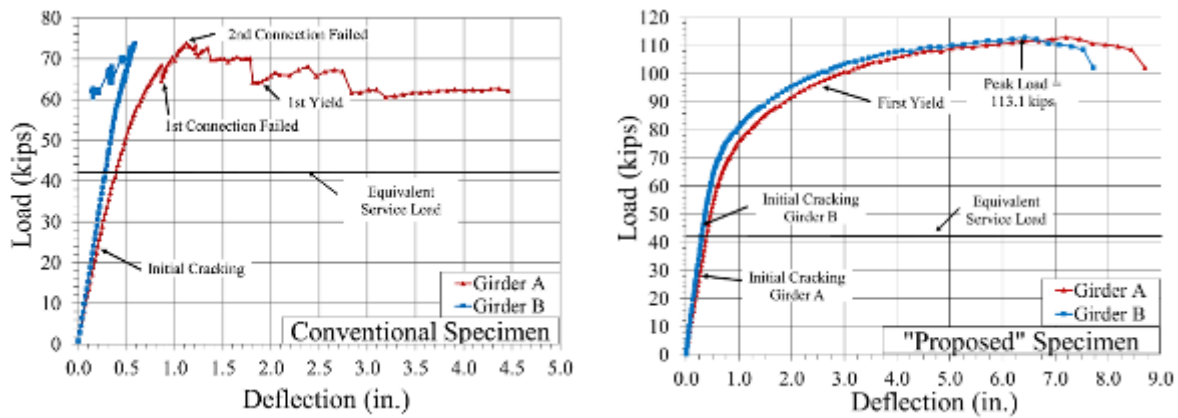

a. Conventional Double-Tee Bridge

b. Double-Tee Bridge with Continuous Joint

Figure 5-7. Measured Load-Displacement Relationship of Double-Tee Bridges under Strength Testing (after Konrad, 2014)

Haber and Graybeal (2014) performed a series of beam tests to better understand the performance of deck panel-to-panel connections under extreme demands. The test variables (Fig. 5-8) were grout type, lap splicing, reinforcement type, surface preparation, and keyway geometry. The loading protocols used for the beam specimens were cyclic crack loading, fatigue loading, and monotonic ultimate loading. The report concluded the following.

- Selection of grout material is critical for deck-level precast connections.
- Depending on the grout type, surface treatment can have significant impact on the bond strength.
- Shear key geometry had minimal effect on the deck panel connection performance.
- Exposing the aggregate was the best method to improve the bond strength.
- Non-shrink and magnesium phosphate grouts may lead to inadequate performance regardless of the surface preparation in terms of bond strength and cyclic loading.
- Epoxy grout and UHPC were found to be the best filler materials in terms of long-term performance and maintenance costs.

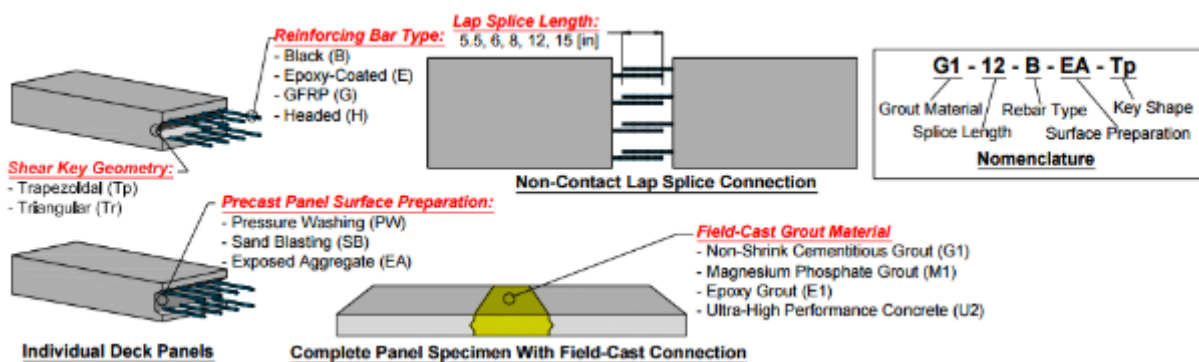


Figure 5-8. Test Variables Used for Precast Deck Panel Connections (after Haber and Graybeal, 2014)

Jones et al. (2016) performed a survey of state DOTs regarding practical longitudinal and transverse joints suitable for precast bridge panels. Thirty-two DOTs participated in the survey. The survey concluded the most common type of longitudinal connections among DOTs are UHPC-filled joints with spliced reinforcement, and post-tensioned joints filled with standard grout (Fig. 5-9). Also surveyed was damage of existing deck panel connections for both full-depth and partial-depth deck systems. The most common issues reported by the participants were cracking of filler materials and joint leakage.

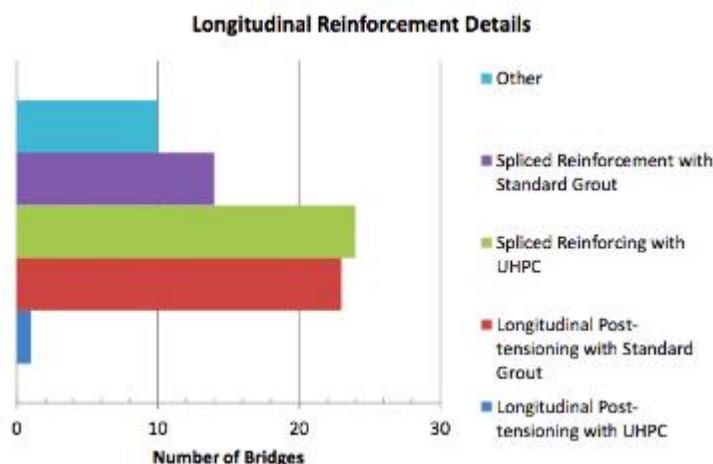


Figure 5-9. Survey Results for Various Longitudinal Joint Detailing (after Jones et al., 2016).

5.4 Dowel Bar Retrofit

One alternative to the continuous joint connection detailing, which might be used for the rehabilitation of double-tee longitudinal joints, is the use of the dowel bar retrofit technique that has been frequently utilized by many state DOTs on paved highways. The technique involves saw-cutting a small slot on both sides of the joint. The material is typically removed by hammer-chipping and cleaned by air-blasting. A smooth dowel is placed and the slot is then filled with a cement-based material.

Washington State DOT (WSDOT) has been using the dowel bar retrofit technique since 1992 to extend the lifespan of the pavement beyond the original intended 20 years. Since 1992, WSDOT has retrofitted over 225 miles of pavement using the dowel bar technique. The study by Pierce et al. (2002) was to investigate the performance, application, and lessons learned from the 10 years of service of the dowel bar retrofit. The report concluded that the overall performance of the dowel bar retrofit on Portland cement concrete was acceptable. However, the following issues were observed.

- Studded tire damage – accelerated wear from the use of studded or chained tires.
- Longitudinal cracking, cracks that intersect dowel bar pockets, typically occur where dowel bar is placed over an existing longitudinal crack. Failure mode was de-bonding of the filler material from substrate.
- 45-degree cracking caused by one or both of the following.
 - Saw cutting too deeply where the dowel bar is located below mid-depth of the slab.

- The use of heavy jackhammers that punch through the bottom of the slots during removal (deep damage in the slab or pavement).
- Spalling caused by misalignment of the core board. The core board intent is to re-establish the existing transverse joint and allow for expansion of the filler material.

The study concluded that construction inspection is the primary factor in successful execution of dowel bar retrofit. Furthermore, one of the most critical parts of the process is the saw-cutting of the slots to remove the concrete.

The dowel bar retrofit was suggested to be a viable option in the rehabilitating of concrete pavement. The use of the dowel bar retrofit technique on the rehabilitation of deck longitudinal joints, however, may be impractical since the deck main reinforcement may be cut.

5.5 Joint Filler Material

5.5.1 Ultra-High Performance Concrete (UHPC)

UHPC refers to a class of advance cementitious composite material with very fine aggregates and steel fibers. In comparing UHPC to other conventional cement-based materials, UHPC exhibits superior properties such as strength, durability, and long-term performance. The UHPC uses a very low water-to-cement ratio along with an optimized matrix. The UHPC can provide an excellent bond with reinforcement as well as the existing substrate; thus, it significantly shortens the development length of reinforcing bars. Table 5-1 provides UHPC typical mix design, and Table 5-2 presents UHPC typical mechanical properties.

Table 5-1. UHPC Typical Mix Design (Graybeal, 2010)

Material	Percent by Weight
Portland Cement	28.5
Fine Sand	40.8
Silica Fume	9.3
Ground Quartz	8.4
Superplasticizer	1.2
Steel Fibers	6.2
Water	5.2

Table 5-2. UHPC Typical Mechanical Properties (Graybeal, 2010)

Properties	Average Value
Compressive Strength	18.3 ksi
Modulus of Elasticity	6,200 ksi
Split Cylinder Cracking Strength	1.3 ksi
Prism Flexure Cracking Strength	1.3 ksi
Direct Tension Cracking Strength	0.8-1.0 ksi
Long-Term Shrinkage	555 micro-strain
Chloride Ion Penetrability	360 coulombs
Freeze-Thaw Resistance	112%

Swenty and Graybeal (2013) investigated different field-cast materials that might be considered to complete the connection between precast bridge members. The insufficient performance of connections between precast bridge members generally can be attributed to the filler material and the joint detailing. The research consisted of a series of tests investigating constructability, material properties, and bond strength for nine joint filler materials. The report concluded that UHPC is a better filler material because of the following:

- Sufficient strength,
- Good workability,
- High tensile strength,
- High modulus of elasticity,
- Excellent durability, and
- Lower cost compared to epoxy grouts.

Graybeal (2014) discussed 30 projects in which UHPC was incorporated in precast bridge deck connections. Currently AASHTO requires a minimum development length of 24 times the bar diameter (d_b) for the joint lap splicing. The UHPC, however, substantially reduces the development length (e.g. $8d_b$ is sufficient to fracture the bar) compared to that of conventional concrete or grout, resulting in smaller joints. This reduces the cost for reinforcement, fabrication, and field assembly.

Examples of UHPC proprietary products are these: BCV, BSI, Cor-Tuf, CRC, Densit, and Ductal. The performance and workability of UHPC decreases when UHPC mix temperature is high. The UHPC can be mixed and placed using conventional methods. Finishing of UHPC is usually done in a closed form to avoid losing moisture.

5.5.2 Latex Modified Concrete (LMC)

Bridge deck deterioration is a problem when salts are used to de-ice roads. De-icing agents contribute to the corrosion of the reinforcement in the bridge deck. The use of latex in concrete resists the penetration of water and salts, and it improves the bar bond with the existing concrete. Latex is an additive to concrete mixes to reduce the amount of water required to achieve adequate workability for placement. The lower water content increases the compressive strength of concrete. The latex

forms an elastic membrane within the concrete matrix, reducing the number of voids and micro-cracks. Also, the flexural strength and abrasion resistance are improved using latex (BASF, 2011).

Wenzlick (2006) examined the suitability of very high-early strength latex modified concrete (LMC-VE) for the repair of bridge decks in Missouri. A trial repair was conducted on I-70 near downtown St. Louis to verify how well the process of quick repair would work. Compressive tests performed on cylinders of LMC-VE showed that the strength was 3,000 psi in three hours and 6,000 psi in three days. Chlorine penetration was 100 coulombs, which is negligible. The study reported that two other projects in St. Louis County and St. Charles County, Missouri, utilized LMC-VE. Based on the cost difference of 25% to 53% between regular LMC and LMC-VE, respectively, MoDOT recommends using LMC-VE on bridge deck repairs in the area of extreme traffic congestion.

The durability of longitudinal joints is a concern for connections between precast bridge girders. The longitudinal joints may exhibit reflective cracking, which leads to moisture and chlorine corrosion of the reinforcement. Baer (2013) proposed LMC as a closure material with a better durability. The LMC was selected because of the high bond to the existing concrete and its familiarity to contractors and designers. The objective of the study was to determine the performance of LMC as closure material for a new longitudinal joint connection that features a continuous detailing with spliced reinforcement. The latex modifier used in this project was Styron Mod A/NA, which was a preapproved modifier for the South Carolina Department of Transportation (SCDOT). Eclipse 4500 shrinkage reducing admixture was used to reduce the drying shrinkage. The test mixture was designed for 6,000 psi compressive strength and exhibited adequate workability (slump of 5 in.). Table 5-3 presents three different mix designs for LMC utilized by Baer (2013).

Table 5-3. LMC Typical Mix Design (Baer, 2013)

Mix Designs	CPTM-1	CPTM-2	CPTM-3
W/C ratio	0.33	0.33	0.28
Coarse Aggregate (lb/yd ³)	1,720	1,260	1,260
Fine Aggregate (lb/yd ³)	1,048	1,505	1,596
Latex Modifier (lb/yd ³)	208	208	208
Air Entrainer (fl oz/yd ³)	1.5	1.5	1.5
Super Plasticizer (fl oz/yd ³)	24.4	0	0
Water Reducer (fl oz/yd ³)	15	15	15
Shrinkage Reducer (lb/yd ³)	11.55	11.55	11.55

Shrinkage tests were performed at 28 days with a length change of 0.02 % to 0.025%. The connection with LMC was exposed to two million cycles of fatigue loading. No crack was observed in the joint. The study concluded that LMC is a viable filler material for longitudinal joints for precast bridge girders.

5.5.3 Other Filler Materials

Champa et al. (1995) studied different grout materials for keyway joints between adjacent box beams, voided slabs, and bulb-tees. A standard non-shrink grout and Magnesium Ammonium Phosphate (MAP) mortar were selected for testing. The MAP grout was found to be a better filler material compared to conventional grouts for use in bridge joint keyways because of:

- Better bond to substrate,
- Less permeability,
- Internal self-curing after moist curing,
- Better freeze-thaw durability, and
- Lower creep.

The study reported that MAP grout has been successfully implemented in several field applications involving bridge keyways.

Barde et al. (2006) studied the repair of concrete pavements with rapid-setting materials. These materials can be placed and cured in a short period of time. In recent years, many high-early strength repair materials have been developed, both generic and proprietary. The Barde et al. study explored materials with early high-strength and good durability. A total of 11 proprietary repair materials were selected for testing. Each material was extended with 3/8-in. pea-gravel and mixed per manufacturer's specifications. The specimens were tested for both strength and durability. The tests provided information on the initial set time, final set time, compressive strength, flexural strength, elastic modulus, shrinkage, and bond strength. The repair materials exhibited a wide range of properties. The study recommended the best repair material sources as Fox Industries FX-928, Chemrex SET45 Regular, and Sika Corporation SikaSet Roadway Patch 2000. Further testing for freeze-thaw and potential corrosion was recommended, however.

French, et al. (2011) evaluated filler materials that could potentially enhance the performance of longitudinal joints in precast bridge decks. The materials included in the study were sand-epoxy mortars, LMC, cement-based grouts, non-shrink cement grout, epoxy mortar grout, calcium aluminate cement mortar, methylmethacrylate polymer concrete, and polymer mortar. The study reported that epoxy grouts exhibit excellent strength and durability with high strength (20 ksi in 6 hours), low shrinkage, and low chloride permeability. Epoxy grouts are very expensive and less compatible with the surrounding concrete, however. The main disadvantage of cement-based grouts was the low durability that could lead to reflective cracking in the joints. The MAP grouts extended with pea-gravel performed better than non-shrink grout. The test results showed that MAP as the overnight cure material (Set 45HW) and HPC mix1 as the 7-day cure material were the best among all of the grout types in terms of strength and durability.

5.6 Joint Reinforcement

Three reinforcing bar types that might be suitable for double-tee bridge longitudinal joint rehabilitation are conventional steel bars, headed bars, and wire meshes. Reinforcement to be used in any rehabilitated longitudinal joint must be able to resist and transfer shear force and bending moment demands, which mainly depend on the splice length. The AASHTO LRFD (2013) provides equations for development length of straight and hooked steel bars, and wire meshes. However, AASHTO requires lab testing for mechanical anchorages. International Code Council Report No. ES ESR-2935 (2016) provides development length for headed bars.

Of the three reinforcement types, headed bars and wire-meshes are expected to be better for the rehabilitation of double-tee bridge joints due to short development length or compatibility with double-tee existing reinforcement.

5.7 Demolition methods

Saw cutting, jack-hammering, and hydro-demolishing might be used for the rehabilitation of double-tee bridge longitudinal joints to remove concrete.

5.7.1 Hydro-Demolishing

Wenzlick (2002) performed a study on the rehabilitation of bridge deck using hydro-demolishing. The study concluded that hydro-demolition is a better alternative for concrete removal from bridge decks than the conventional methods using jackhammers, since de-bonding and cracking of the rehabilitated bridge decks using conventional demolishing methods was observed. The study highlighted the major advantages of hydro-demolition versus jack-hammering as follows.

- Hydro-demolition does not damage the concrete that is to stay in place. Jack-hammering causes micro-fractures in the concrete surface that leads to poor bond.
- Bond strength of repaired concrete with hydro-demolition is, on average, two times higher than that repaired with jack-hammering.
- Hydro-demolition exposes the reinforcement with no additional damage, and no additional operation is needed before casting; whereas, jack-hammering requires sand-blasting of the reinforcement after material is chipped away.
- Cost for hydro-demolishing in Missouri in 2002 was \$12/yd² to \$75/yd² compared to \$260/yd² to \$300/yd² for conventional removal.

The only disadvantage reported for hydro-demolition was the limited mobilization and availability of hydro-jets in 2002.

6 LONGITUDINAL JOINT REHABILITATION ALTERNATIVES

In the previous chapter, two different joint detailing methods (continuous and dowel), different filler materials (e.g., ultra-high performance concrete), and reinforcement types (e.g., wire mesh) were introduced. Twenty feasible alternatives for the rehabilitation of double-tee bridge longitudinal joints were developed using the combination of the above mentioned joint detailing, materials, and reinforcement. In an attempt to identify the best joint rehabilitation methods, a rating system was adopted from the NCHRP Report No. 698 (Marsh et al., 2011) and was modified in the present study. Furthermore, 13 large-scale beams were tested to verify and optimize the best rehabilitation alternatives prior to full-scale bridge system testing. A summary of the joint rehabilitation alternatives, the rating system and results, and the beam test results is presented herein. For in-depth discussion, refer to Attachment A (Bohn, 2017).

6.1 Double-Tee Longitudinal Joint Rehabilitation Alternatives

Both continuous and dowel bar joint detailing might be used for the rehabilitation of double-tee girder-to-girder joints. Five premix materials were selected as potential joint filler: ultra-high performance concrete (UHPC), latex modified concrete (LMC), magnesium ammonium phosphate grout (MAP), a fiber reinforced grout (FRG), and non-shrink grout. Joints can be reinforced with either headed steel bars or steel wire-meshes to improve joint integrity and performance. With the two connection types, five filler materials, and two types of reinforcement; 20 feasible rehabilitation alternatives were developed for the longitudinal joints of double-tee bridges (Table 6-1).

6.2 Rating System, Beam Tests, and Analytical Study

6.2.1 Rating System

A double-tee longitudinal joint rehabilitation alternative consists of three constituents: connection detailing, filler material, and reinforcement type. A rating system to select the best Accelerated Bridge Construction (ABC) methods was developed under the NCHRP Report 698, which consists of five levels of performance (-2, -1, 0, 1, 2) and five criteria (construction risk, performance, durability, inspectability, and cost). This rating system was adopted and modified in the present study to evaluate each constituent of a double-tee bridge's longitudinal joint rehabilitation detailing.

Table 6-1. Double-Tee Bridge Longitudinal Joint Rehabilitation Alternatives

Alternative ID	Alternative Name	Joint Filler Material	Joint Reinforcement
1	CUH	UHPC	Headed-Bar
2	CUW	UHPC	Wire-Mesh
3	CNH	NSG	Headed-Bar
4	CNW	NSG	Wire-Mesh
5	CMH	MAP	Headed-Bar
6	CMW	MAP	Wire-Mesh
7	CLH	LMC	Headed-Bar
8	CLW	LMC	Wire-Mesh
9	CFH	FRG	Headed-Bar
10	CFW	FRG	Wire-mesh
11	DUH	UHPC	Headed-Bar
12	DUR	UHPC	Rebar
13	DNH	NSG	Headed-Bar
14	DNR	NSG	Rebar
15	DMH	MAP	Headed-Bar
16	DMR	MAP	Rebar
17	DLH	LMC	Headed-Bar
18	DLR	LMC	Rebar
19	DFH	FRG	Headed-Bar
20	DFW	FRG	Rebar

Notes: The rehabilitation alternative names consist of letters referring to:

C – Continuous Joint Rehabilitation, D – Dowel Bar Retrofit, U – Ultra-High Performance Concrete, L – Latex Modified Concrete, F – Fiber Reinforced Grout, N – Non-Shrink Grout, M – Magnesium Ammonium Phosphate Grout, H – Headed Bar, W – Wire Mesh, R-Rebar.

Table 6-2 presents the results of the rating. The three numbers under the construction risk, durability, performance, and inspectability (columns 5 through 8, respectively) are the ratings for the three constituents of an alternative. The overall rating (column 10) is the summation of all sub-ratings for an alternative. The results indicated that alternatives with the dowel bar retrofit method are not adequate for the rehabilitation of the longitudinal joints. Overall, the alternatives with continuous joints filled with UHPC or LMC were identified as the best methods of joint rehabilitation. The rating favored the headed bars but the wire mesh was still a potential option. The top four candidates (highlighted in the table) for the rehabilitation of double-tee longitudinal joints were: continuous joint with UHPC and headed bars (CUH), continuous joint with LMC and headed bars (CLH), continuous joint with UHPC and wire mesh (CUW), and continuous joint with LMC and wire mesh (CLW).

Table 6-2. Rating of Double-Tee Bridge Longitudinal Joint Rehabilitation Alternatives

Alt. No.	Alt. Name	Filler Material	Reinforcement Type	Const. Risk Rating	Durability Rating	Perform. Rating	Inspect. Rating	Cost Rating	Overall Rating
1	CUH	UHPC	Headed-Bar	0, -1, 0	2, 1, 1	2, 1, 1	0, 0, 0	-2	5
2	CUW	UHPC	Wire-Mesh	0, 0, 0	2, 0, 1	2, -1, 1	0, 0, 0	-2	3
3	CNH	NSG	Headed-Bar	0, -1, 0	-1, 1, 1	0, 1, 1	0, 0, 0	0	2
4	CNW	NSG	Wire-Mesh	0, 0, 0	-1, 0, 1	0, -1, 1	0, 0, 0	0	0
5	CMH	MAP	Headed-Bar	0, -1, 0	-1, 1, 1	1, 1, 1	0, 0, 0	-2	1
6	CMW	MAP	Wire-Mesh	0, 0, 0	-1, 0, 1	1, -1, 1	0, 0, 0	-2	-1
7	CLH	LMC	Headed-Bar	0, -1, 0	2, 1, 1	2, 1, 1	0, 0, 0	-2	5
8	CLW	LMC	Wire-Mesh	0, 0, 0	2, 0, 1	2, -1, 1	0, 0, 0	-2	3
9	CFH	FRG	Headed-Bar	-1, -1, 0	1, 1, 1	1, 1, 1	0, 0, 0	-1	3
10	CFW	FRG	Wire-mesh	-1, 0, 0	1, 0, 1	1, -1, 1	0, 0, 0	-1	1
11	DUH	UHPC	Headed-Bar	0, -1, -1	2, 1, -1	2, 1, -2	0, 0, 0	-2	-1
12	DUR	UHPC	Rebar	0, 0, -1	2, 0, -1	2, -1, -2	0, 0, 0	-2	-3
13	DNH	NSG	Headed-Bar	0, -1, -1	-1, 1, -1	0, 1, -2	0, 0, 0	0	-4
14	DNR	NSG	Rebar	0, 0, -1	-1, 0, -1	0, -1, -2	0, 0, 0	0	-6
15	DMH	MAP	Headed-Bar	0, -1, -1	-1, 1, -1	1, 1, -2	0, 0, 0	-2	-5
16	DMR	MAP	Rebar	0, 0, -1	-1, 0, -1	1, -1, -2	0, 0, 0	-2	-7
17	DLH	LMC	Headed-Bar	0, -1, -1	2, 1, -1	2, 1, -2	0, 0, 0	-2	-1
18	DLR	LMC	Rebar	0, 0, -1	2, 0, -1	2, -1, -2	0, 0, 0	-2	-3
19	DFH	FRG	Headed-Bar	-1, -1, -1	1, 1, -1	1, 1, -2	0, 0, 0	-1	-3
20	DFW	FRG	Rebar	1, 0, -1	1, 0, -1	1, -1, -2	0, 0, 0	-1	-5

Notes: The rehabilitation alternative names consist of letters referring to:

C – Continuous Joint Rehabilitation, D – Dowel Bar Retrofit, U – Ultra-High Performance Concrete, L – Latex Modified Concrete, F – Fiber Reinforced Grout, N – Non-Shrink Grout, M – Magnesium Ammonium Phosphate Grout, H – Headed Bar, W – Wire Mesh, R – Rebar.

6.2.2 Beam Tests

The rating of the joint rehabilitation alternatives resulted in four options, but the best detailing for full-scale bridge testing could not be determined due to a lack of test data pertaining to the joint performance. An experimental program (Table 6-3) was executed, therefore, to select the best detailing for the next phase of the study. Twelve spliced beam specimens were tested to failure, incorporating different joint rehabilitation alternatives, as well as a reference reinforced concrete beam specimen (RCS) as the benchmark model (Fig. 6-1 and 6-2). Three variables were investigated in the experimental program: filler material, reinforcement type, and splice length.

Table 6-3. Large-Scale Beam Test Matrix

Test Specimen ID	Filler Material	Splice Reinforcement	Splice Length
RCS	No filler, 6000-psi Concrete only	4 in. X 8 in., D8.0 X D4.0, Wire Mesh	None
U-H-3	UHPC	No. 3 Headed Bar	3 in.
U-H-5	UHPC	No. 3 Headed Bar	5 in.
U-W-3	UHPC	D8.0 X D4.0 Wire Mesh	3 in.
U-W-5	UHPC	D8.0 X D4.0 Wire Mesh	5 in.
L-H-3	LMC	No. 3 Headed Bar	3 in.
L-H-5	LMC	No. 3 Headed Bar	5 in.
L-W-3	LMC	4 in. X 8 in., D8.0 X D4.0, Wire Mesh	3 in.
L-W-5	LMC	4 in. X 8 in., D8.0 X D4.0, Wire Mesh	5 in.
LE-H-3	LMC– Extended w/ 3/8-in. Pea-gravel	No. 3 Headed Bar	3 in.
LE-W-5	LMC– Extended w/ 3/8-in. Pea-gravel	4 in. X 8 in., D8.0 X D4.0, Wire Mesh	5 in.
N-W-3	NSG	4 in. X 8 in., D8.0 X D4.0, Wire Mesh	3 in.
N-W-5	NSG	4 in. X 8 in., D8.0 X D4.0, Wire Mesh	5 in.

Note:


Filler Materials: UHPC (ultra-high performance concrete), LMC (latex modified concrete), and NSG (non-shrink grout),

Test specimens: RCS (reference concrete slab/beam),


Specimen ID: Filler Material (U=UHPC, L=LMC, N=NSG) – Reinforcing (H=Headed steel bar, W=steel Wire) – Splice Length (e.g. U-H-3= UHPC – No. 3 Headed bar – 3 in. splice)

The geometry selection criteria for the beam test models was based on the two-adjacent prototype double-tee girders (Figure 6-1). The thickness of the beam was the same as the girder flange thickness. The length of the beam was approximately 7.5 ft based on the centerline to centerline of the two exterior stems of the two girders. A 12-in. slice of the prototype bridge was selected as the width of the test specimens. The test beams were placed on two roller supports simulating the two left stems of the two girders. A point load was applied approximately at the right edge of the left girder to maximize the shear demand. The effect of the right exterior stem as a support was ignored to maximize shear force demands on the joint. The RCS had the same geometry as the spliced beams, but it was reinforced with a continuous wire mesh with the same size, type, and spacing as those that are currently utilized in actual double-tee girders.


The beam test model reinforcement followed the prototype double-tee girder mild steel reinforcement in terms of the total area, but the total reinforcement area in the beams was achieved by using either wire mesh or headed bars. The concrete mix design was the same as that of actual double-tee girders used in the field to minimize test variations.

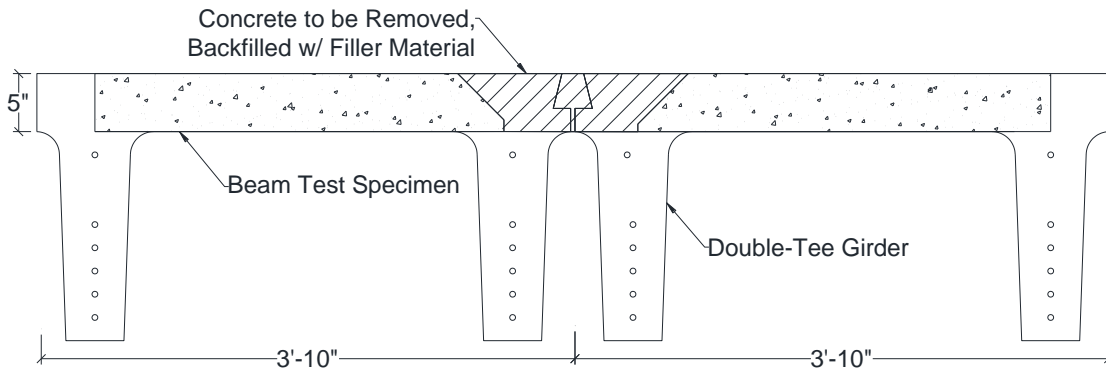


a. Profile View of Beam Test Extracted from a Double-tee Girder

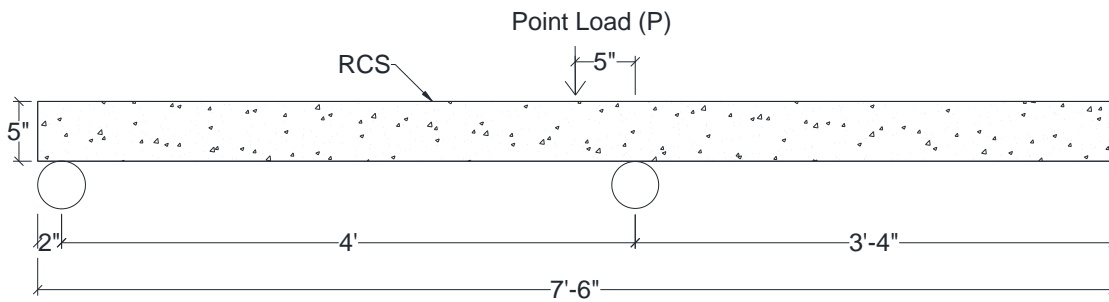

b. Reference Concrete Slab (RCS) Test Specimen

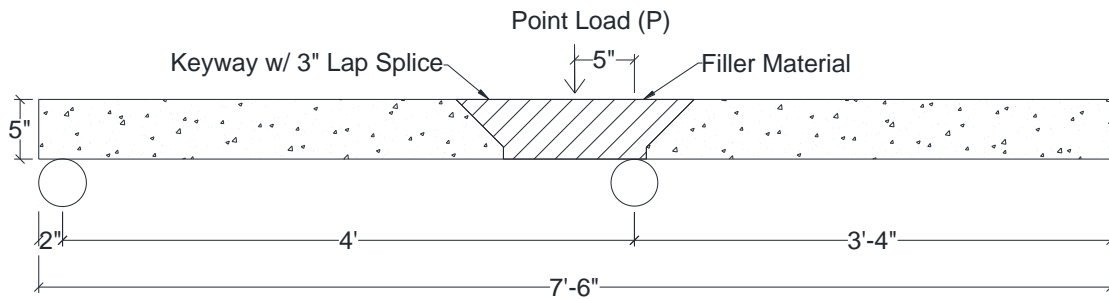


c. Test Specimen with 3-in. Lap-Splice

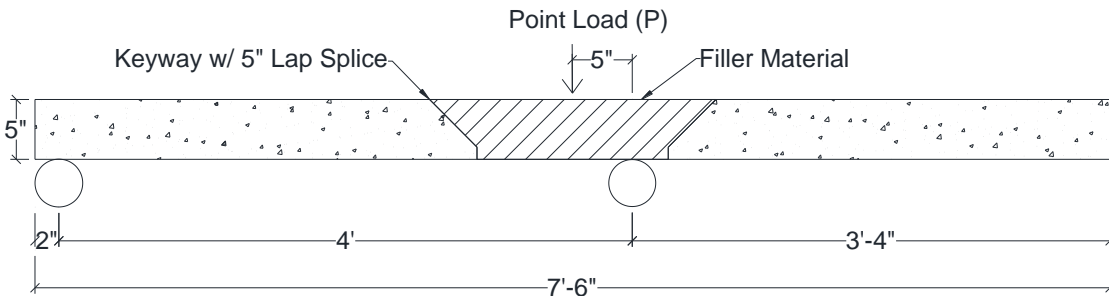


d. Test Specimen with 5-in. Lap-Splice


Figure 6-1. Geometry of Beam Test Specimens

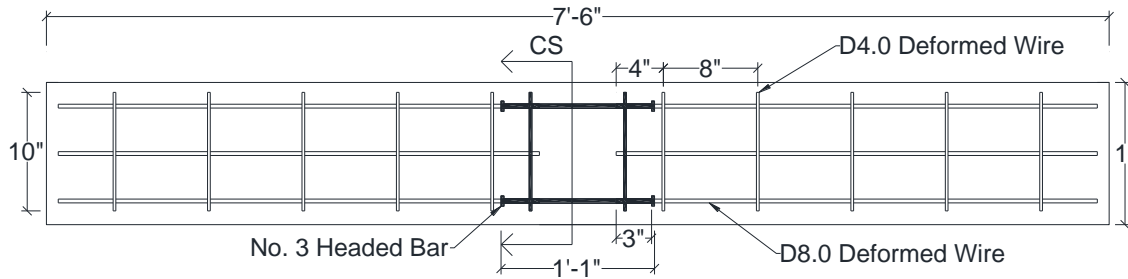


a. Test Specimen with 3-in. Splice Lengths Utilizing No. 3 Headed Bars

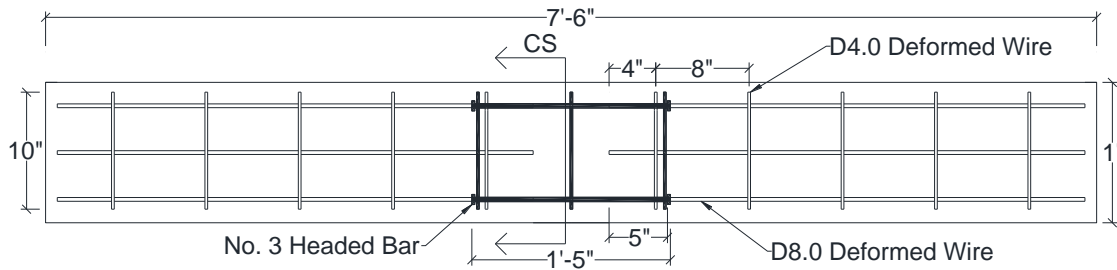

b. Test Specimen with 5-in. Splice Lengths Utilizing No. 3 Headed Bars

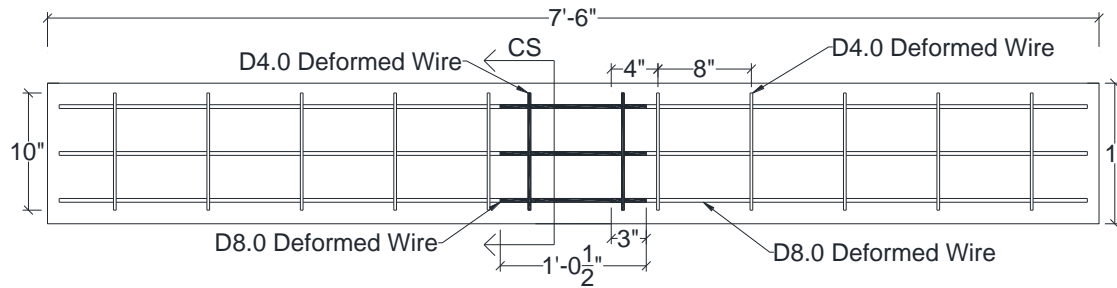

c. Test Specimen with 3-in. Splice Lengths Utilizing D8/D4 Wire Mesh

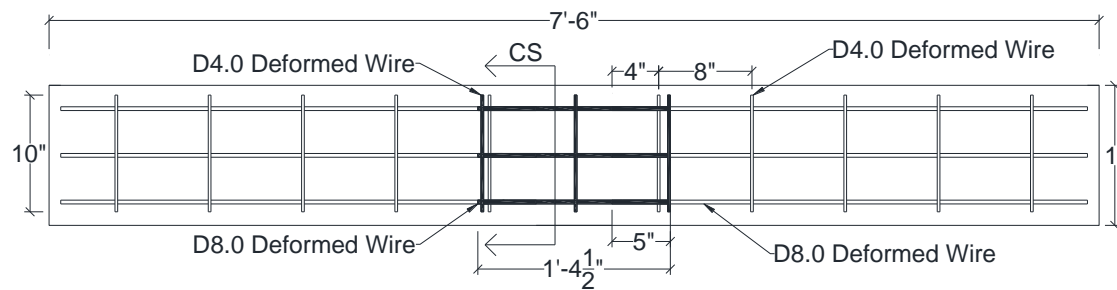

d. Test Specimen with 5-in. Splice Lengths Utilizing D8/D4 Wire Mesh

Figure 6-2. Splice Detailing of Beam Test Specimens

The beams were fabricated (Fig. 6-3) in the Lohr Structures Laboratory at South Dakota State University (SDSU). Ready mix concrete was utilized for construction. The fresh concrete temperature was 64°F with a slump of 6.0 in. The mix design was based on the current double-tee mix design provided by the manufacturer, targeting 6,000-psi compressive strength at 28-days. After 7 days of curing, the inner formwork was stripped in order to place the joint reinforcement. A previous study showed that roughening and pre-wetting the surface for 24 hours increases the bond between two cementitious materials (Graybeal, 2014). Since the concrete is usually demolished by hammer chipping in South Dakota, a hammer drill was used to roughen the splice surface (Fig. 6-3a and 6-3b) to best resemble demolishing conditions.

After surface preparation, cleaning, and placing the reinforcement in the spliced region, the joints were poured with one of the following a premix LMC, a premix UHPC (with 2% volumetric steel fibers), LMC extended with 3/8-in. diameter pea-gravel, or conventional non-shrink grout.



a. Formwork



b. Pouring Concrete



c. Original Joint Surface



d. Roughened Joint Surface

Figure 6-3. Construction of Beam Test Specimens

The test day compressive strength of the concrete, non-shrink grout, LMC, extended LMC, and UHPC was approximately 6100, 6100, 8000, 4500, and 20500 psi, respectively. The wire mesh was made of ASTM A497 deformed wires with a yield strength of 108 ksi. The ASTM A706 headed bars with a yield strength of 80 ksi were incorporated in the specimens.

A displacement-based half-cyclic loading protocol with a slow rate of 0.003 in./sec was used for the testing of the beam specimens. Cyclic as opposed to monotonic loading was chosen to maximize damage and to investigate the joint performance under large cyclic displacement demands.

The RSC failed by bar fracture. The failure mode of the spliced test specimens was either bar pullout or bar fracture. Table 6-4 presents a summary of the beam test results including the initial cracking load, the ultimate load, and the failure mode. The load corresponding to the initial cracking was based on visual inspection of the test beams. All test specimens with a 5-in. lap-splice (Fig. 6-4a) exhibited bar fracture except NW5 (a joint reinforced with wire mesh and filled with conventional non-shrink grout) and LH5 (a joint with headed bars and latex modified concrete). The UW3 (a joint with wire mesh and UHPC) and UH3 (a joint with headed bars and UHPC) were the only test specimens with a 3-in. lap-splice exhibiting bar fracture (Fig. 6-4b).

Table 6-4. Mode of Failure and Load Capacity for Beam Test Specimens

Specimen ID	Measured P_{crack} (kips)	Measured P_u (kips)	Mode of Failure
RCS	8.8	22.3	Bar rupture in joint
LW5	9.9	20.1	Bar rupture in joint
UW5	13.3	29.4	Bar rupture in precast concrete segment
LEW5	7.2	16.8	Bar rupture in joint
NW5	3	13.6	Bar pullout
LH5	14.3	16.4	LMC compressive failure
UH5	14.7	29.6	Bar rupture at interface
LW3	12	13.8	Bar pullout
UW3	16.4	32.9	Bar rupture at interface
NW3	9.1	10.4	Bar pullout
LH3	11.7	14.9	Bar pullout
UH3	13.5	28.5	Bar rupture at interface
LEH3	10.5	12.9	Bar pullout


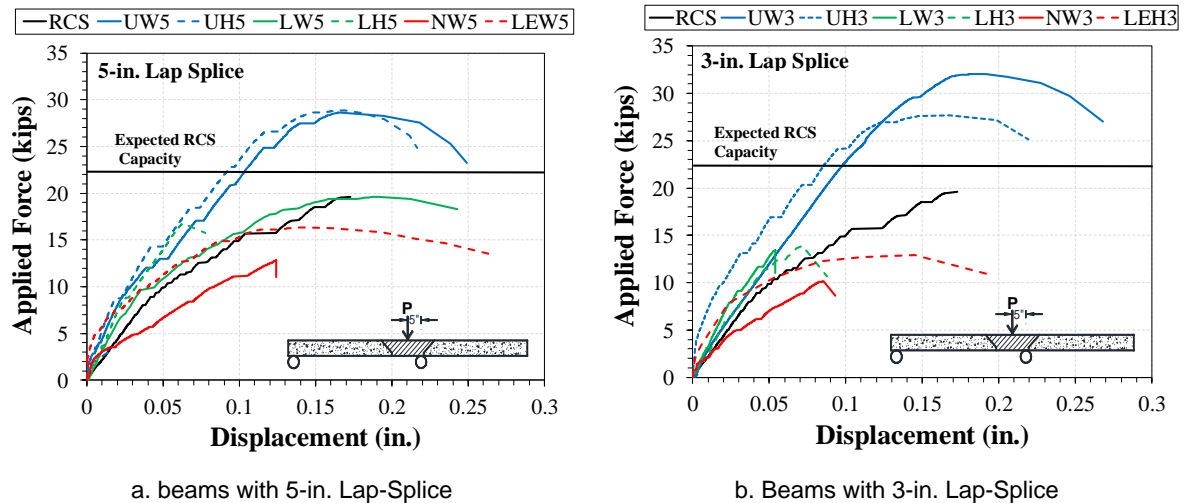


Figure 6-4. Load-Displacement Relationships for Beam Test Specimens

The UHPC test specimens had a 30% higher load carrying capacity than the reference specimen. This may be attributed to the 400% higher compressive strength and additional tensile strength provided from the 2% volumetric ratio steel fibers. The first crack (Fig. 6-5) then failure (Fig. 6-6) of all specimens except those incorporating UHPC, occurred inside the joint directly under the applied load where the bending moment was maximum. In the UHPC specimens, all of the flexural cracking was shifted outside the joint.

The LH5 had a different failure mode compared to the rest of the specimens in which LMC crushed directly under the applied load. This was attributed to the lower effective depth for LH5 (3.2 in.) compared to that for LW5 (3.7 in.), as well as the 50% higher strain capacity for No. 3 headed bar reinforcement, compared to that of the D8 reinforcement. The combination of the two parameters resulted in a condition in which the beam concrete (LMC) failed in compression in a brittle manner. On the other hand, the LW5 exhibited bar fracture. The LEW5 had an effective depth of 3.2 in. that resulted in 16% lower capacity compared to LW5.

Overall, it can be concluded from the beam test results that either UHPC or LMC might be viable filler materials for the rehabilitation of double-tee bridges. Full-scale bridge testing will reveal the best material for field applications. The splice length for UHPC and LMC should be at least 3 and 5 in., respectively. The use of non-shrink grout and extended LMC cannot guarantee bar fracture inside the joint; thus, they should be avoided in the rehabilitation of double-tee bridge longitudinal joints.

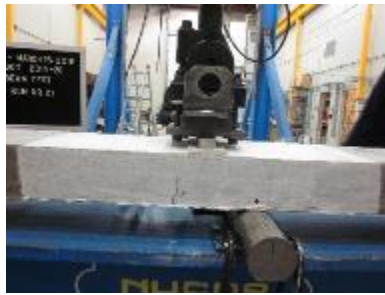

a. RCS



b. LW3



f. UW5



j. LEW5



c. LW5



g. UH5



k. LEH3



d. LH3



h. UW3



l. NW5



e. LH5



i. UH3



m. NW3

Figure 6-5. Beam Test Specimens at First Cracking



a. RCS



b. LW3



f. UW5



j. LEW5



c. LW5



g. UH5



k. LEH3



d. LH3



h. UW3



l. NW5



e. LH5



i. UH3



m. NW3

Figure 6-6. Beam Test Specimens at Failure


6.2.3 Analytical Study

6.2.3.1 Introduction


The rehabilitation alternative rating and the beam test results confirmed that the continuous joint detailing is a viable rehabilitation method for double-tee girder-to-girder joints. In an attempt to minimize the material use and the cost, a modified version of the continuous joint was proposed in which discrete pockets are connected through a continuous shear key. An analytical study was necessary to optimize the joint detailing with a capacity that exceeds demands under fatigue, service, and strength limit states. The performance of the two joint rehabilitation concepts was analytically investigated using linear finite element analyses as follows.

Option I – “continuous” concept (Fig. 6-7a) in which the girder flange reinforcement will be exposed along the length of the girder using a demolishing technique to be spliced with a new welded wire mesh. The joint can be filled with either LMC or UHPC.

Option II – “pocket” concept (Fig. 6-7b) consisted of discrete pockets exposed by demolishing the girder flange concrete and reinforcing with steel bars. In between the pockets the damaged material in the longitudinal joint is removed and replaced with a filler material such as UHPC.



a. Plan View of Option I (Continuous Detailing)

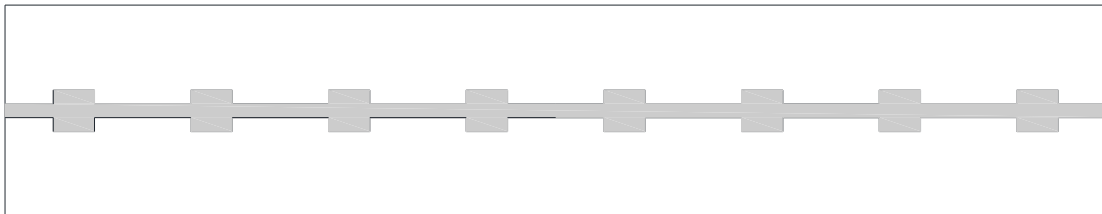


b. Plan View of Option II (Pocket Detailing)

Figure 6-7. Two Double-Tee Bridge Rehabilitation Concepts


6.2.3.2 Modeling Methods and Loading

Linear Finite Element Analyses (FEA) were performed on two adjacent 23-in. deep double-tee girders (Fig. 6-8a). The double-tee stems are 18-in. tall, 5-in. wide at the bottom while tapered to 6.125 in. at the top. The double-tee deck is 5-in. thick and 46-in. wide. The SAP2000 (2016) was selected for the analytical study. The stems were modeled with frame elements. Pin supports were assigned to the end of each stem. The deck (the flange of the girders) was modeled using solid shell elements. The connection between the frame and shell elements was provided utilizing body constraints fixing all degrees of freedom (DOFs) between the two end nodes. The connection allows the deck and stems

to act compositely. The section properties for each girder was according to the actual double-tee section with an area of 426 in² and a moment of inertia of 18,640 in⁴ about the strong axis. The compressive strength (f'_c) for the deck and stems was 6,000 psi based on the target 28-day compressive strength of the actual double-tee girder mix design. The concrete modulus of elasticity (E_c) was 4,415 ksi.

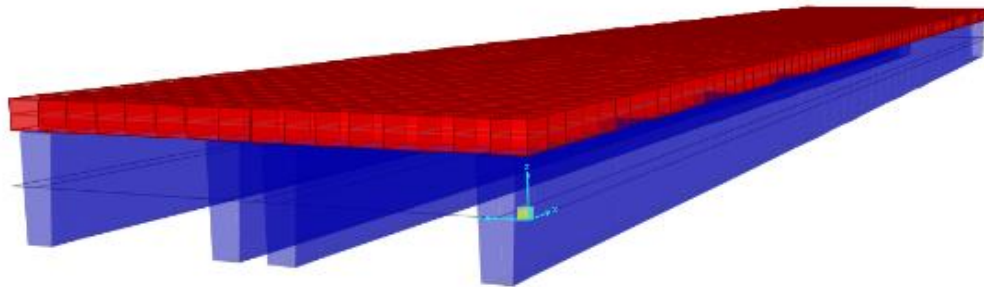

a. Extruded View of FEA Model for Continuous Joint

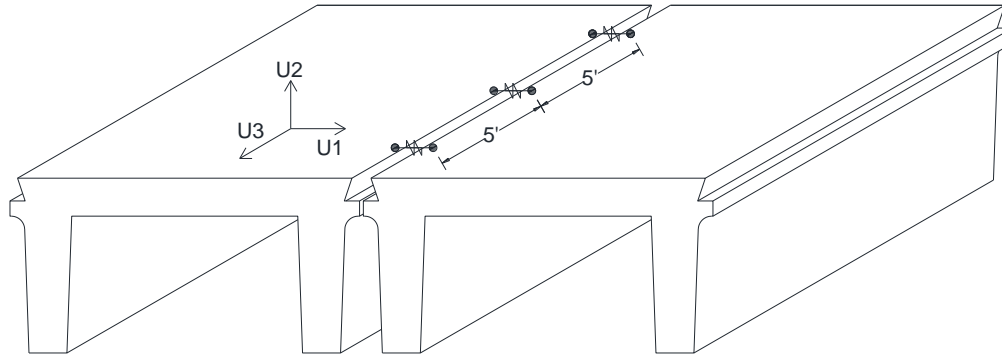

b. Link locations and Local Axis for Pocket Detailing

Figure 6-8. Finite Element Analysis of Double-Tee Bridge Rehabilitation Concepts

Point loads were applied at the mid-span of the bridge to produce the peak moment from moment envelopes calculated for an interior double-tee girder under AASHTO Service I, Fatigue II, and Strength I limit states. The loads were applied on an area of 10 by 20 in. at the mid-span, adjacent to the longitudinal joint to maximize the shear load demand on the joint. The area load was to simulate a truck tire load.

In an attempt to evaluate the performance of the proposed rehabilitation detailing, two analytical models were created as follows.

- i. "Continuous" model (Fig 6-8a) in which the longitudinal joint of the girders was monolithically constructed with shell elements
- ii. "Pocket" model (Fig 6-8b) in which the girders were connected by a series of links representing the pockets spaced along the length of the longitudinal joint

The "pocket" model was constructed using "link" elements consisting of linear springs in all six DOFs to connect the girders as shown in Fig. 6-8b. The spring properties (Table 6-5) were based on the

properties of UHPC and reinforcement. The UHPC was assumed to have a compressive strength (f'_{UHPC}) of 18 ksi, a modulus of elasticity (E_c) of 6,200 ksi, and Poisson's ratio of (ν) of 0.2 (Graybeal, 2010). The axial stiffness (U_1) (Eq. 6-1), shear stiffness (U_2) (Eq. 6-2), and rotational stiffness (R_3) (Eq. 6-3) were calculated based on assumed properties of $E_s = 29,000$ ksi and $A_s = 0.8$ in² for steel bars; $A_c = 90$ in² and $I = 187.5$ in³ for the filler material; and a spring length of $L = 4.25$ in. Shear stiffness (U_3) and rotational stiffness (R_1 and R_2) were considered rigid.

$$U_1 = \frac{AE}{L} \quad \text{Eq. 6-1}$$

$$U_2 = \frac{GA}{L} \quad \text{Eq. 6-2}$$

$$R_3 = \frac{EI}{L} \quad \text{Eq. 6-3}$$

Table 6-5. Input for Pocket Springs in Finite Element Analysis

Link Properties	Values
Axial Stiffness (U_1)	92,800 kip/in
Shear Stiffness (U_2)	54,700 kip/in
Shear Stiffness (U_3)	Fixed
Rotational Stiffness (R_1)	Fixed
Rotational Stiffness (R_2)	Fixed
Rotational Stiffness (R_3)	273,500 kip-in/rad

The performance of two adjacent double-tee girders connected with pocket detailing (Fig. 6-8b) was evaluated by comparing the amount of load being transferred to stems of each girder (Figure 6-9). Three different pocket (link) spacing of 5, 8, and 13 ft were included in the analyses, and the response was compared to that of a monolithic (continuous) bridge model. Results indicated that the difference between the stem forces for the monolithic and pocket models increases when the pocket spacing increases. For example, the end reaction of stem B of the pocket model with a 13-ft link spacing was 30% higher than that in the model with a 5-ft pocket spacing.

The stem force differences in the monolithic model and the model with 5-ft pocket spacing were within 10% for all stems, and the maximum stem forces between the two models were less than 3% in difference. It can be concluded, therefore, that the pocket spacing of 5 ft results in a monolithic behavior for a double-tee bridge rehabilitated with the pocket option. This pocket spacing was selected for further analysis.

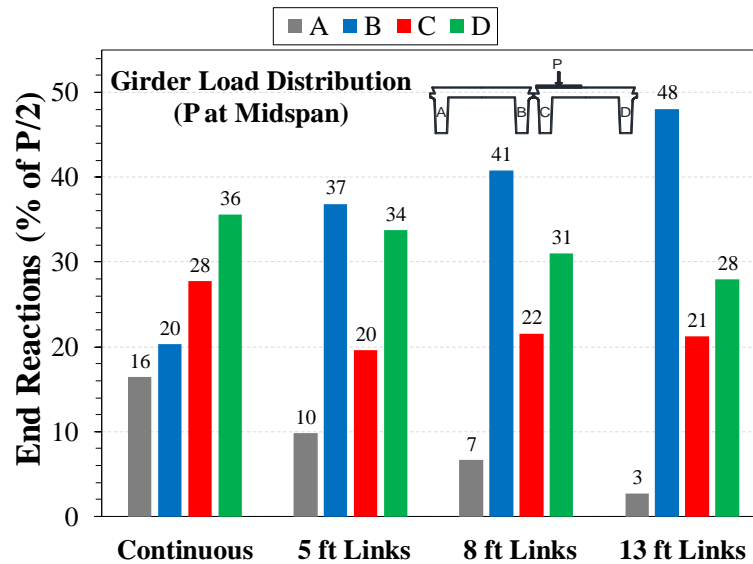


Figure 6-9. Effect of Pocket Spacing on Double-Tee Girder Load Distribution

To better comment on the suitability of rehabilitated bridges with 5-ft pocket spacing, the calculated stem forces of the rehabilitated bridge were compared with those measured in previous experimental studies (Fig. 6-10). Two full-scale double-tee bridge models were tested by Konrad (2014), one specimen with continuous joint detailing (which behaved as a monolithic bridge) and one specimen with welded plate detailing (conventional double-tee bridge detailing that is currently used in practice). Results indicated that the girder stem end reactions for the analytical continuous model were close to those measured in the test (8% difference in the peak stem forces). The peak stem force calculated for the pocket model was 2.6% lower than that measured in the test for the continuous joint. Overall, the pocket model performed better compared to the original double-tee specimen with welded plates in terms of the load transfer mechanism.

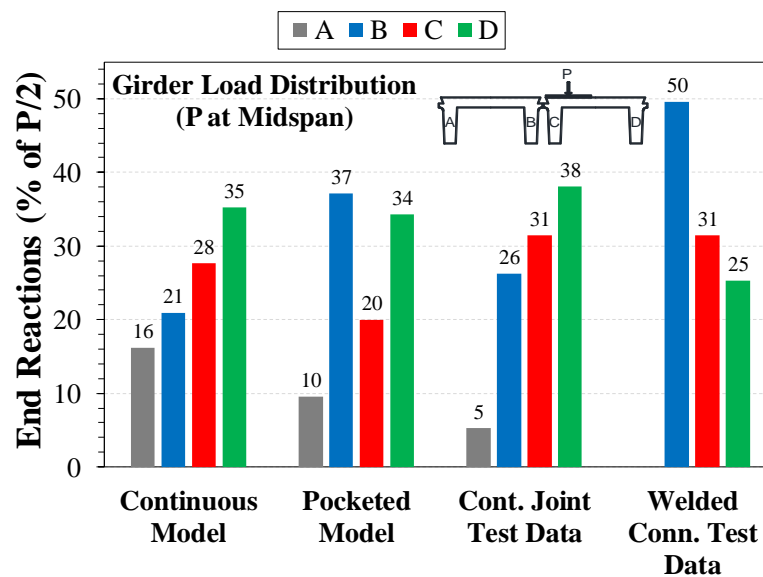


Figure 6-10. Calculated and Measured Double-Tee Girder Load Distribution

Currently, double-tee bridges with span lengths other than 40 ft are in-service in South Dakota (SD). To investigate the feasibility of the “pocket” detailing on bridges with different span lengths, the stem load distribution of “pocket” models with span lengths of 30 to 50 ft were analytically studied (Fig. 6-11). Results indicated that peak stem load slightly decreases when the span length increases. Overall, the effect of the span length on the stem peak forces was approximately 10% for the practical span lengths.

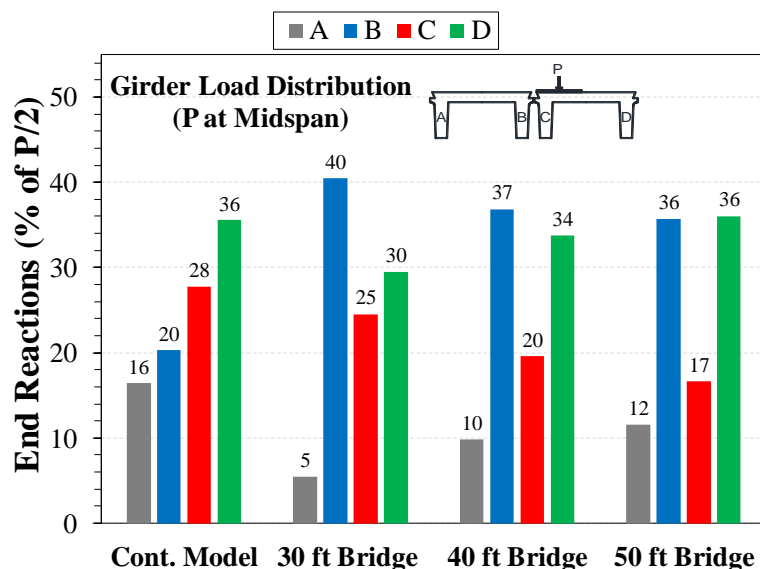


Figure 6-11. Rehabilitated Double-Tee Girder Load Distribution vs. Span Length

The effect of pocket spacing on the deflection of the rehabilitated double-tee bridges was also investigated. The parametric study showed that the maximum differential deck deflection between the two-adjacent double-tee girders is at the mid-span of the bridge. The calculated girder differential deflections for the rehabilitated double-tee bridges with 5, 8, and 13-ft pocket spacing were respectively 0.02, 0.03, and 0.05 in. under service limit state loading. The rehabilitated bridge model with 5-ft pocket spacing, therefore, exhibits a minimal differential deck deflection.

Overall, the finite element analyses showed that “pocket” rehabilitation detailing is a viable solution, specifically when the pocket spacing is 5 ft. Furthermore, the study confirms that continuous detailing is another viable solution for the rehabilitation of double-tee longitudinal joints.

6.3 Proposed Rehabilitation Detailing

This section includes the proposed rehabilitation methods for a full-scale prestressed double-tee bridge test model, which was developed based on the results of the joint rating, the large scale-beam testing, and the analytical study.

The analytical study showed that both the “pocket” and “continuous” concepts are feasible for the rehabilitation of double-tee bridges. The “pocket” detailing, however, offers several advantages such as a 50% reduction in material, significantly lower cost, and better bridge stability during construction.

To investigate the performance of bridges rehabilitated with the proposed detailing, testing was proposed for a full-scale bridge test specimen consisting of two simple span interior precast prestressed double-tee girders. Each girder was 23-in. deep, 3.83-ft wide, and 40-ft long. In an attempt

to evaluate the performance of both joint rehabilitation alternatives using only one test specimen, one half of the bridge test specimen was rehabilitated with the “pocket” detailing utilizing UHPC, and the other half of the bridge was rehabilitated with the “continuous” detailing incorporating LMC (Fig. 6-12). Hammer-chipping demolition technique was selected for concrete removal.

The proposed rehabilitation detailing for the bridge test model is summarized as follows.

Option I – “pocket” detailing

- Prepare 18 by 18 in. pockets to be filled with UHPC. The pocket spacing should not exceed 5 ft (Fig. 6-12) center-to-center.
- Pockets should be reinforced with four ASTM A706/A615 Grade 60 No. 4 bars in both longitudinal and transverse directions (Fig. 6-13).
- A minimum of 3-in. lap-splice between the pocket reinforcement and the deck’s existing wires is required to ensure full development (Fig. 6-13).
- A 5.875-in. continuous shear key filled with UHPC and longitudinally reinforced with two No. 4 bars should be provided (Fig. 6-14).

Option II – “continuous” detailing

- Prepare a 22-in. wide continuous opening to be filled with LMC (Fig. 6-12).
- Continuous joint should be reinforced with ASTM A497 Grade 70, 4 by 4 in. D8/D8 welded wire mesh (Fig. 6-15).
- A minimum of 5-in. lap-splice between the new and existing reinforcement should be provided to fully development the wires (Fig. 6-15).
- If wire mesh is not continuous over the length of the bridge, the mesh should be spliced as shown in Fig. 6-16.

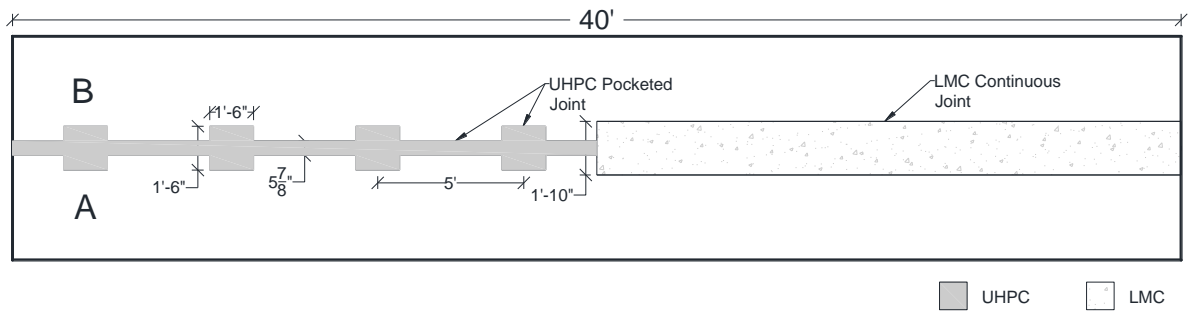


Figure 6-12. Proposed Rehabilitation for Double-Tee Bridge Test Specimen- Plan View

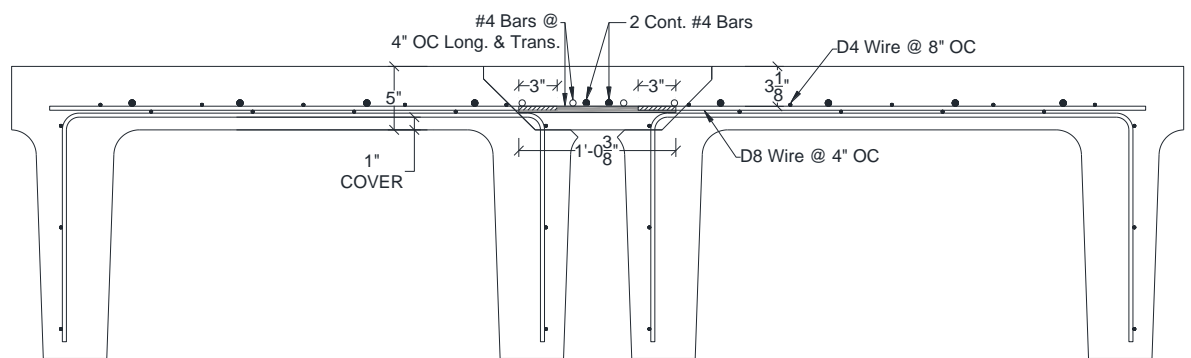


Figure 6-13. Proposed UHPC Pocket Detailing

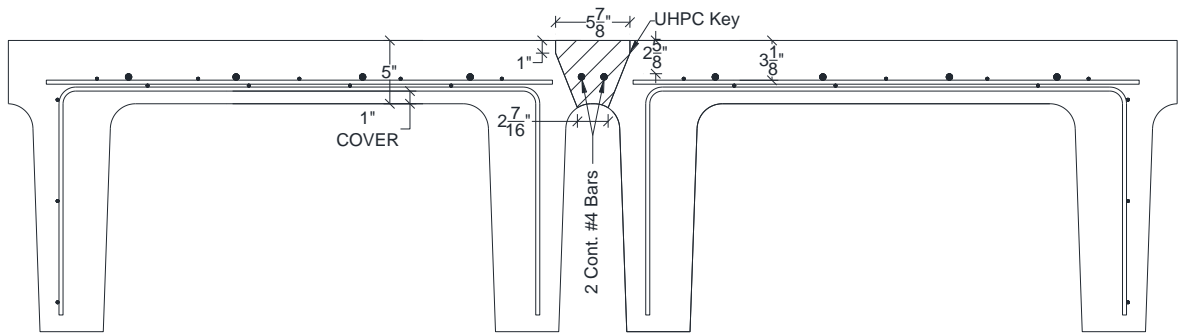


Figure 6-14. Proposed UHPC Intermediate Pocket Detailing

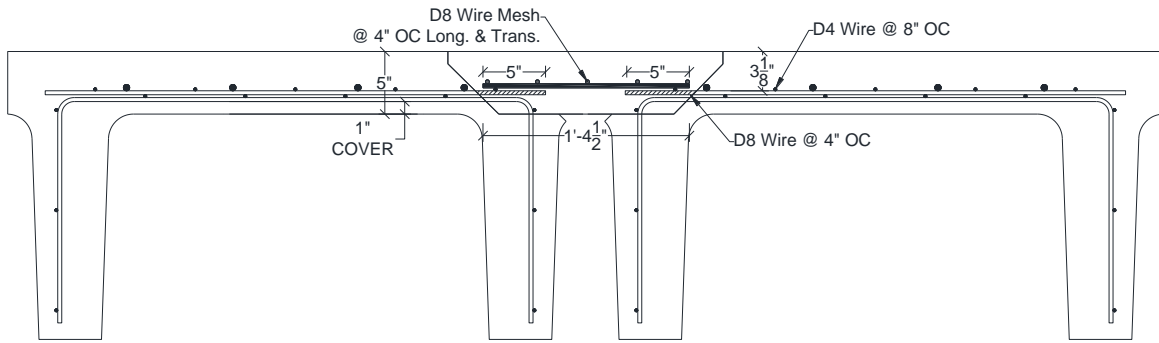


Figure 6-15. Proposed LMC Continuous Joint Detailing

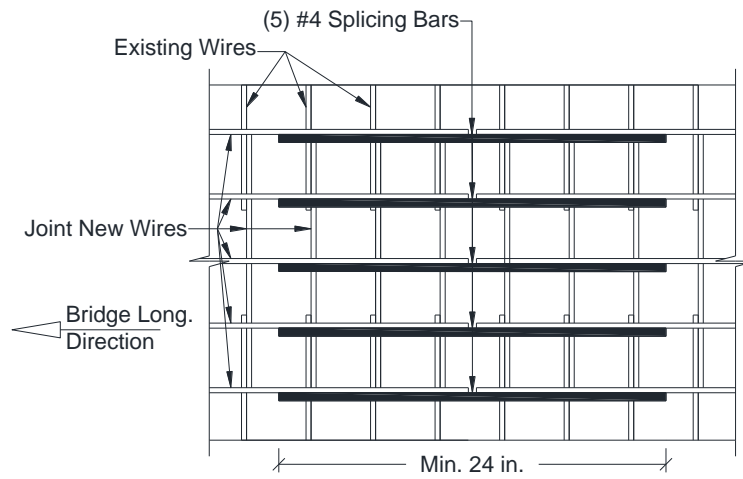


Figure 6-16. Proposed Continuous Joint Splice Detailing

7 FULL-SCALE BRIDGE TEST SPECIMENS

The experimental and analytical studies presented in the previous chapters showed that both pocket and continuous detailing are viable rehabilitation options for the longitudinal joints of double-tee bridges. Full-scale testing of double-tee bridges was needed to confirm the feasibility and suitability of the rehabilitated joints.

7.1 Design of Bridge Test Specimens

Double-tee bridges located on South Dakota local roads usually consist of eight double-tee girders, providing two lanes of traffic with a total width of 30 ft-8 in. (Fig. 7-1). A 40-ft long full-scale bridge with only two interior girders (shaded area in Fig. 7-1) was selected for testing in the present study. The 40-ft span length is common for double-tee bridges. Furthermore, two double-tee bridges with the same geometry were tested by Wehbe et al. (2016), which are the benchmark models for the present study.


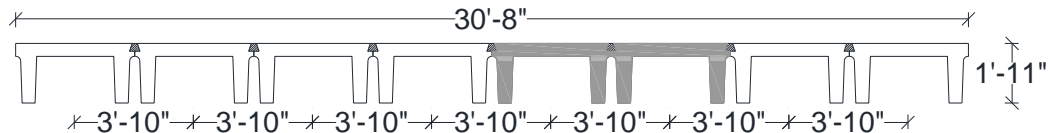


Figure 7-1. Cross-Section of Typical Double-Tee Girder Bridges

The prototype bridge was designed according to AASHTO LRFD Bridge Design Specifications (2013) with live loading consisting of a truck or tandem and a lane load. The design live load was based on an HL-93 truck (two 32-kip axles and one 8-kip front axle spaced 14 to 30 ft apart) or two 25-kip tandem axles 4-ft apart plus a 10-ft wide 0.64 klf distributed lane load.

The design led to a double-tee girder (Fig. 7-2) with a depth of 23 in., a width of 46 in., and a length of 40 ft. The deck was 5-in. thick reinforced with a 4 by 8 in. ASTM A-497 D8/D4 welded wire mesh. D8 wires provided 0.24 in² per foot steel reinforcement in the transverse direction of the bridge. Each stem was 5-in. thick at the bottom tapering to 6.25 in. at the top, and was reinforced with six 0.5-in. diameter ASTM-416 Grade 270 low relaxation 7-wire strands. The tendons were straight over the length of the girder (Fig. 7-2b). The tendons were de-bonded 5 ft from each girder end and were initially pulled 10.75 in., equivalent to 202.6-ksi stress (or 31-kip force) per tendon. The girder shop drawings are provided in Attachment A (Bohn, 2017).

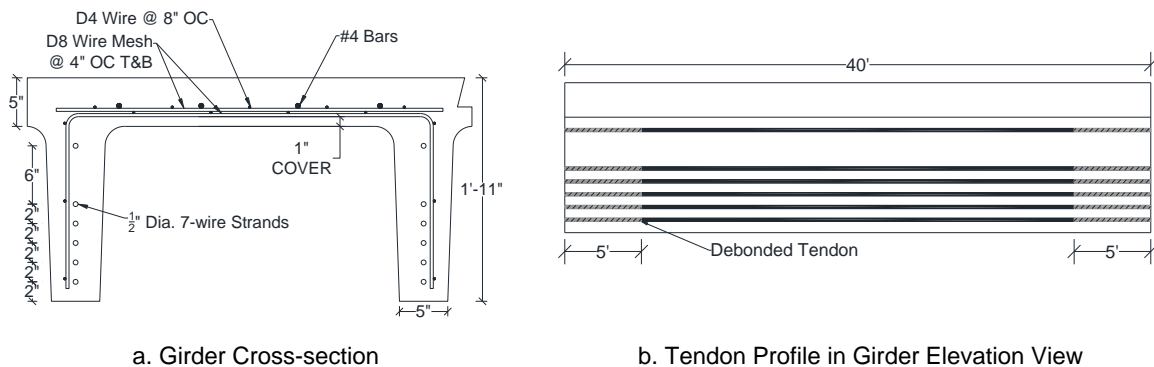

a. Girder Cross-section

b. Tendon Profile in Girder Elevation View

Figure 7-2. Detailing of 23-in. Deep Double-Tee Girders

7.1.1 Conventional Bridge Test Specimen

The longitudinal joint of the conventional bridge specimen (Fig. 7-3) consisted of discrete welded plates spaced at 5 ft with a continuous grouted keyway. The welded plate detailing (Fig. 7-4) consisted of two 1 ¼ in. X 1 ¼ in X 3/16 in. steel angles, each 6-in. long and embedded in the concrete with two 3/8 in. diameter X 4 in. long headed studs. The angles of the two adjacent girders were connected using 1/4 in. thick 1in. by 5 in. steel plates with 3/8 in. field weld. A non-metallic non-shrink grout, preapproved by South Dakota Department of Transportation (SDDOT) with a minimum compressive strength of 4,500 psi (SDDOT Standard Specification for Roads and Bridges, 2004), was used to fill the keyway.


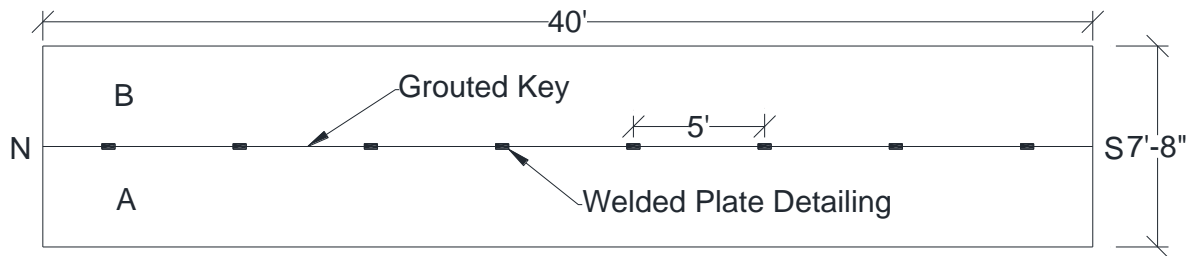


Figure 7-3. Plan View of Conventional Test Specimen

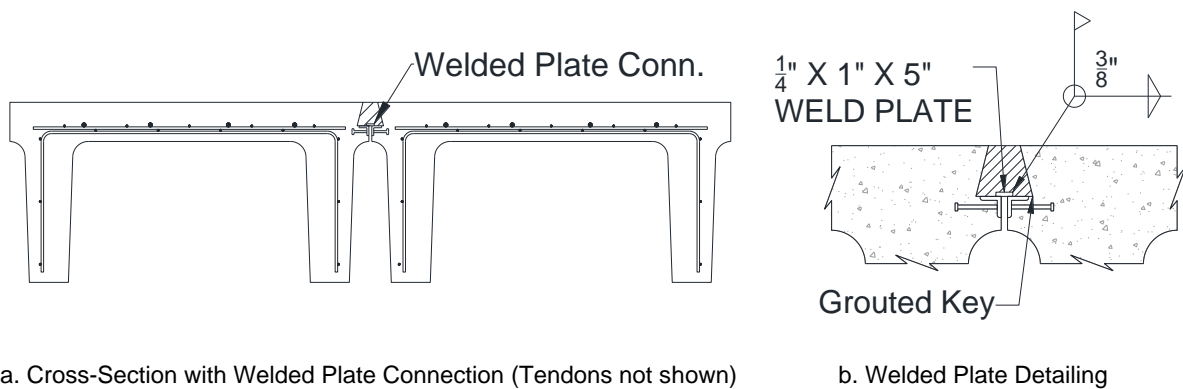

a. Cross-Section with Welded Plate Connection (Tendons not shown)

b. Welded Plate Detailing

Figure 7-4. Conventional Test Specimen Details

7.1.2 Rehabilitated Bridge Test Specimen

After testing the conventional bridge specimen, the longitudinal girder-to-girder joint was rehabilitated with two different methods (Fig. 7-5): Ultra-High Performance Concrete (UHPC) pocket detailing (Fig. 7-6 and 7-7), and Latex Modified Concrete (LMC) continuous detailing (Fig. 7-8).

The UHPC pockets were 5-in. deep (the same as the deck thickness), 18-in. wide, and 18-in. long, reinforced with a mesh of four No. 4 bars in each direction of the bridge. The pocket spacing was 5 ft, and the pocket side slope was 45 degrees. The new steel bars were lapped three in. with the exposed deck D8 wires. This splice length is sufficient to fracture the new reinforcement, based on the beam test data in Chapter 6. The intermediate UHPC keyway (between the pockets) was 5-in. deep and 5.87-in. wide with a side slope of 20 degrees. The UHPC keyway was longitudinally reinforced with two No. 4 continuous bars passing the pockets to improve the integrity of the joint.

The LMC continuous joint was 5-in. deep and 22-in. wide, reinforced with 4 in. by 4 in., D8/D8 welded grid mesh. The new wire mesh was spliced to the deck's existing wire mesh with at least a 5-in. splice length in the transverse direction of the bridge. Two 10-ft long meshes were lap-spliced with No. 4 bars in the longitudinal direction of the bridge to complete the joint and to provide continuity.

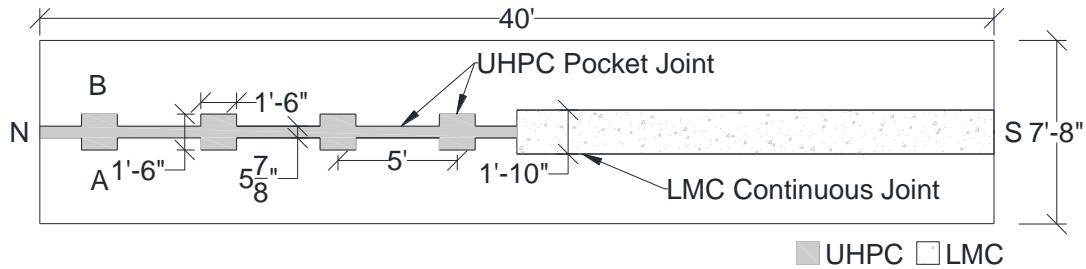


Figure 7-5. Plan View of Rehabilitated Test Specimen

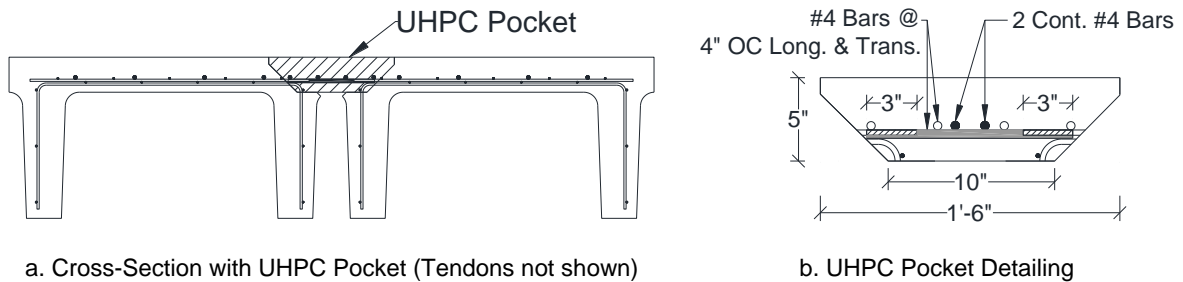


Figure 7-6. UHPC Pocket Rehabilitation Detailing

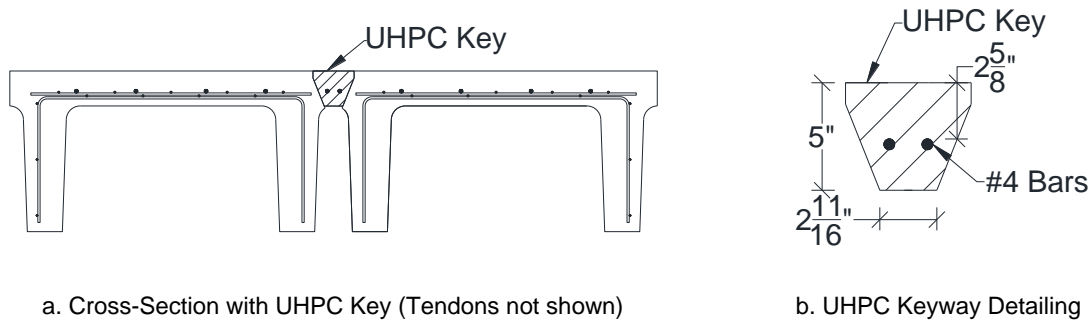


Figure 7-7. UHPC Intermediate Pocket Rehabilitation Detailing

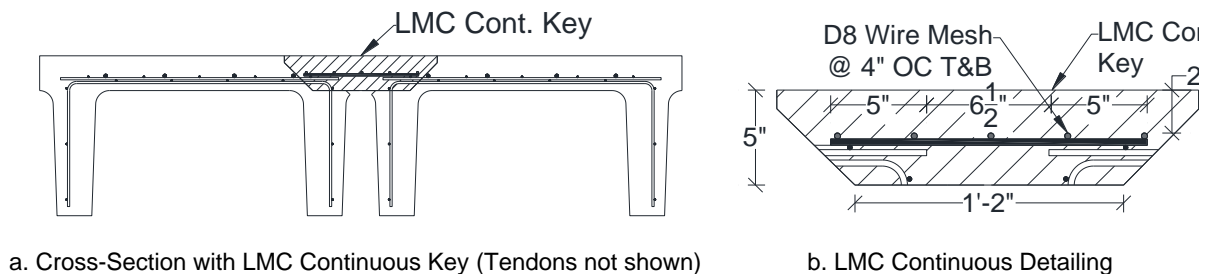


Figure 7-8. LMC Continuous Rehabilitation Detailing

7.2 Fabrication and Assembly

The girders were fabricated in Mitchell, SD. The girders were prepared and cast in four days on a 140-ft long prestressing bed (Fig. 7-9a). On day one, the prestressing strands were initially tensioned to 3,000 lb. to remove slack in the tendons, and strain gauges were installed on the tendons. On day two, the strands were jacked to 31 kips; then wire mesh and longitudinal joint anchors were placed in the prestressing bed. On day three, the embedded concrete strain gauges were installed in the deck between wires in the mesh. Subsequently, the girders were cast (Fig. 7-9b). Fresh concrete properties (e.g. slump, air, density, and temperature) were measured, and 18 standard cylinders were collected. The girders were covered and steam cured overnight. On day four, the concrete strength was 5,680 psi, which was higher than the minimum release strength of 5,000 psi. Subsequently, the strands were cut with a torch (Fig. 7-9c); then the girders were removed from the prestressing bed (Fig. 7-9d). Strain data was measured during various stages of construction to determine elastic shortening losses.



a. Prestressing Bed



b. Concrete Casting



c. Cross-section with Torched Stands



d. Removal from Formwork

Figure 7-9. Fabrication of Double-Tee Girders

The test girders were stored in the manufacturer's yard for six months and then delivered to the Lohr Structures Laboratory at South Dakota State University (SDSU) with a semi-truck trailer. The girders were unloaded using a 15-ton overhead crane (Fig. 7-10a) and then were placed on reaction blocks (Fig. 7-10b)



a. Unloading



b. Placement on Abutment

Figure 7-10. Unloading and Placement of Girders

The girders were surveyed to measure cambers. The camber of girder A and B was 0.85 in. and 0.6 in., respectively, with a 0.25-in. differential camber.

7.2.1 Conventional Bridge Joint Completion

The girder steel angles and steel plates were welded in the Lohr Lab (Fig. 7-11a) by a certified welder to connect the adjacent girders. Subsequently, the keyway was filled with non-shrink grout (Fig. 7-11b) to complete the joint. The grout was cured for three days and reached a compressive strength of 5,853 psi.



a. Welding Steel Plate to Angles Embedded in Girders



b. Grouting Girder-to-Girder Keyway

Figure 7-11. Fabrication and Grouting of Conventional Joint Detailing

7.2.2 Rehabilitated Bridge Joint Completion

Since double-tee bridges are common in rural areas, simple and locally available techniques were sought for the rehabilitation. Saw-cutting and hammer-chipping were then selected in the present study to rehabilitate the joints.

The continuous joint was demolished and cast in two segments to avoid bridge instability. An actual double-tee girder with continuous exposed bars at the both sides of the girder may become unstable in the field. Each segment covered 25% of the bridge length. The rehabilitation began with saw-cutting

(Fig. 7-12a) the perimeter of the joint to a depth of 1 in. Then, 15- and 30-lb pneumatic hammer chippers (Fig. 7-12b) were utilized to remove the deck concrete with a 45-degree side slope for both the continuous (Fig. 7-12c and 7-12d) and pocket joints (Fig. 7-12e).



a. Saw-cutting



b. Pneumatic Hammer Chipper



c. Continuous Joint Demolishing – Segment I



d. Continuous Joint Demolishing – Segment II



e. Pocket Demolishing

Figure 7-12. Demolition of Longitudinal Joint of Double-Tee Bridge Test Specimen

After chipping the concrete and exposing the deck reinforcement, the surface was cleaned with compressed air, then wetted for 24 hours (Fig. 7-13). Sand-blasting should be used to improve the bond; however, it was not feasible in this experimental study due to Lohr Lab restrictions.



a. Continuous Joint Surface Preparation – Segment I



b. Continuous Joint Preparation – Segment II



c. Pocket Joint and Intermediate Keyway



d. Wet Burlap

Figure 7-13. Rehabilitated Joint Surface Preparation in Double-Tee Bridge Test Specimen

The formwork for Segment I of the continuous joint was made with plywood with intermediate blocking (Fig. 7-14a-b). Styrofoam (Fig. 7-14c) was used to separate the segments. A significant LMC leak was noticed using this method. For Segment II of the continuous joint, the formwork was modified using Styrofoam (Fig. 7-14d), and no leak was observed.

The as-built continuous joint reinforcement (Fig. 7-14e) was 4 by 4-in., D8/D8 welded wire mesh with a total width of 16 in., installed 2.25 in. below the deck surface. A minimum splice length of 5 in. was provided on the both sides of the joint. The pocket reinforcement (Fig. 7-14f) was 12.5-in. long in both directions and was installed with a clear cover of 2.75 in. from the top of the deck. A minimum splice length of 3 in. was provided in the transverse direction of the bridge in each pocket.



a. Top View, Continuous Joint Segment I Formwork



b. Underneath View, Continuous Joint Segment I Formwork



c. Block-out Formwork



d. Continuous Joint Segment II Formwork



e. Continuous Joint Reinforcement



f. Pocket Reinforcement

Figure 7-14. Formwork and Reinforcement of Rehabilitated Joints in Double-Tee Bridge Test Specimen

The continuous joint was poured with a premix LMC using a 12-cubic ft drum mixer (Fig. 7-15a), batching six 50-lb bags for three minutes. As previously mentioned, the continuous joint was poured in two segments. Wheelbarrows (Fig. 7-15b) were lifted onto the bridge, using a forklift to pour the joints. Figure 7-15c shows the finished continuous joint poured with LMC. The pocket joint was poured with a premix UHPC (with 2% steel fibers). The average batching time for four bags of UHPC was 20 minutes, using a seven cubic ft mortar mixer (Fig. 7-15d). The average static flow of the UHPC was 8 inches. Figures 7-15e to 7-15f show the pouring and the finishing of the pocket joint.

Two-in. standard cubes were cast for LMC, and 3-in. diameter cylinders were cast for UHPC. The cylinders were sealed and cured at ambient room temperature. The 2-in. LMC cubes were unmolded after 24 hours and then were placed in a steam room for curing.

After pouring, the joints were covered with wet burlaps and plastic sheets. The test specimen was cured for 14 days to allow UHPC to gain a compressive strength of 18 ksi.



a. Mixing LMC



b. Pouring LMC



c. Finished LMC



d. Mixing UHPC



e. Pouring UHPC



f. Finished UHPC

Figure 7-15. Casting UHPC and LMC in Rehabilitated Joints of Double-Tee Bridge Test Specimen

7.3 Instrumentation, Test Setup, and Loading Protocols

The instrumentation used in the experimental programs consisted of strain gauges, linear voltage differential transformers (LVDTs), load cells, and string potentiometers (string pots). This section presents the instrumentation plan of the bridge test specimen.

7.3.1 Instrumentation

Strain gauges were used for measuring the strains of the girders and the joint reinforcement as well as the girder concrete strains. Twelve gauges were installed on the girder tendons, and six concrete strain gauges were embedded in the deck.


Thirteen LVDTs were used to measure displacements, slippage, and rotations of critical locations in the experiment. The four mid-span LVDTs measuring vertical deflection of the stems from the bottom, were removed during strength testing and were replaced with four string pots to prevent damage of LVDTs. Two LVDTs were used to measure vertical compression of the elastomeric bearing pads at the support, to calculate the net mid-span deflections. Six LVDTs were used to measure either vertical or

horizontal relative displacements between the deck and the longitudinal joint. Two LVDTs (one on the top of the deck and one at the bottom of the girders) were used to measure the rotation of the girders in the transverse direction of the bridge.

The end reactions of each girder were determined by placing four 100-kip load cells under each stem at the south end. The load cells were placed between two 1 by 6 by 6 in. steel plates for adequate bearing. An elastomeric bearing pad was placed between the plate and the girders to allow free rotation.

7.3.2 Test Setup


Figure 7-16 shows the full-scale bridge test setup. A 146-kip hydraulic actuator was used to apply point loads at the mid-span on girder A (Fig 7-16a) with 11-in. offset from the joint centerline. The load was applied on a 1.5 by 10 by 20-in. steel plate, which was seated above plaster (Fig. 7-16b). The plate area represents the truck tire loading area. Water dams (Fig. 7-17) were formed above the rehabilitated longitudinal joint to identify leakage.

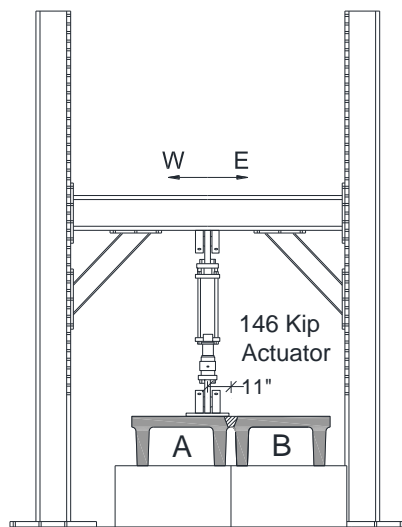

a. Cross-Section View of Test Setup



b. Actuator Head with Loading Plate

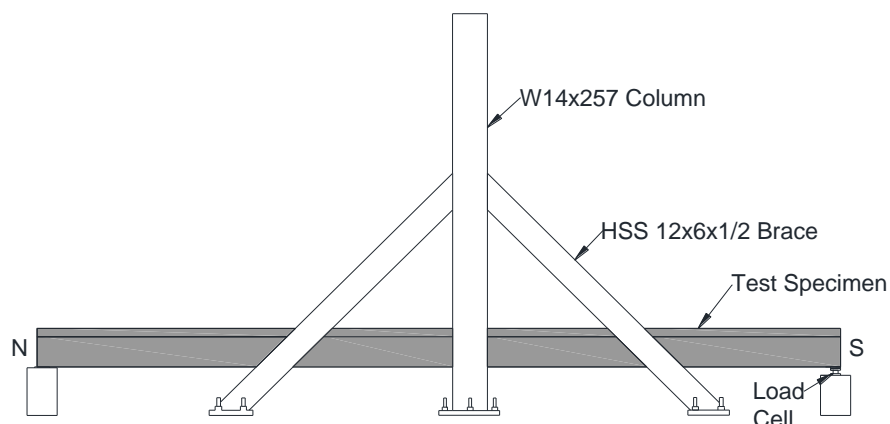

c. Elevation View of Test Setup

Figure 7-16. Full-Scale Double-Tee Bridge Test Setup



Figure 7-17. Water Dams on Rehabilitated Joint of Double-Tee Bridge Test Specimen

7.3.3 Loading Protocol

Table 7-1 presents the loading protocol for the bridge test specimen. Both conventional and rehabilitated specimens were tested under fatigue loading. The conventional bridge specimen was first tested under fatigue loading, then under a monotonic loading, to crack the longitudinal joint prior to the rehabilitation. Strength (ultimate) testing was performed on the rehabilitated specimen to determine the capacity of the bridge. Figure 7-18 shows the location and the area of the applied load for all testing phases.

Table 7-1. Full-Scale Bridge Loading Matrix

Testing Phase	Bridge Model	Load Type	Load Amplitude	No. of Cycles
I	Conventional Specimen	Cyclic Fatigue	21 kips	250,000
II	Conventional Specimen	Monotonic	50 kips	-
III	Rehabilitated Specimen	Cyclic Fatigue II	21 kips	500,000
IV	Rehabilitated Specimen	Cyclic Fatigue I	42 kips	100,000
V	Rehabilitated Specimen	Monotonic	To Failure	-

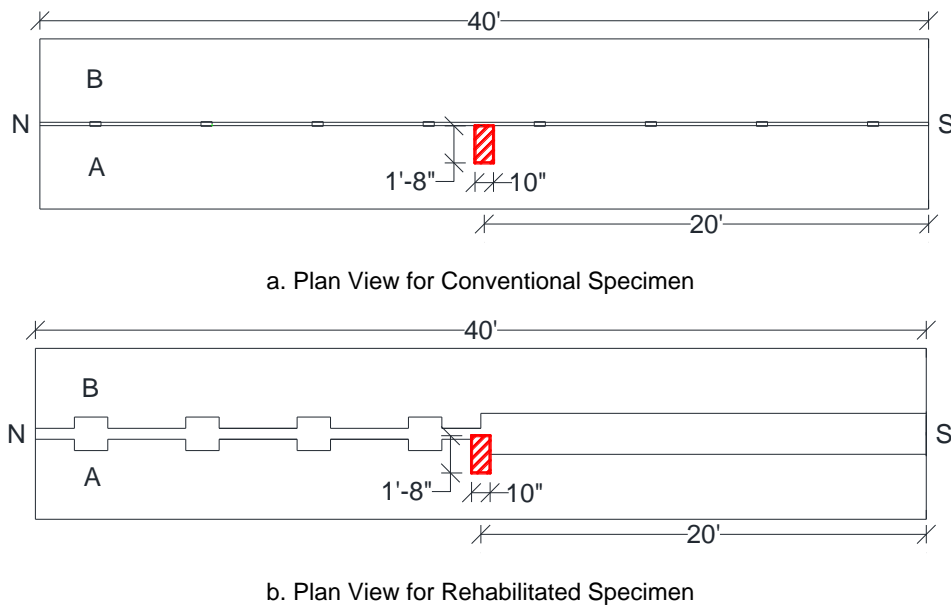


Figure 7-18. Applied Load Configuration and Location

7.3.3.1 Fatigue and Stiffness Testing

According to AASHTO LRFD (2013), the Fatigue II limit state loading was sufficient to evaluate the performance of this bridge for 75 years of service life. The bridge was tested under both Fatigue I and II loads, however, to maximize the demand on the rehabilitated joint. The fatigue II limit state loading consisted of a sinusoidal 21-kip load applied with a frequency of one cycle per second, which was applied to both conventional and rehabilitated specimens (Table 7-1). The fatigue I limit state loading consisted of a sinusoidal 42-kip load applied with a frequency of 0.7 cycles per second. The magnitude of the loads was determined using the moment envelope from the AASHTO fatigue I and II limit states for a two-lane 40-ft bridge. The load frequency was based on the test setup limitations.

The Average Daily Truck Traffic (ADTT) for local roads in SD was assumed to be 15. For the 75-year design life, 410,625 trucks would pass the bridge. The conventional bridge specimen was tested under 250,000 load cycles. The rehabilitated bridge specimen was first tested under 500,000 Fatigue II load cycles (surpassing the required 75-year design life) followed by 100,000 Fatigue I load cycles to maximize the joint load demands.

A bridge stiffness measurement was taken at intermediate load cycles. The stiffness of the conventional test specimen was measured at every 10,000 cycles, up to 100,000 load cycles. It was then measured at every 25,000 cycles to the end of fatigue testing. The stiffness of the rehabilitated test specimen under the Fatigue II and Fatigue I loading was measured every at 50,000 and 10,000 load cycles, respectively.

7.3.3.2 Strength (Ultimate) Testing

The conventional test specimen was monotonically loaded to 50 kips to crack the longitudinal joint prior to the rehabilitation. The rehabilitated test bridge was monotonically loaded to failure using a displacement-based controlled point load at the mid-span (Fig. 7-18) with a load increment of 0.1 in. and a displacement rate of 0.007 in. per second.

8 EXPERIMENTAL FINDINGS

This chapter includes the results of experimental studies on both conventional and rehabilitated full-scale double-tee bridge test specimens discussed in the previous chapter. The measured material properties and performance of both bridge test specimens under fatigue and strength loading are discussed.

8.1 Materials Properties

Many different cementitious and steel materials were incorporated in different components of the bridge test specimens. Presented in this section are the material properties for concrete used in the precast bridge girders, non-shrink grout used in the conventional longitudinal girder-to-girder joint, ultra-high performance concrete (UHPC) used in the rehabilitated longitudinal joint pockets, and latex modified concrete (LMC) used in the rehabilitated continuous longitudinal joint, and the steel reinforcement utilized in the precast bridge girders and the rehabilitated longitudinal joints.

8.1.1 Properties of Cementitious Materials

Presented in this section are the properties of fresh concrete and the compressive strength of precast concrete, non-shrink grout, UHPC, and LMC.

8.1.1.1 Precast Concrete

The properties of fresh concrete incorporated in the precast double-tee bridge girders measured in accordance with ASTM C143 (2015) and C231 (2016) are presented in Table 8-1. The requirements based on the manufacturer's mix design (Appendix C in Bohn, 2017) for fresh concrete were 6% (+1.5%, -1.0%) air content and a slump between 4 to 6 in. The girder concrete met the requirements.

Table 8-1. Properties of Precast Girder Fresh Concrete

Temperature (°F)	Air Content (%)	Unit Weight (lb/ft ³)	Slump (in.)
70	5.5	143.6	5

Standard 6-in. diameter cylinders were used for concrete sampling. The cylinders were steam cured for 12 hours onsite with the girders; then the cylinders were sealed and stored in the structures lab. The concrete compressive strength was measured in accordance to the ASTM C39 (2016) procedure. Tests were performed after 1 day, 7 days, 28 days of casting, and the day of fatigue and strength testing. Table 8-2 presents the compressive strength for concrete used in the girders. The manufacturer's 28-day compressive strength requirement of 6,000 psi was met.

Table 8-2. Compressive Strength of Girder Concrete

Time (Day)	f _c (psi)
1	5,698
7	7,192
28	7,636
Fatigue Test (Phase I)	8,783
Fatigue Test (Phase III)	9,230
Strength Test (Phase V)	9,512

8.1.1.2 Non-Shrink Grout

Standard 2-in. cube molds were used for sampling the non-shrink grout. The samples were stored and cured in a moist room. The compressive strength was measured in accordance with ASTM C109 (2016) procedures. Compressive tests were performed at 3 days, 28 days, and girder fatigue testing days. Table 8-3 presents the compressive strength for the non-shrink grout used in the longitudinal joint of the conventional test specimen. The South Dakota Department of Transportation (SDDOT) specifies a minimum 28-day compressive strength of 4,500 (SDDOT, 2004) for non-shrink grout, which was met.

Table 8-3. Compressive Strength of Non-Shrink Grout

Time (Day)	f _c (psi)
3	5,853
28	8,519
Fatigue Test (Phase I)	5,853

8.1.1.3 Ultra-High Performance Concrete (UHPC)

Three-inch diameter cylinders were used for sampling UHPC. The samples were sealed and stored in the structures lab. Compressive strength tests were carried out in accordance with ASTM C39 (2016) as well as the procedure specified by the UHPC provider. The samples were prepared by saw-cutting the surface to avoid any point load and were tested without bearing pads since pads cannot be used for materials stronger than 11,000 psi. Compressive tests were performed at 7, 14, fatigue, and strength testing days. Table 8-4 presents the compressive strength for UHPC used in the longitudinal joint of the rehabilitated test specimen. According to Graybeal (2010), the minimum field compressive strength for UHPC should be 18 ksi, which was met.

Table 8-4. Compressive Strength of UHPC

Time (Day)	f'_{UHPC} (psi)
7	11,480
14	19,716
Fatigue Test (Phase III)	19,716
Fatigue Test (Phase IV)	20,835
Strength Test (Phase V)	21,167

8.1.1.4 Latex Modified Concrete (LMC)

Standard 2-in. cube molds were used for sampling LMC. The samples were stored and cured in a moist room. The compressive strength was measured in accordance to the ASTM C109 (2016) procedure. Compressive tests were performed after 3 hours, 7 days, and 14 days of casting as well as the days of fatigue and strength testing. Table 8-5 presents the compressive strength for LMC used in the longitudinal joint of the rehabilitated test specimen. The longitudinal joint, incorporating LMC, was cast in two stages, seven days apart.

Table 8-5. Compressive Strength of LMC

Time (Day)	Phase I, f'_c (psi)	Phase II, f'_c (psi)
0.125 (3 Hours)	5,457	N/A
7	N/A	7,204
14	7,585	N/A
Fatigue Test (Phase III)	7,742	6,992
Fatigue Test (Phase IV)	8,103	7,283
Strength Test (Phase V)	7,571	7,494

8.1.2 Properties of Prestressing Strands

The prestressing strands used in the girders were seven-wire, Grade 270, 0.5-in. diameter low-relaxation strands, $A_s=0.153$ in². Table 8-6 presents the measured mechanical properties for the prestressing strands provided by the manufacturer.

Table 8-6. Tensile Properties of Prestressing Strands

Properties	0.5-in. Strands (ASTM A416)
Yield Strength, f_y (ksi)	258.4
Ultimate Strength, f_u (ksi)	285.2
Strain at Break, ϵ_r	7.4%
Modulus of Elasticity, E (ksi)	28,500

8.1.3 Properties of Steel Reinforcement

This section presents the mechanical properties of steel wires used in welded mesh and deformed reinforcing steel bars used in the joints. The mechanical properties were measured in accordance with the ASTM E8 (2016) procedure.

8.1.3.1 Reinforcing Steel Wires

The continuous joint was reinforced with ASTM A497 Grade 70, 4 by 4 in., D8/D8 weld wire mesh. The same type of wire was used in the girder flanges. Table 8-7 presents the measured mechanical properties for the steel wire.

Table 8-7. Tensile Properties of Steel Wires Used in Joints and Girders

Properties	D8 Wire (ASTM A497)
Yield Strength, f_y (ksi)	117
Ultimate Strength, f_u (ksi)	123
Strain at Peak Stress, ϵ_u	2.9%
Strain at Break, ϵ_r	19%

8.1.3.2 Reinforcing Steel Bars

Table 8-8 presents the measured mechanical properties of ASTM A615 Grade 60 No. 4 steel bars used in the UHPC pockets of the rehabilitated bridge.

Table 8-8. Tensile Properties of Reinforcing Steel Bars Used in UHPC Pockets

Properties	No.4 Bars (ASTM A615)
Yield Strength, f_y (ksi)	74
Ultimate Strength, f_u (ksi)	107
Strain at Peak Stress, ϵ_u	10%
Strain at Break, ϵ_r	16%

8.1.4 Properties of Elastomeric Neoprene Bearing Pads

Mingo (2016) tested a 6 by 6 by 3/8-in. elastomeric neoprene bearing pad in compression to determine the force-displacement relationship of the bearing pads used at the supports (Fig 8-1). The same neoprene pads were used in this study. The stiffness of the linear region of the force-displacement relationship was 1,128 kip/in.

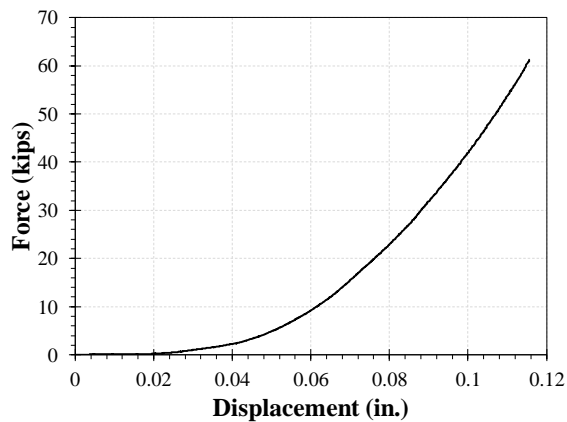


Figure 8-1. Measured Force-Displacement Relationship of Elastomeric Bearing Pad (after Mingo, 2016)

8.2 Bridge Test Results

This section presents the results of the conventional and rehabilitated bridge specimens tested under fatigue and strength loading.

8.2.1 Conventional Double-Tee Bridge Test Specimen

The conventional double-tee bridge specimen (in which the girder-to-girder connection detailing was the same as that currently used in practice) was first tested under 250,000 cycles of the Fatigue II loading (Phase I) applied at the mid-span. The point load was offset from the longitudinal centerline of the bridge to apply the force on only one girder and to maximize the shear load demand transferred between the girders. After the fatigue loading, the conventional bridge specimen was monotonically loaded as Phase II of the testing to crack the longitudinal girder-to-girder joint prior to the rehabilitation. The results of experimental testing of the conventional double-tee bridge specimen is discussed.

8.2.1.1 Phase I: Fatigue II Testing of Conventional Double-Tee Bridge

Figure 8-2 shows the measured stiffness versus the number of the load cycles during AASHTO Fatigue II testing. The stiffness of the specimen was defined as the slope of the measured load-displacement relationship. The net mid-span deflection (subtracting the total deflection and the compression of the bearing pads) of only girder A was used for the stiffness calculation since it was the loaded girder. Results indicated that the bridge stiffness essentially remained constant during the fatigue II testing, and no damage of the longitudinal joint or any other members of the bridge throughout 250,000 cycles of loading was observed.

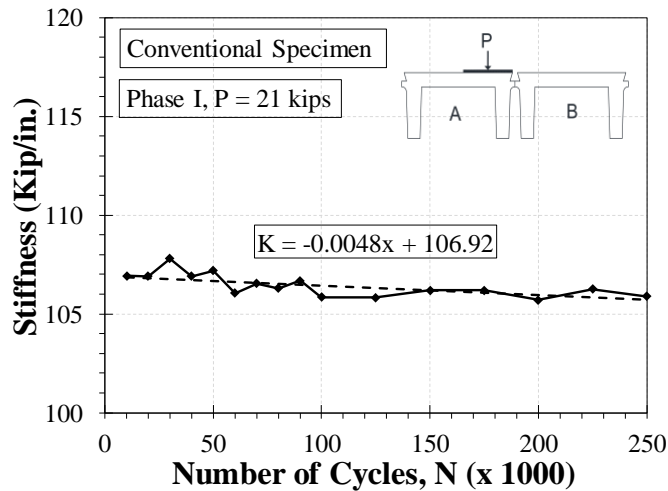


Figure 8-2. Stiffness Degradation during Fatigue II Testing of Conventional Double-Tee Bridge Specimen

Girder-to-girder joint relative vertical displacements were measured 2.0 ft away from the mid-span (Fig. 8-3). It can be seen that the measured joint relative displacements were negligible throughout the fatigue testing indicating no girder-to-girder joint damage.

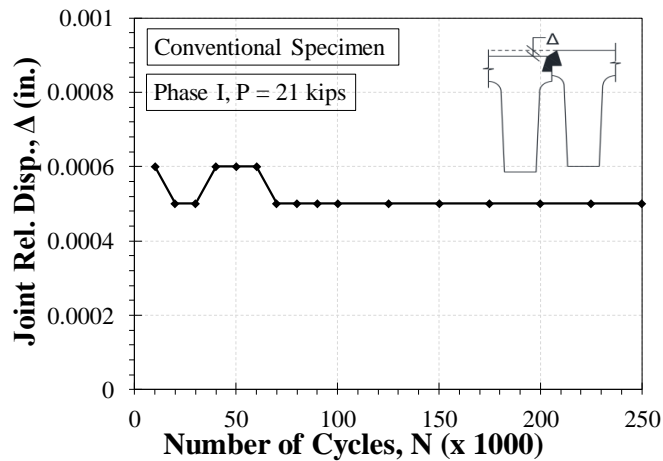


Figure 8-3. Longitudinal Joint Relative Displacement for Conventional Double-Tee Bridge Specimen during Fatigue II Testing

Girder-to-girder joint rotations (Fig. 8-4) in the transverse direction of the bridge were also measured 1.5 ft away from the midspan. The rotations were measured using two LVDTs: one was installed at the top of the deck (LVDT TR-1), and another was installed at the bottom of the stems (LVDT TR-2). Results indicated that the measured joint rotations were negligible throughout fatigue testing indicating the girder-girder joint did not degrade at this level of loading.


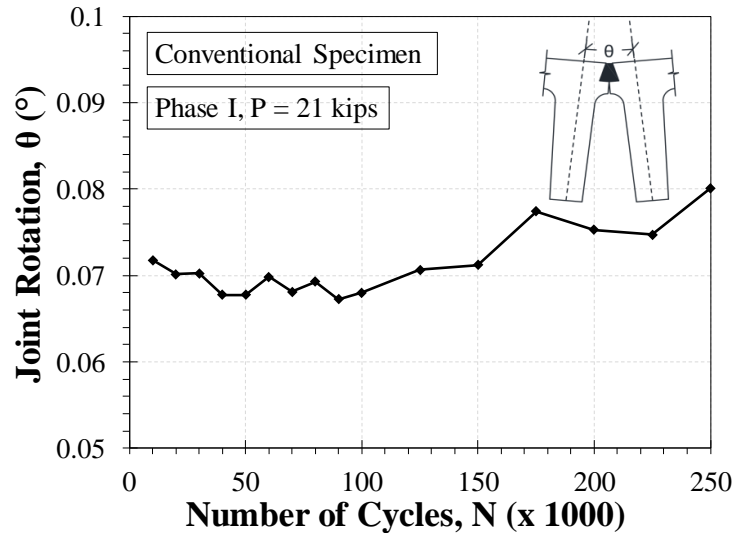


Figure 8-4. Girder-to-Girder Joint Rotation for Conventional Double-Tee Bridge Specimen during Fatigue II Testing

8.2.1.2 Phase II: Joint Crack Strength Testing of Conventional Double-Tee Bridge

After the fatigue II testing, the bridge specimen was monotonically loaded under a displacement controlled loading regime to 48.5 kips, where the girder-to-girder joint was cracked. The goal of this test was to damage the joint prior to the rehabilitation without cracking the girders.

The first crack in the joint was observed in the longitudinal direction of the bridge at the mid-span at a load of 44 kips (Fig. 8-5). More cracks were observed at the peak load of 48.5 kips, where the test was stopped to avoid girder cracking.

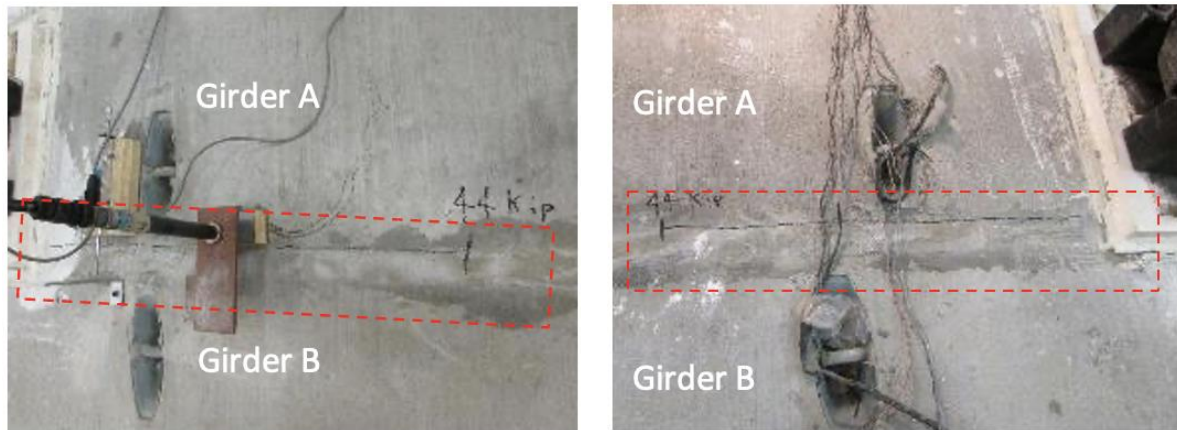

a. First Crack, North of Mid-span

b. First Crack, South of Mid-span

Figure 8-5. Girder-to-Girder Joint Cracking of Conventional Double-Tee Bridge Specimen

Figure 8-6 shows the force-displacement relationship for both girders (A and B) at the mid-span up to 48.5 kips at which the deflections of girders A and B were 0.48 and 0.39 in., respectively. Based on the measured strains, as well as the joint relative displacement data (discussed later in this chapter), the load at the first joint cracking was estimated to be 38.7 kips. The first joint cracking was observed at

44 kips. Joint cracking occurred, therefore, before reaching the AASHTO Service I limit state, which was equivalent to a mid-span point load of 51 kips. This indicates that the current girder-to-girder joint detailing for double-tee bridges is not sufficient, even for the service loads.

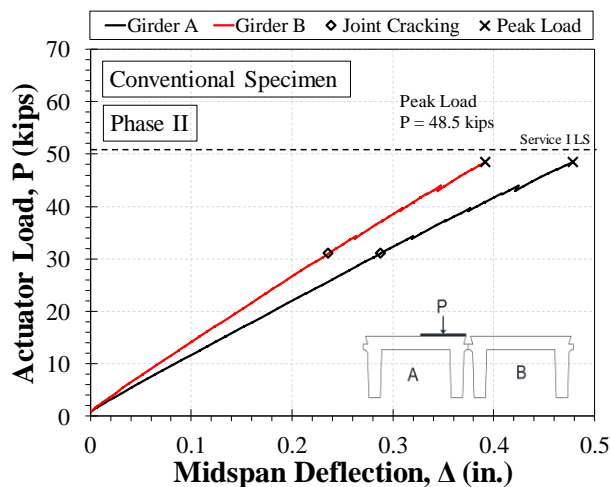


Figure 8-6. Force-Displacement Relationship for Conventional Double-Tee Bridge Specimen during Joint Crack Strength Testing

Load cells were used to measure south end reactions of the girders, one load cell per stem. The reactions were used to determine the girder load distribution based on a percentage of the applied load ($P/2$ per girder end). The girder end reactions at the beginning of the fatigue testing, after the fatigue testing, and at the joint cracking were compared in Fig. 8-7. Results indicated that the load distribution slightly changed during fatigue testing, but the change was significant when the longitudinal girder-to-girder joint cracked. In this case, Stem D did not resist any force resulting in an increase in forces of the other stems. This change in load transfer mechanism may crack the stems at higher loads or in the field.

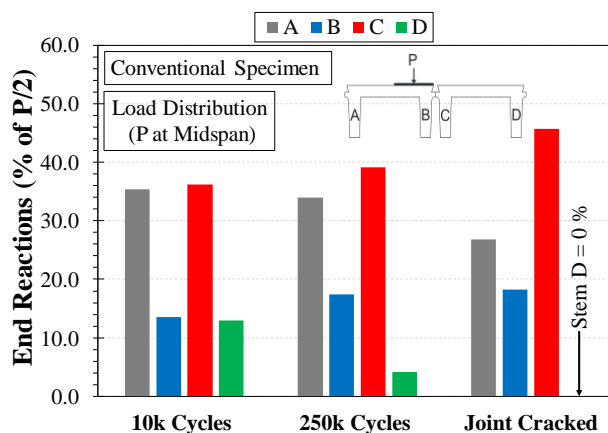


Figure 8-7. Girder Load Distribution for Conventional Double-Tee Bridge Specimen

Figure 8-8 shows the strains of the prestressing strands and concrete in the flange of the loaded girder (A) during the phase II testing. The maximum tensile strain at the extreme strand of the interior stem at the peak load of 48.5 kips was 462 micro-strain (prestressing strands are not included in Figure 8-8).

The estimated initial strain without any losses from 31-kip pre-tensioning is 7,109 micro-strain from structural mechanics. The yield strain of Grade 270 strands is 8,772 micro-strain. The summation of the strain demand and the prestressing strains suggested that the strands did not yield. The maximum compressive strain in the girder flange concrete was 92.1 micro-strain at the peak load of 48.5 kips. The embedded concrete strain gauges were located 3.5 in. below the girder surface.

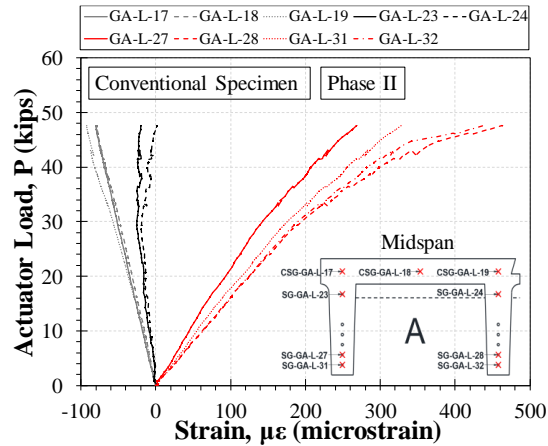


Figure 8-8. Measured Strains of Loaded Girder in Conventional Double-Tee Bridge Specimen during Joint Crack Strength Testing

Figure 8-9 shows the strain of girder B during Phase II testing. It can be seen that the maximum tendon tensile strain in girder B is 29% less than that in Girder A, which was the loaded girder. The maximum strain in the extreme strand of Girder B at the peak load of 48.5 kips was 329 micro-strain, which was less than the yield strain, even after adding the initial prestressing strains. The maximum compressive strain in the girder flange concrete was 80.4 micro-strain at the peak load of 48.5 kips. Similar to Girder A, the embedded concrete strain gauges were located 3.5 in. below the girder surface.

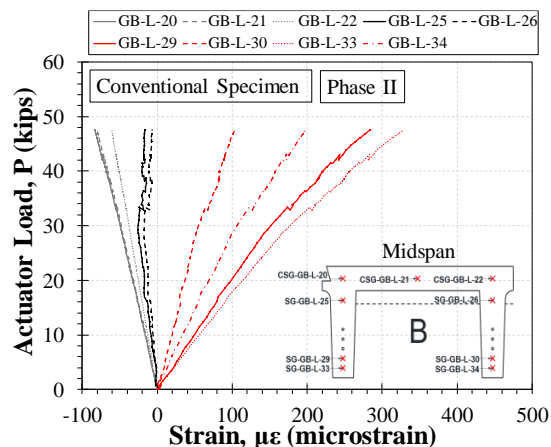


Figure 8-9. Measured Strains of Girder B in Conventional Double-Tee Bridge Specimen during Joint Crack Strength Testing

Girder-to-girder joint relative vertical displacements were measured 2 ft away from the bridge midspan. The measured joint relative vertical displacement was 0.001 in. at the peak load of 48.5 kips (Fig. 8-10), which was insignificant. Results indicated that the joint relative displacement decreased at 38.7 kips and higher loads, which can be attributed to the cracking of the longitudinal joint.

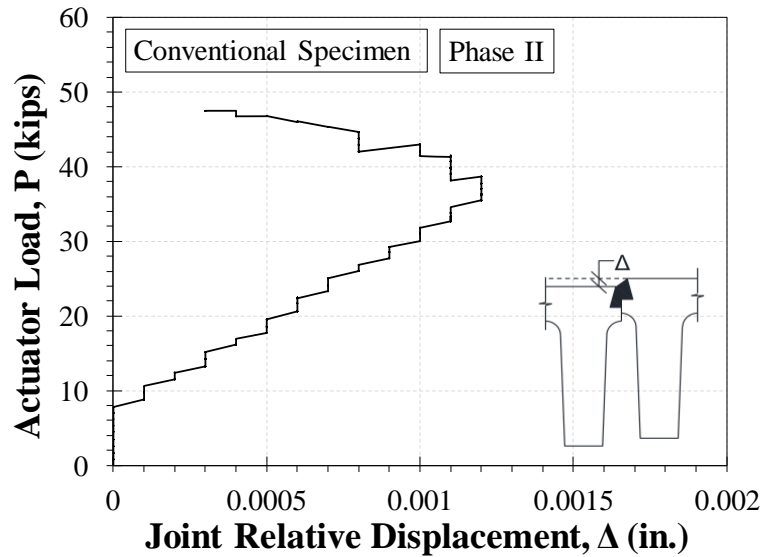


Figure 8-10. Longitudinal Joint Relative Displacement for Conventional Double-Tee Bridge Specimen during Joint Crack Strength Testing

Girder-to-girder joint rotations (Fig. 8-11) in the transverse direction of the bridge were measured 1.5 ft away from the mid-span. The measured joint rotation was 0.24 degrees at the peak load of 48.5 kips, which was significant compared to that of fatigue loading, confirming that the joint cracked. If the test were continued by applying larger loads, the rotation would have been increased significantly in a nonlinear manner. The test, however, was stopped to perform the rehabilitation.

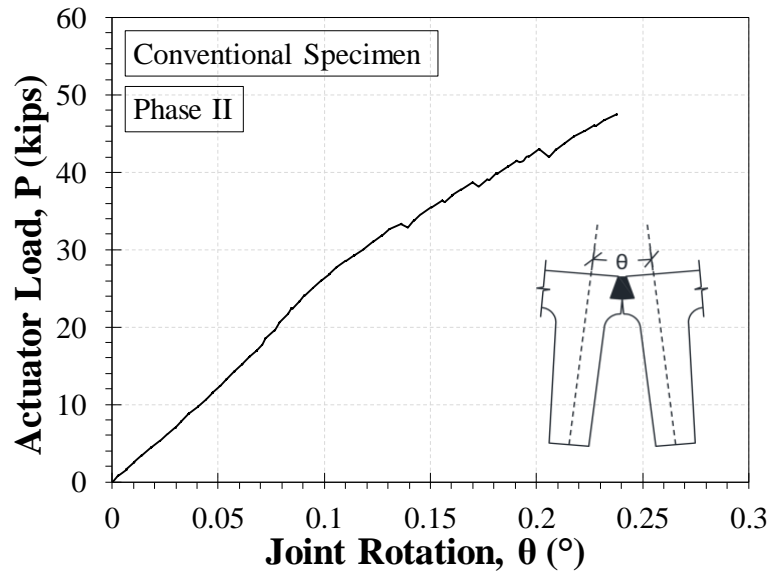


Figure 8-11. Girder-to-Girder Joint Rotation for Conventional Double-Tee Bridge Specimen during Joint Crack Strength Testing

8.2.2 Rehabilitated Double-Tee Bridge Test Specimen

After completion of the tests on the conventional double-tee bridge specimen, the bridge's girder-to-girder longitudinal joint was rehabilitated using two methods discussed in the previous chapters. The

longitudinal joint for one half of the bridge was rehabilitated using UHPC pocket detailing and the other half with continuous LMC detailing. The rehabilitated bridge specimen was initially tested under 500,000 cycles of AASHTO Fatigue II loading, which is referred to as “Phase III” hereafter, followed by an additional 100,000 cycles of AASHTO Fatigue I loading as “Phase IV.” Finally, the rehabilitated bridge was monotonically loaded to failure in “Phase V.”

8.2.2.1 Continuous Joint Cracking of Rehabilitated Double-Tee Bridge Prior to Testing

Several cracks were observed in the transverse direction of the bridge in LMC of the continuous joint prior to testing (Fig. 8-12). The cracks were spaced 12-in. apart along the length of the continuous joint. The LMC cracks are attributed to the expansion of the grout during the high-temperature rapid curing and restrained boundaries (adjacent girders) causing induced stresses at the time of cooling. No cracking was observed in the UHPC pockets.

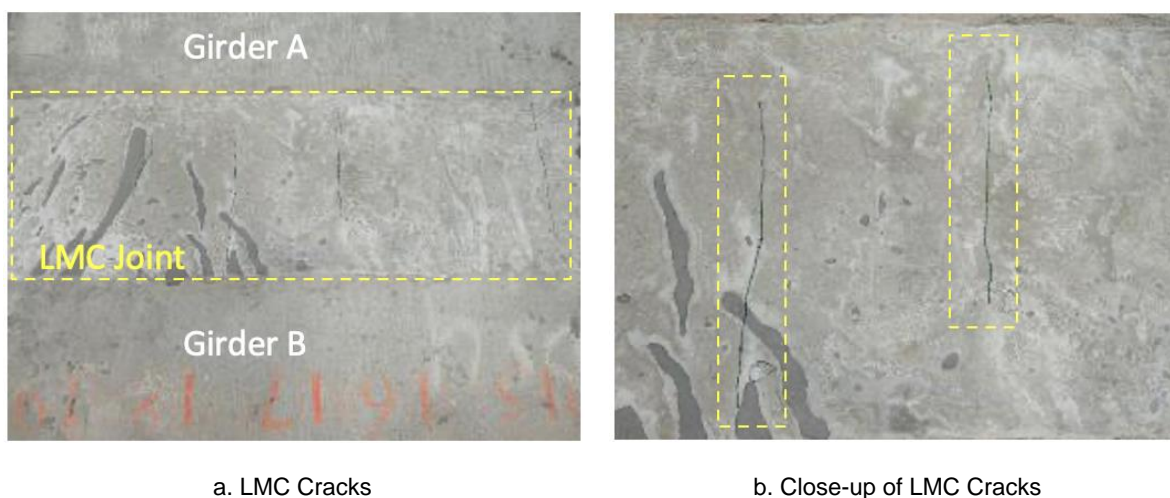


Figure 8-12. Transverse Cracks in Continuous Joint of Rehabilitated Double-Tee Bridge Specimen Prior to Testing

8.2.2.2 Phase III: Fatigue II Testing of Rehabilitated Double-Tee Bridge


Water was seeping through the LMC continuous joint cracks before the initiation of the fatigue II testing (Fig. 8-13a). The water seepage beneath the joint reduced after 500,000 cycles of the fatigue testing (Fig. 8-13b) perhaps because of the rehydration of LMC when the water penetrated. No additional leaks or any other damage was observed during the fatigue testing. The pocket joints that filled with UHPC did not damage or leak during the entire 500,000 cycles of the Fatigue II testing (Fig. 8-14a and b).



a. Leak in LMC before Testing



b. Leak in LMC after Fatigue Testing

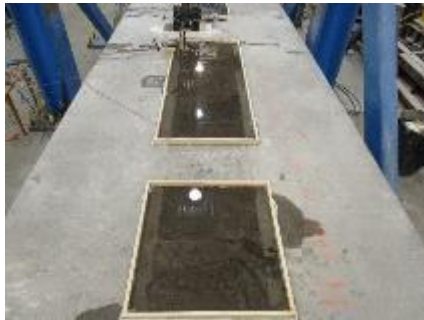

c. Before Testing – Top of Bridge



d. After Testing – Top of Bridge

Figure 8-13. Damage of Continuous Joint of Rehabilitated Double-Tee Bridge Specimen during Fatigue II Testing



a. Before Testing – Beneath Bridge



b. After Testing – Beneath Bridge



c. Before Testing – Top of Bridge



d. After Testing – Top of Bridge

Figure 8-14. Damage of UHPC Pocket Joints of Rehabilitated Double-Tee Bridge Specimen during Fatigue II Testing

Figure 8-15 shows the measured stiffness versus the number of the load cycles during the Fatigue II testing. The stiffness of the specimen was determined as explained in section 8.2.1.1. Direct observations indicated that the rehabilitated bridge stiffness essentially remained constant during the Fatigue II testing. No damage was observed for the pocket joint, continuous joint, or any other members of the bridge through 500,000 cycles of loading.

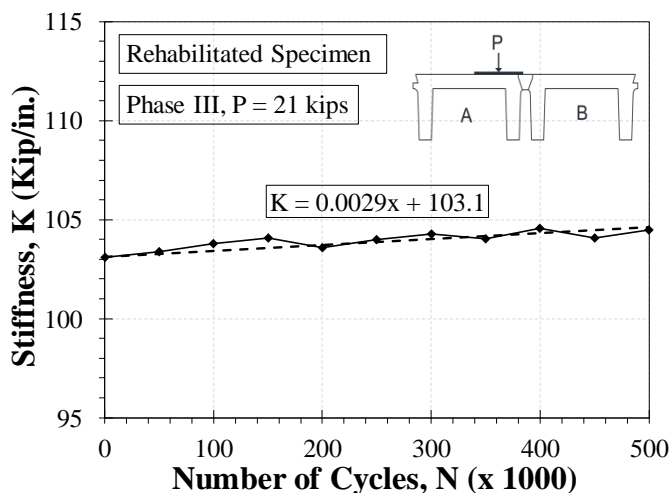


Figure 8-15. Stiffness Degradation during Fatigue II Testing of Rehabilitated Double-Tee Bridge Specimen

Girder-to-girder joint relative vertical and horizontal displacements for the rehabilitated bridge were measured (Fig. 8-16). Results indicated that the measured joint relative displacements were negligible throughout the Fatigue II testing, indicating no girder-to-girder joint damage.

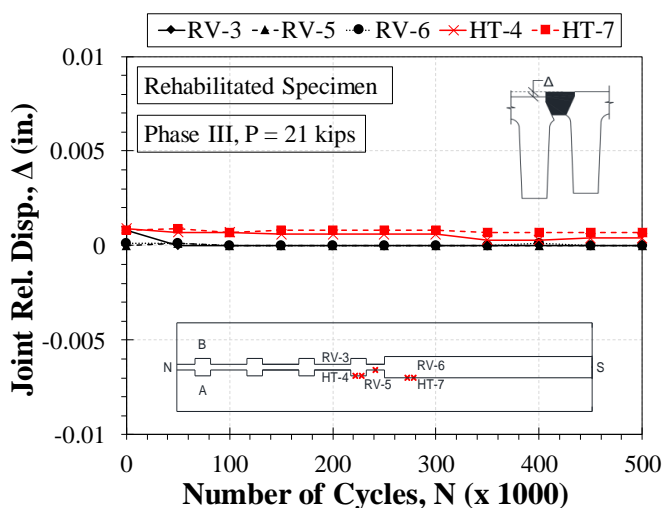


Figure 8-16. Longitudinal Joint Relative Displacements for Rehabilitated Double-Tee Bridge Specimen during Fatigue II Testing

Girder-to-girder joint rotations (Fig. 8-17) in the transverse direction of the rehabilitated bridge were also measured 1.5 ft away from the mid-span. Measured joint rotations were negligible throughout the Fatigue II testing, indicating that the rehabilitated girder-to-girder joints did not degrade.

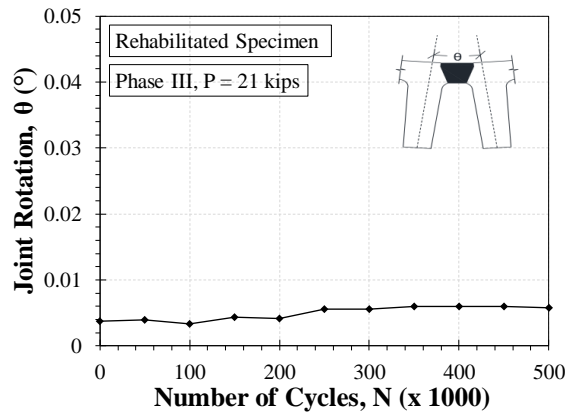


Figure 8-17. Girder-to-Girder Joint Rotation for Rehabilitated Double-Tee Bridge Specimen during Fatigue II Testing

8.2.2.3 Phase IV: Fatigue I Testing of Rehabilitated Double-Tee Bridge

Figure 8-18 shows the rehabilitated joint condition after Fatigue I testing. No new damage or leaks were observed beyond the LMC, prior to testing the cracks discussed in section 8.2.2.1, including LMC continuous joints or the UHPC pocket joints throughout 100,000 cycles of the Fatigue I testing.

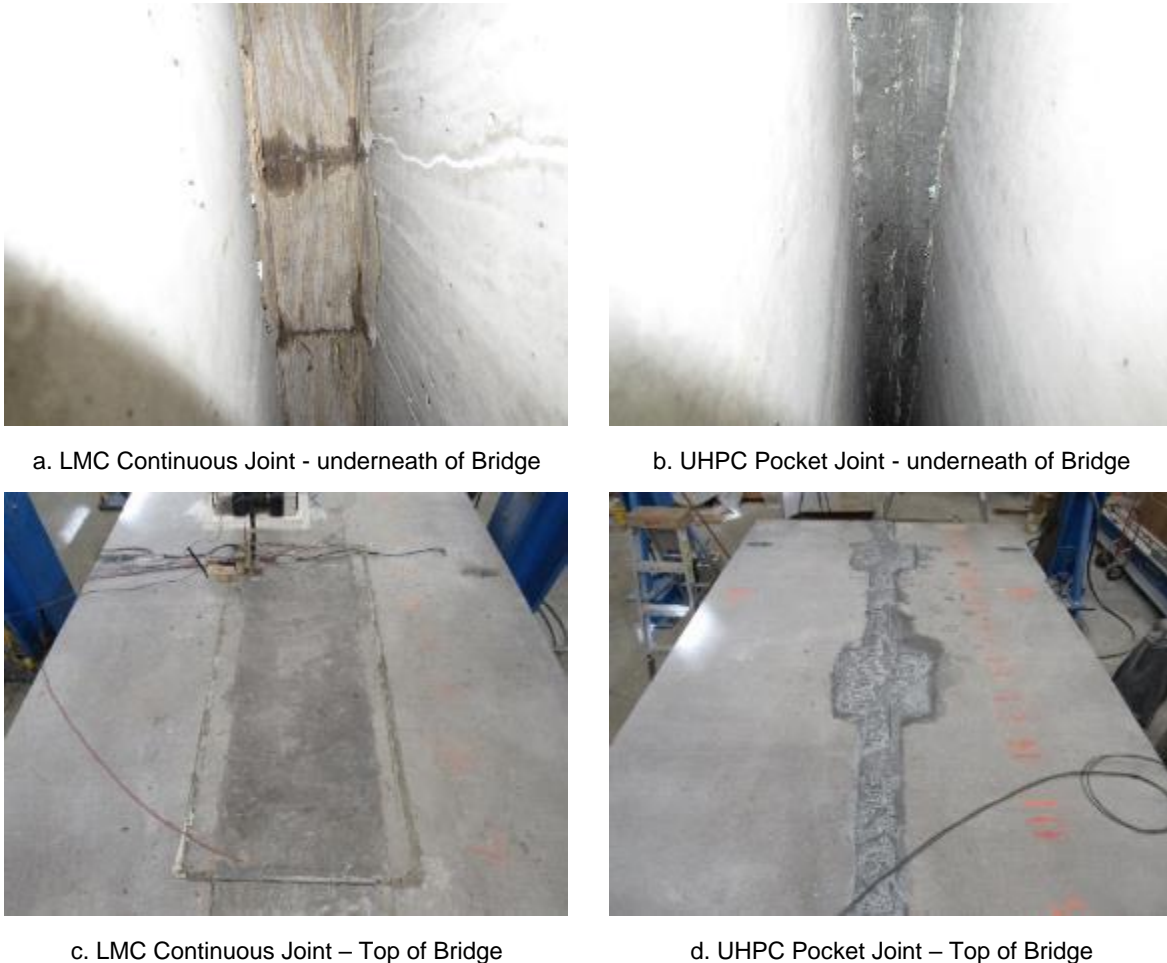


Figure 8-18. Damage of Rehabilitated Double-Tee Bridge Specimen after Fatigue I Testing

Figure 8-19 shows the measured stiffness, versus the number of the load cycles, during Fatigue I testing. The bridge stiffness essentially remained constant during Fatigue I testing.

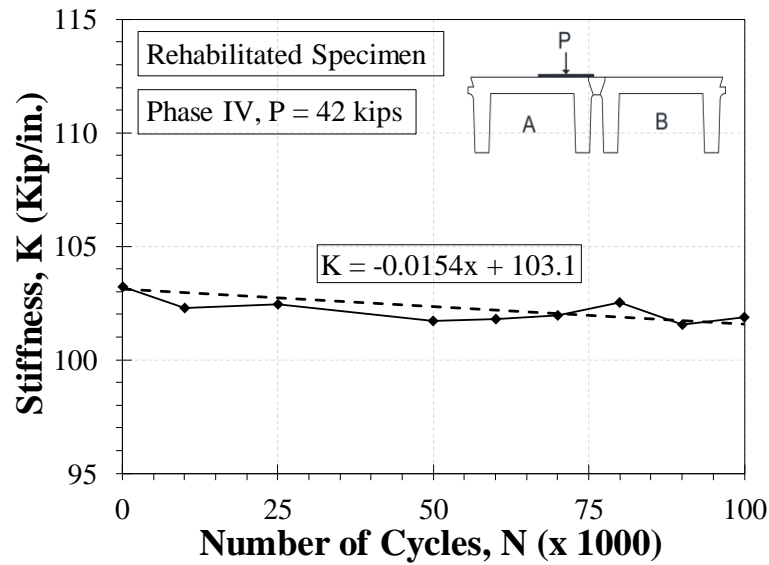


Figure 8-19. Stiffness Degradation for Rehabilitated Double-Tee Bridge Specimen during Fatigue I Testing

Figure 8-20 shows the rehabilitated girder-to-girder joint's relative vertical and horizontal displacements during Fatigue I testing. The measured joint's relative displacements were negligible throughout the testing, indicating no girder-to-girder joint damage.

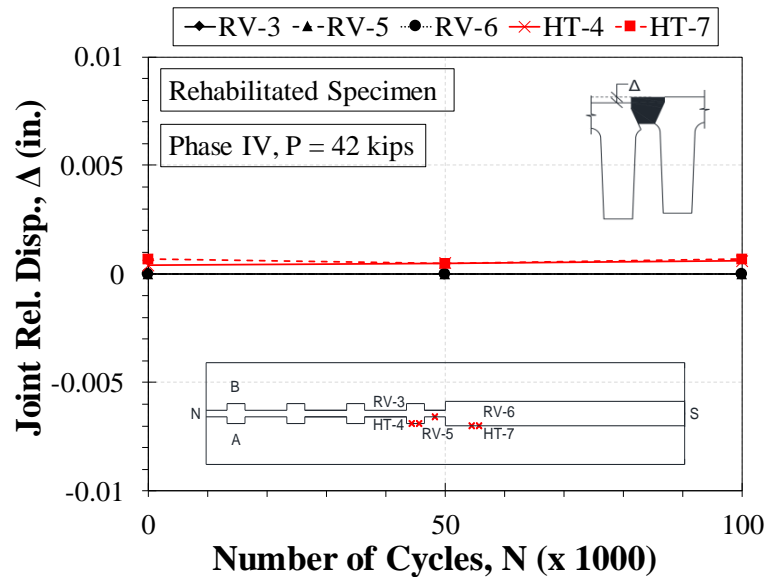


Figure 8-20. Longitudinal Joint Relative Displacement for Rehabilitated Double-Tee Bridge Specimen during Fatigue I Testing

Girder-to-girder joint rotations (Fig. 8-21), in the transverse direction of the bridge, were also measured 1.5 ft away from the mid-span. The measured joint rotations were negligible throughout Fatigue I testing, indicating that the rehabilitated girder-to-girder joint did not degrade.

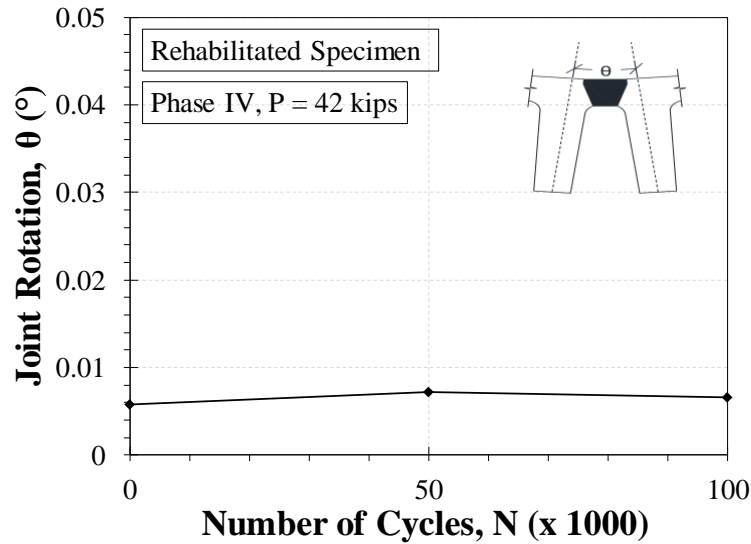


Figure 8-21. Girder-to-Girder Joint Rotation for Rehabilitated Double-Tee Bridge Specimen during Fatigue I Testing

8.2.2.4 Phase V: Strength (Ultimate) Testing of Rehabilitated Double-Tee Bridge

The rehabilitated bridge specimen was monotonically loaded at the mid-span of the bridge under a displacement controlled loading protocol to failure (Fig. 8-22). The mode of failure of the bridge was compression failure of the concrete at the girder top flange in a ductile manner, indicating that both rehabilitated joints were sufficiently strong to avoid connection failure and to make the bridge behave monolithically. The first crack was observed in the west stem of Girder A (loaded girder) at the mid-span during loading to 60 kips (Fig.8-22a). New cracks formed, extended, and widened on the stems of the both girders at higher displacement demands (Fig. 8-22b). Both girders exhibited ductile failure with a displacement capacity of 9.5 in. (Fig. 8-22c and d). No new damage beyond the LMC prior to testing cracks discussed in section 8.2.2.1 was observed in the LMC continuous joint or the UHPC pocket joints at the bridge failure (Fig. 8-22e and f).



a. First Crack During Loading to 60 kips on West Girder



b. East Side of Girder B Damage at 1.5-in. Deflection



c. Compressive Failure of Concrete at 9.5-in. Deflection



d. Bridge Condition at Failure



e. UHPC Pocket Joint after Testing



f. LMC Continuous Joint after Testing

Figure 8-22. Damage of Rehabilitated Double-Tee Bridge Specimen during Strength Testing

Figure 8-23 shows the force-displacement relationship for Girders A and B measured at the mid-span. Both girders acted similarly in a ductile fashion indicating monolithic behavior for the rehabilitated

joints. The girders reached and surpassed the AASHTO Service I limit state without cracking indicating sufficient structural performance. At the peak load of 113.9 kips, the deflection of Girders A and B was 7.56 and 7.14 in., respectively. The bridge failed at the Girder A at a displacement of 9.55 in. and the actuator load of 111.1 kips. The first girder crack was observed during loading of the bridge to 60 kips. The load amplitude at which the girders cracked, based on the strain data (discussed later, Fig. 8-25), was estimated to be 53.8 kips. Overall, both rehabilitation methods were found to be structurally viable.

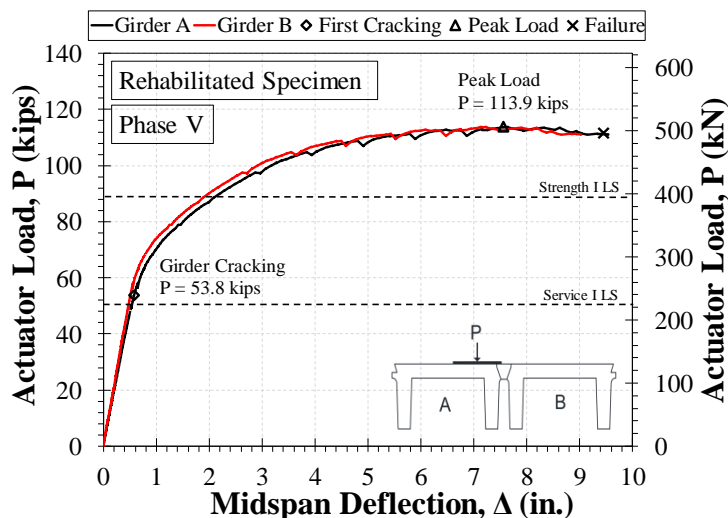


Figure 8-23. Force-Displacement Relationship for Rehabilitated Double-Tee Bridge Specimen During Strength Testing

Load cells were used to measure south end reactions of the girders, one load cell per stem. The reactions were used to determine the girder load distribution based on a percentage of the applied load ($P/2$ per girder end). The girder end reactions at the beginning of the fatigue testing, after the Fatigue II and Fatigue I testing, and at AASHTO service I and strength I limit states were compared in Fig. 8-24. Results indicated that the load distribution remained approximately the same throughout all phases of testing showing sufficient girder-to-girder detailing for the rehabilitated joints.

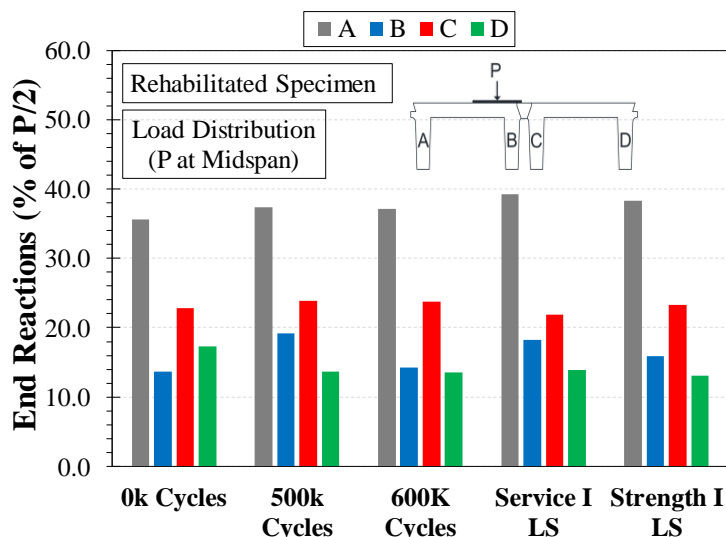


Figure 8-24. Girder Load Distribution for Rehabilitated Double-Tee Bridge Specimen

Figure 8-25 shows the strains of the prestressing strands and concrete in the flange of the loaded Girder A during strength testing. Cracking of girders can be identified using strain data where there is a sudden increase in reinforcement strains. The first girder cracking occurred at an actuator load of 53.8 kips (Fig. 8-25). Prestressing losses were not measured in this project. The initial strain in the prestressing tendon resulting from the 31 kip pre-tensioning force was calculated as 7,109 micro-strain. The yield strain of Grade 270 tendons is 8,772 micro-strain. Therefore, yield in the outermost prestressing tendon would occur at an actuator load of 71.2 kips, which induces 1,663 micro-strain in the tendon. The maximum strain in the extreme tendon in the right stem of Girder A at the peak load of 113.9 kips was 22,317 micro-strain. The maximum measured tendon strain at the girder's failure was 30,601 micro-strain. The maximum compressive strain in the concrete was 114 micro-strain at a load of 60.2 kips. The neutral axis of the section shifted upward when the applied load increased. For example, the neutral axis at a load of 79 kips was at a depth of 3.5 in. from the top of the girder where the embedded concrete strain gauges were installed. The unloaded section neutral axis was at a depth of 7.75 in. from the top of the girder.

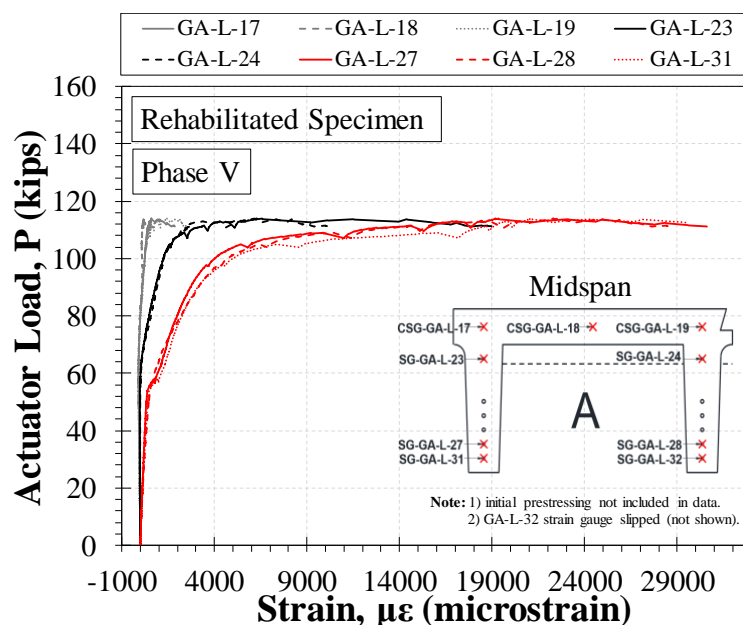


Figure 8-25. Measured Strains of Loaded Girder in Rehabilitated Double-Tee Bridge Specimen during Strength Testing

Figure 8-26 shows the strains of the prestressing strands and concrete in the flange of Girder B during the strength testing. The first girder cracking occurred at an actuator load of 55.4 kips (Fig. 8-25). The yield strain of the extreme tendon was estimated to be 1,663 micro-strain, which corresponds to an actuator load of 75.6 kips. The maximum strain in the extreme tendon in the left stem of Girder B at the peak load of 113.9 kips was 23,552 micro-strain. The maximum measured tendon strain at the girder failure was 31,478 micro-strain. The maximum compressive strain in the concrete was -122 micro-strain at a load of 68.6 kips. The neutral axis of the section shifted upward to a 3.5-in. depth (location of embedded concrete strain gauges) from the top of the girder at a load of 92.5 kips. It can be seen that the maximum tendon tensile strain in Girder B is 3% more than that in Girder A, and the load at first cracking in Girder B is 3% higher than that in Girder A. Overall, both girders behaved monolithically with the same performance.

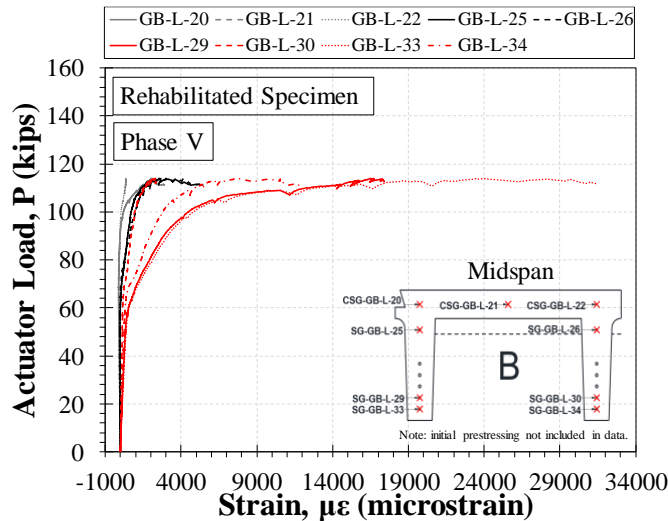


Figure 8-26. Measured Strains of Girder B in Rehabilitated Double-Tee Bridge Specimen During Strength Testing

Several strain gauges were also installed on the reinforcement of the rehabilitated joints. Figure 8-27 shows the strains of the transverse reinforcement in the UHPC pockets of the rehabilitated bridge during the strength testing. The reinforcement strains were higher in pocket P4 compared to the other pockets. The maximum pocket reinforcement strain at the girder failure was 1,839 micro-strain for the girder exposed steel D8 wires and 1,471 micro-strain for the pocket new No.4 steel bars. For pocket P3, the maximum reinforcement strain at the girder failure was 132 micro-strain in the exposed D8 wires and 767 micro-strain in the No.4 bars. The theoretical yield strain of Grade 70 steel wire and Grade 60 steel bars is 2,414 and 2,069 micro-strain, respectively. None of the UHPC pocket reinforcement yielded, even at the girder failure meeting joint capacity-protected requirements. Joints are capacity-protected according to the AASHTO thus they shall not fail before the connecting member failure.

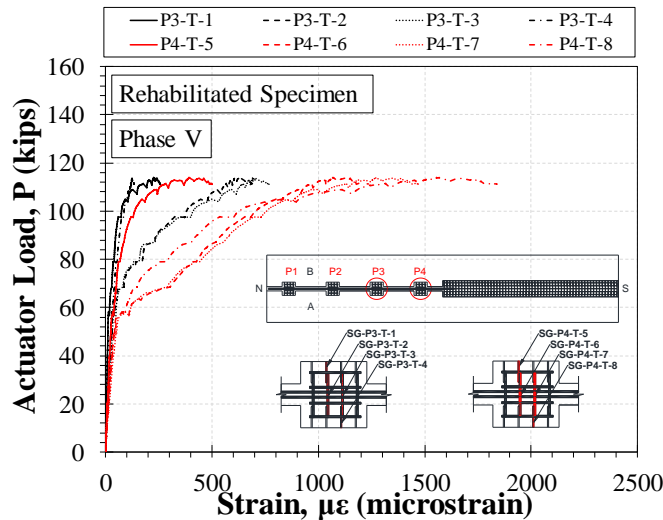


Figure 8-27. Measured Strains of Transverse Reinforcement in UHPC Pockets of Rehabilitated Double-Tee Bridge Specimen During Strength Testing

Figure 8-28 shows the strains in the transverse reinforcement of the LMC continuous joint during the strength testing. The strains of one of the steel wires located under the applied load were higher than the others, mainly due to stress concentration. The strain of this wire at girder failure was 2,949 micro-strain, which was 20% higher than the wire yield strain. The strain of another wire located 12 in. away from the point load at the girder failure was 1,272 micro-strain, which was 50% lower than the wire yielding. Reinforcing steel wires in the rehabilitated continuous joints of double-tee bridges, therefore, are not expected to yield, even under the AASHTO strength I limit state.

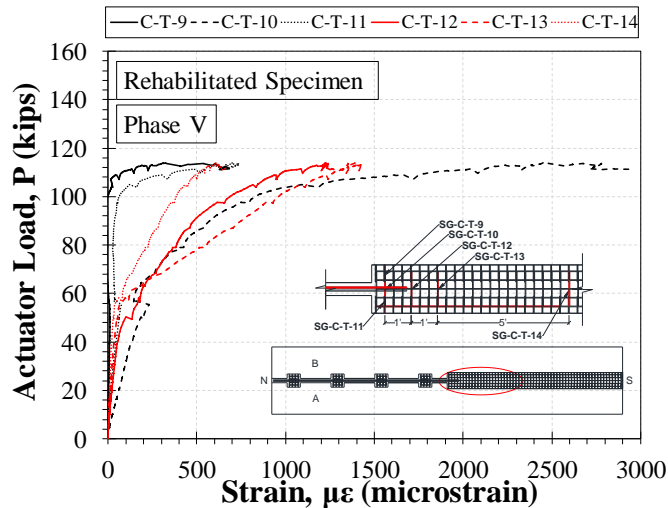


Figure 8-28. Measured Strains of Transverse Reinforcement in LMC Continuous Joint of Rehabilitated Double-Tee Bridge Specimen during Strength Testing

Figure 8-29 shows the strain in the longitudinal reinforcement in both the pocket and continuous joints of the rehabilitated bridge during strength testing. The reinforcement strains were all compressive. The maximum measured compressive strain at girder failure was -777 micro-strain, which is in the linear-elastic range.

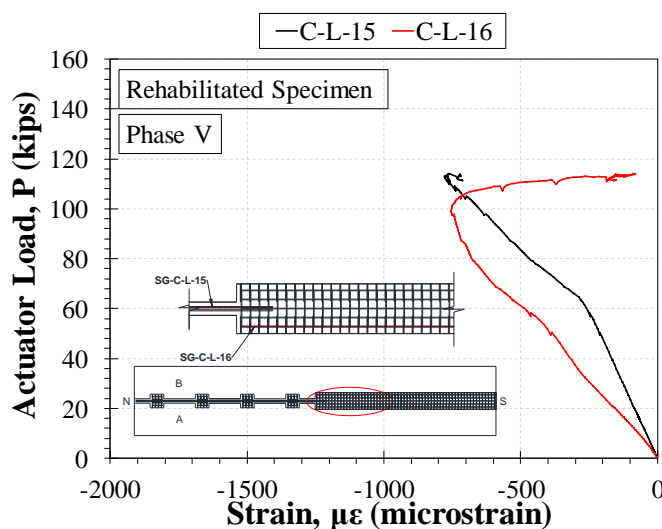


Figure 8-29. Measured Strains of Joint Longitudinal Reinforcement in Rehabilitated Double-Tee Bridge Specimen during Strength Testing

Figure 8-30 shows the girder-to-girder joint relative displacements during strength testing. The girder-to-girder relative vertical displacement closest to the applied point (RV-5) at the girder failure was 0.0062 in. Based on the measured data, it can be inferred that the UHPC joint close to the loading plate and between the two UHPC pockets cracked at an actuator load of 56.8 kips, which was higher than the AASHTO Service I limit state of 51 kips. However, no crack was observed for the UHPC joint at this load level. The relative joint displacement was considered insignificant, therefore. The joint relative vertical displacements were negligible at other locations at the pocket and continuous joints.

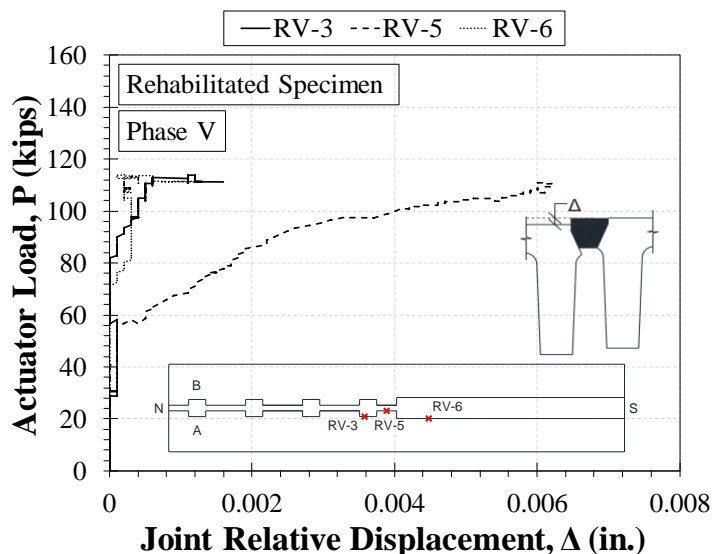


Figure 8-30. Girder-to-Girder Joint Relative Displacement for Rehabilitated Double-Tee Bridge Specimen during Strength Testing

Girder-to-girder joint rotations (Fig. 8-31) in the transverse direction of the bridge were measured 1.5 ft away from the mid-span. The measured joint rotation was 0.009 degrees, which was negligible, at the girder failure.

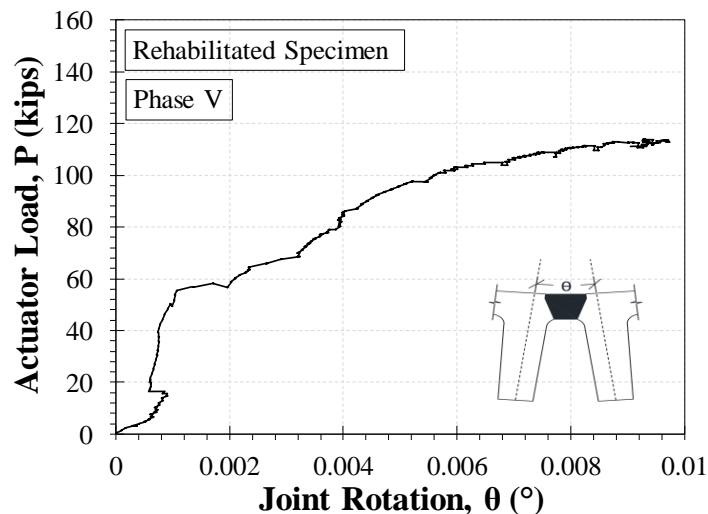


Figure 8-31. Girder-to-Girder Joint Rotation for Rehabilitated Double-Tee Bridge Specimen during Strength Testing

8.3 Performance of Double-Tee Bridges under Different Limit States

8.3.1 Double-Tee Bridge Test Specimens

A full-scale 40-ft long double-tee bridge, incorporating the conventional girder-to-girder joint detailing, was first tested to crack the joint. Subsequently, the bridge joint was rehabilitated using two methods. The rehabilitated bridge was then tested under AASHTO Fatigue II, Fatigue I, Service, and Strength limit states to investigate the performance of the rehabilitated bridge and to obtain data in order to comment on the suitability of the proposed joint detailing.

The response of the rehabilitated bridge tested in the present study was compared with that of two double-tee bridges tested by Wehbe et al. (2016) in which one bridge was built with the conventional detailing, and the other was constructed with continuous girder-to-girder detailing. The conventional girder-to-girder joint detailing was the same as that used in the present study, which consisted of discrete steel plates welded to embedded anchors in a shear key that was then filled with a non-shrink grout. In the continuous joint detailing (suitable for new construction but not for rehabilitation), the flange transverse wires were extended outside the double-tee girders, then were lap spliced with the adjacent girder extended wires along the entire length of the bridge. The joint was completed by pouring a non-shrink grout. Wehbe et al. (2016) evaluated the performance of both the conventional girder-to-girder detailing of a double-tee bridge and the new continuous joint detailing through full-scale testing of double-tee bridges. The geometry, detailing, material properties, and testing procedures of the bridges tested by Wehbe et al. (2016) were the same as those for the rehabilitated bridge tested in the present study.

8.3.2 Observed Damage

8.3.2.1 Rehabilitated Double-Tee Bridge

Transverse cracks were observed in LMC utilized in the continuous joint of the rehabilitated bridge prior to testing (Fig. 8-32). The cracks were spread along the entire length of the continuous joint and spaced at 12 in. The cracks were deep allowing water to penetrate through the joint. These cracks had no effect on the structural performance of the rehabilitated continuous joint. No cracks or leaks were observed in UHPC incorporated into the rehabilitated pocket joint, prior to or during all phases of the testing. The UHPC was found to be a durable and structurally viable material for this project.

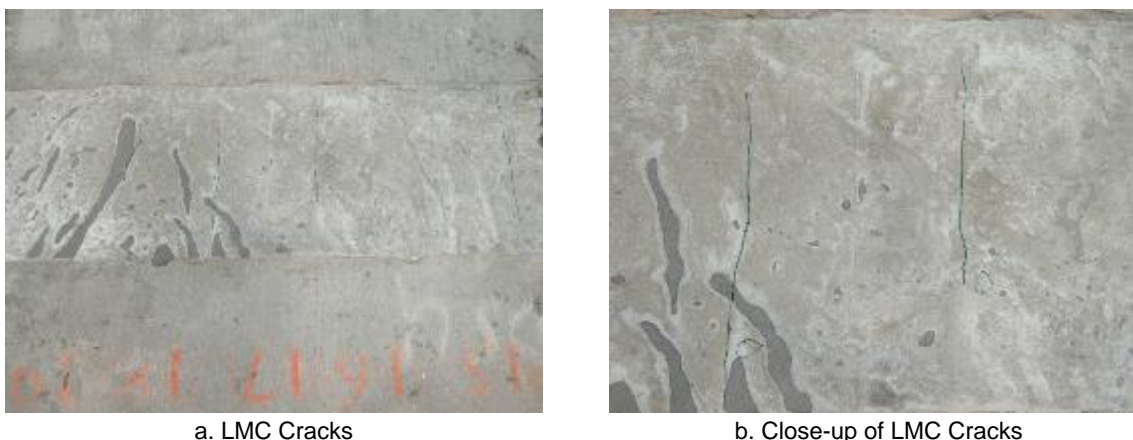


Figure 8-32. Transverse Cracks of Continuous Joint in Rehabilitated Double-Tee Bridge

8.3.2.2 Newly Constructed Double-Tee Bridges with Conventional or Continuous Joints

Wehbe et al. (2016) observed no cracks or leaks in the longitudinal joint of the continuous double-tee specimen throughout fatigue and strength testing. The longitudinal joint of the conventional specimen started leaking at 19,500 load cycles, grout spalled at 43,000 load cycles, and the connection failed at a load cycle of 62,000 during the AASHTO fatigue I testing. The conventional joint failed during the strength testing by headed-stud pullout before reaching the AASHTO strength limit state requirements.

8.3.3 Fatigue Performance

8.3.3.1 Rehabilitated Double-Tee Bridge

Approximately 411,000 trucks will pass a bridge located on a SD local road for a 75-year design life based on an ADTT of 15. The rehabilitated test bridge was subjected to 500,000 cycles of AASHTO Fatigue II loading at the mid-span, followed by an additional 100,000 cycles of AASHTO Fatigue I loading. The point load applied at the mid-span was equivalent to the maximum moment that two interior double-tee girders would experience under truck loading for limit states specified in AASHTO (2013). The rehabilitated bridge specimen experienced no stiffness degradation throughout the fatigue testing (Fig. 8-33 and 8-34). A total of 600,000 fatigue cycles is equivalent to 110 years of service for a bridge on a local road in SD. No damage beyond those discussed for LMC was observed in the fatigue testing, indicating sufficient structural performance for the rehabilitated bridge.

8.3.3.2 Newly Constructed Double-Tee Bridges with Conventional or Continuous Joints

The bridge with the conventional longitudinal joint (Wehbe et al., 2016) degraded rapidly under 100,000 cycles of AASHTO Fatigue II loading (Fig. 8-33) or 60,000 cycles of AASHTO Fatigue I loading (Fig. 8-34), confirming that conventional longitudinal joint detailing is not structurally adequate for long-term performance.

Overall, the double-tee bridge specimens with either rehabilitated or continuous girder-to-girder detailing performed sufficiently under fatigue loading and are suitable for field applications.

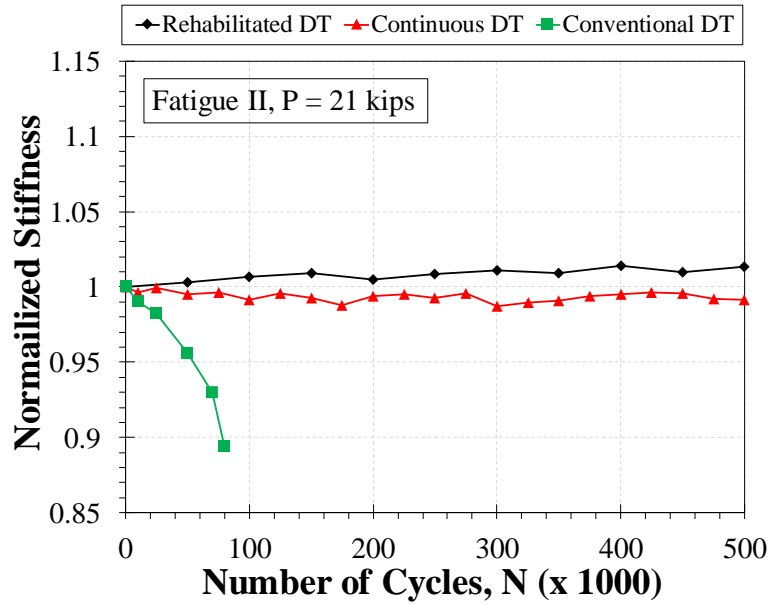


Figure 8-33. Stiffness Degradation for Different Double-Tee Bridges under AASHTO Fatigue II Loading

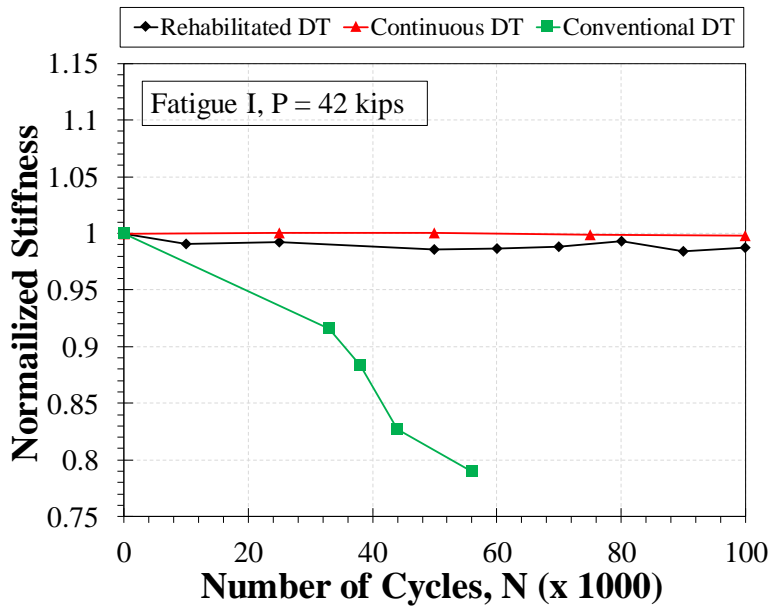


Figure 8-34. Stiffness Degradation for Different Double-Tee Bridges under AASHTO Fatigue I Loading

8.3.4 Force-Displacement Relationships

Figure 8-4 shows the force-displacement relationships for the rehabilitated double-tee bridge, the conventional double-tee bridge, and the double-tee bridge with continuous joint detailing. The AASHTO Service I and Strength I limit states are also included.

8.3.4.1 Rehabilitated Double-Tee Bridge

The rehabilitated specimen did not crack under the Service I limit state. The first crack of the girders of the rehabilitated bridge was at a force of 53.8 kips. The load carrying capacity of the rehabilitated bridge was 113.9 kips, which was 28% higher than the Strength I limit state indicating sufficient performance. The failure mode of the rehabilitated bridge was compressive failure of the girder flange concrete at 9.55 in. of displacement in a ductile manner.

8.3.4.2 Newly Constructed Double-Tee Bridges with Conventional or Continuous Joints

The bridge with the continuous detailing (Wehbe et al., 2016) performed similarly to the rehabilitation bridge in terms of force-displacement response (Fig. 8-35). The force-displacement relationship was approximately the same as that for the rehabilitated specimen with 113-kip load capacity and 9 in. of displacement capacity. The conventional bridge was insufficient, however, since it did not meet AASHTO limit state requirements. The girders of the conventional double-tee specimen cracked at 40 kips, prior to the Service I limit state of 51 kips. The girder-to-girder joint failed at a load equivalent to 70% of the Strength I limit state where the headed studs of the embedded steel plates pulled out from the girder concrete.

Overall, the performance of the rehabilitated bridge was found to be acceptable, since it behaved as a monolithic cast-in-place bridge. Both rehabilitation methods, pocket and continuous joints, are structurally viable, but UHPC should only be used as filled material due to improved durability.

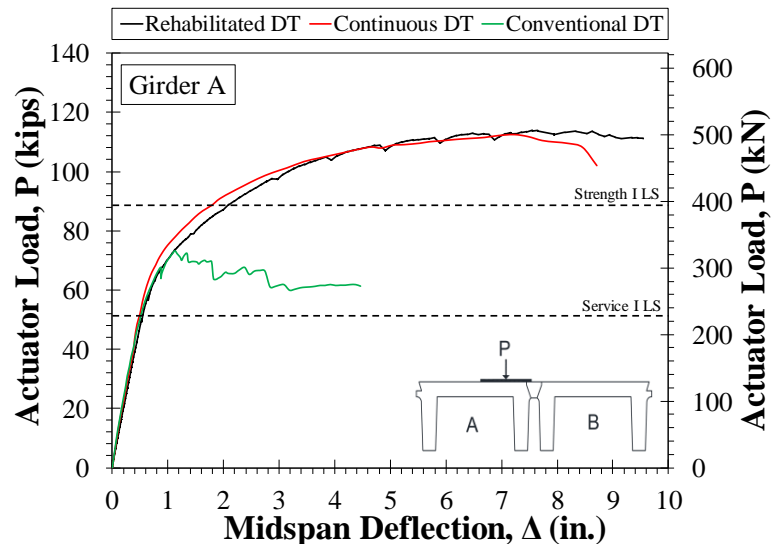



Figure 8-35. Force-Displacement Relationships for Loaded Girders of Different Double-Tee Bridges

8.4 Constructability of Proposed Joint Rehabilitation Methods

This section includes a discussion of the constructability of the pocket and continuous joint rehabilitation methods.

8.4.1 Method of Demolishing

The perimeter of the pocket and continuous joint was saw-cut using a portable, gas powered diamond-blade concrete saw. This process was very easy. The longitudinal joint was demolished using hammer-chipping at a 45-degree inclination. The hammer-chipping was somewhat tedious since the girders were new and relatively undamaged and built with concrete with a compressive strength of 9,000 psi. The hammer-chipping was more effective when using a 30-lb pneumatic hammer-chipper. A 30-lb pneumatic hammer-chipper should not be used, however, when exposing the reinforcement and finishing the joint. Some minor spalling of the concrete stem was noticed during demolition (Fig. 8-36a). The disturbed areas were patched with the filler material using a formwork consisting of Styrofoam and plywood (Fig. 8-36b). The formwork was installed from the top and removed relatively easily from the bottom of the bridge. A significant amount of concrete debris fell through the joint during demolition. To catch falling debris, a catcher could be placed beneath the bridge. Overall, the hammer-chipping demolition process was found to be a viable method for field applications for both continuous and pocket joints.

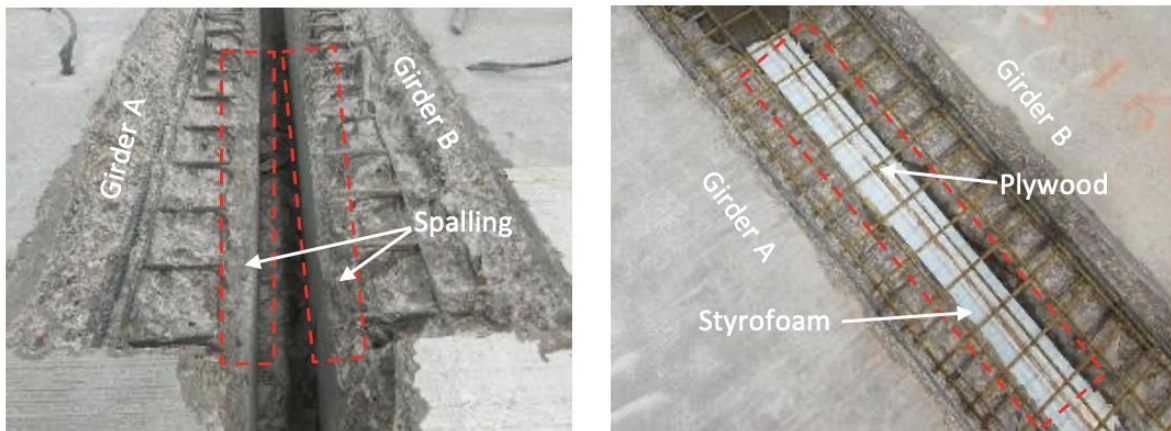

a. Girder Concrete Spalling

b. Formwork Placement

Figure 8-36. Joint Preparation for Rehabilitation

8.4.2 Construction of Rehabilitated Continuous Joint

The girder concrete was hammer-chipped in two stages each on 25% of the length of the bridge to form the continuous joint. This was done to improve the overall stability of the bridge by avoiding stem-to-deck connection failure. The wire mesh installation was easy and relatively fast. The time to demolish and prepare the continuous joint was 2.5 times longer than that for the pocket joint.

Premix LMC was used in the continuous joint as the filler material. The mix was simple and fast, since the premix LMC just requires water. The set time for LMC was only 30 minutes, which requires advanced planning and proper management of workforce in the field.

8.4.3 Construction of Rehabilitated Pocket Joint

The girder concrete was hammer-chipped to form the pockets. Preparation of the pocket joints was easier and 2.5 times faster than the continuous joint. The installation of the new reinforcing steel bars was relatively easy and fast.

Premix UHPC was used to fill the pockets. The UHPC mix is more involved and time consuming compared to conventional grout or LMC, since it requires adding premix powder, steel fibers, plasticizer, and water. Mortar mixers are required for mixing UHPC, and each batch of UHPC can take up to 20 minutes depending on the size of the mixer. Multiple or large mortar mixers should be used in field applications for batching UHPC. Unlike LMC, UHPC has a long working time. Static flow of the UHPC should be checked before placement.

8.5 Cost of Double-Tee Bridge Longitudinal Joint Rehabilitation

The cost of both the pocket and continuous joint rehabilitation methods was compared to the cost of superstructure replacement for a 40-ft long by 30.66-ft wide double-tee bridge.

The material and fabrication cost provided by the SDDOT for a 46-in. wide and 23-in. deep double-tee girder is approximately \$247 per linear foot. For a 30.66-ft wide bridge having eight girders and seven longitudinal joints, the total material and fabrication cost is \$79,040. Furthermore, crane mobilization, superstructure demolition and removal, and onsite activity costs should be included (Table 8-9). The superstructure replacement costs were also verified by a contractor.

Costs of double-tee bridge girder-to-girder joint rehabilitation were estimated by a contractor, who performed the rehabilitation of the double-tee test specimen in the Lohr Structures laboratory. The cost of the filler material was assumed to be \$88/ft³. The approximate cost of the “pocket” and “continuous” joint rehabilitation detailing for a 40-ft long and 30.7-ft wide bridge with eight double-tee girders was \$31,685 and \$64,856, respectively, which are 26% and 53%, respectively, of the cost of the bridge superstructure replacement.

Note aforementioned costs are raw and do not include mobilization, markup, taxes, fees, and insurance costs. A catch system is also needed underneath the bridge to collect debris during construction. The cost of a metal deck catcher is between \$30k to \$40k for a 40-ft long 31-ft wide bridge. The cost of a heavy-duty debris safety net for a 40-ft long 31-ft wide bridge is less than \$5,000. The catcher cost was not included in the neither replacement nor rehabilitation option.

Both rehabilitation methods are structurally viable and are feasible in the field. In conclusion, the pocket rehabilitation method is the cheapest solution to preserve in-service double-tee bridges. The pocket rehabilitation method offers approximately 70% cost saving compared to the superstructure replacement option.

Table 8-9. Rehabilitation vs. Replacement Costs for 40-ft Long Double-Tee Bridges

Type	Item	Cost
Superstructure Replacement	Girder Material and Fabrication	\$79,040
	Girder Demolition, Removal, and Construction	\$25,000
	Crane Mobilization	\$20,000
	Total	\$124,040
Superstructure Rehabilitation	Pocket Joint	\$31,685 (or 26% of Superstructure Replacement)
	Continuous Joint	\$64,856 (or 53% of Superstructure Replacement)

9 PROPOSED CONSTRUCTION SPECIFICATIONS

This chapter includes proposed construction specifications for the rehabilitation of double-tee bridge girder-to-girder longitudinal joints. The proposed rehabilitation details are valid for 23-in. deep double-tee girder bridges that are reinforced with welded wire fabrics in the flange (deck). Most double-tee bridges constructed after 2005 meet this requirement.

9.1 Preparation for Double-Tee Longitudinal Joint Rehabilitation

The general requirements for the demolition and preparation of double-tee bridge girder-to-girder longitudinal joints for field applications are the following:

1. A maximum 1-in. deep saw-cut shall be allowed around the perimeter of the joints for the ease in demolition.
2. Hammer-chipping should be allowed for existing concrete demolition if meeting all of the following requirements:
 - a. For pocket joint rehabilitation, concrete shall be chipped with a slope of 45°. Concrete of the intermediate shear keys between the pockets shall be chipped with a minimum of 20° with respect to a vertical line.
 - b. For continuous joint rehabilitation, concrete shall be chipped with a slope of 45°.
 - c. The use of either 15-lb or 30-lb pneumatic hammer chippers shall be allowed. However, the 30-lb hammer chippers shall not be used for demolishing of double-tee flange existing concrete deeper than 2.5 in. from the surface of the girder. In this case or in the vicinity of the girder reinforcement, only 15-lb hammer chippers shall be used.
3. The use of hydro-demolition shall be allowed to remove existing concrete from the double-tee girder flange and to form the joint.
4. After forming the joint and exposing the existing reinforcement, the joint surface shall be sand-blasted and pre-wetted with burlap for at least 12 hours prior to pouring.
5. Formwork shall be water tight and may be installed from the top of the bridge. Nets shall be installed beneath the bridge to catch falling debris.


9.2 Rehabilitation Methods for Double-Tee Longitudinal Joints

Feasibility and performance of two rehabilitation methods were investigated in the present study: (1) discrete pockets filled with Ultra-High Performance Concrete (UHPC) and reinforced with steel bars, and (2) continuous joints filled with Latex Modified Concrete (LMC) and reinforced with wire mesh. Of the two methods, only the UHPC pocket joint was found to be both structurally viable and durable. Even though the LMC continuous joint was structurally viable, it showed shrinkage cracks, which may cause serious durability issues in field applications. Therefore, only the UHPC filled pocket joint detailing should be used for the rehabilitation of double-tee bridge longitudinal joints. Continuous joint detailing may be an acceptable option for field applications if the joint is filled with UHPC or other material which does not shrink when used to fill relatively large gaps.


9.2.1 Pocket Detailing for Rehabilitation of Double-Tee Bridge Longitudinal Joints

Rehabilitation of girder-to-girder joints of double-tee bridges using the “pocket” detailing method shall be performed according to the following requirements:


1. Square pockets, each with a minimum side dimension of 18 in., shall be formed meeting the preparation requirements. For each girder-to-girder joint, one pocket shall be placed at the mid-span of the bridge, and two pockets shall be placed no more than 24 in. away from the ends of the bridge (Fig. 9-1). The spacing of pockets between the mid-span and the end-span pockets shall not exceed 5 ft center-to-center. The pocket shall be filled with UHPC with a minimum 28-day compressive strength of 18 ksi.
2. The square pockets shall be reinforced with at least four ASTM A706 (or A615) Grade 60 No. 4 reinforcing steel bars in both the longitudinal and transverse directions of the bridge (Fig. 9-2b).
3. A continuous shear key with a minimum width of 5.5 in. shall be formed meeting the preparation requirements then be filled with UHPC. The UHPC intermediate keyways shall be longitudinally reinforced with at least two ASTM A706 (or A615) Grade 60 No. 4 bars (Fig. 9-2c) for the entire length of the bridge. A minimum of 2.5 in. clear cover shall be provided for the longitudinal reinforcement.
4. A minimum of 3 in. lap-splice between the pocket reinforcement and the deck exposed wires shall be provided in the transverse direction of the bridge. This length ensures full bar development to fracture (Fig. 9-2b and c).

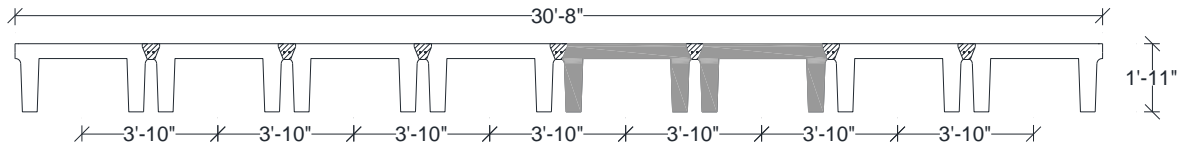

a. Cross-section of Two-Lane Double-Tee Bridges with Pocket Joints

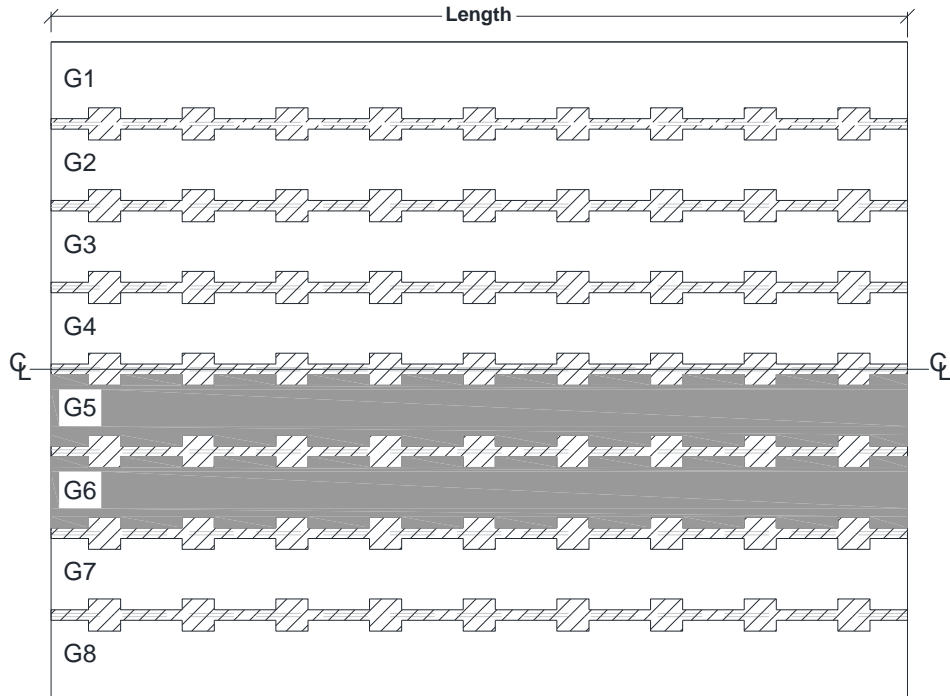


b. Plan view of Rehabilitated Double-Tee Bridges

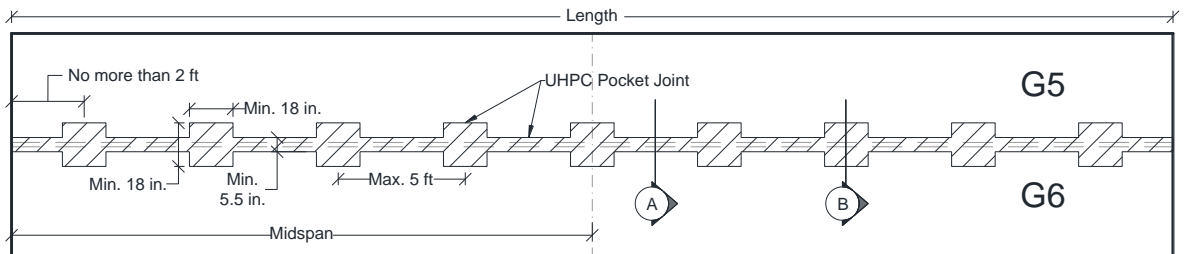


c. Dimensions for Rehabilitated Longitudinal Pocket Joint Detailing


Figure 9-1. Geometry Requirements for Proposed UHPC Pocket Joint Rehabilitation Method

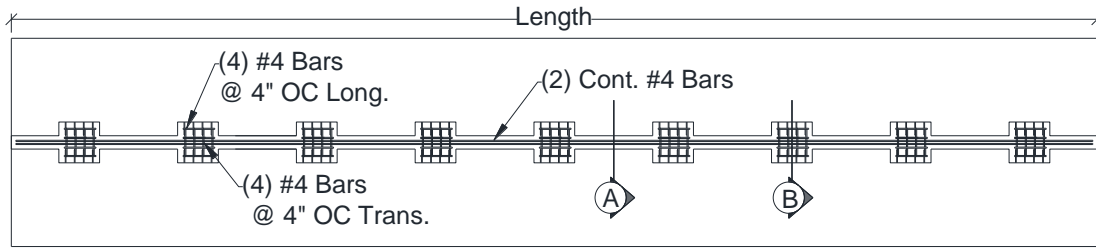

a. Pocket and Shear Key Reinforcement – Plan View

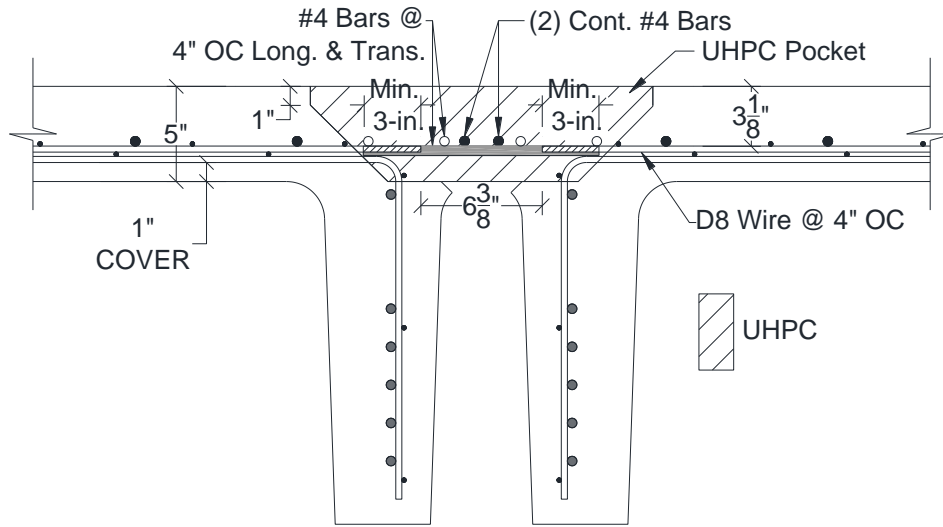

b. Section B - Pocket Joint Detailing

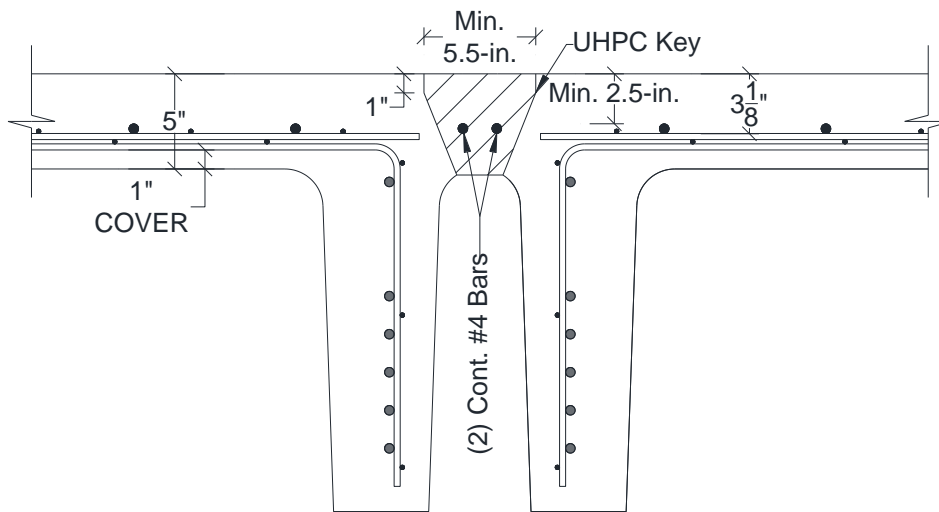


c. Section A – Shear key Detailing

Figure 9-2. Detailing for Proposed UHPC Pocket Joint Rehabilitation Method


9.2.2 Continuous Detailing for Rehabilitation of Double-Tee Bridge Longitudinal Joints

Rehabilitation of girder-to-girder joints of double-tee bridges using the “continuous” detailing method shall be performed according to the following requirements:


1. Demolition and construction for each longitudinal joint of the bridge using the “continuous” detailing method shall be performed using segmental construction with quarter-span increments per joint. Joints shall not be rehabilitated along the length of the bridge all at once. Two adjacent joints shall not be demolished and rehabilitated at the same time.
2. A continuous opening with a minimum width of 22 in. shall be formed (Fig. 9-3) meeting the preparation requirements. The joint shall be filled with UHPC with a minimum 28-day compressive strength of 18 ksi.
3. Other filler materials such as non-shrink grout, latex modified concrete, and fiber reinforcement concrete shall not be used for the continuous joints due to shrinkage cracking. New materials with improved durability suitable for filling large gaps may be used with bridge owner approval.
4. The continuous joints shall be reinforced with ASTM A497 Grade 70, 4 by 4 in. D8/D8 welded wire mesh (Fig. 9-4).
5. A minimum of a 5-in. lap-splice between the new and existing reinforcement shall be provided in the transverse direction of the bridge to ensure full development of the wires to fracture (Fig. 9-4b).
6. If wire meshes must be spliced over the length of the bridge, at least five No. 4 ASTM A706 (or A615) Grade 60 reinforcing steel bars shall be used to splice the wires in the longitudinal direction of the bridge with a minimum splice length of 12 in. per wire (Fig. 9-4c).

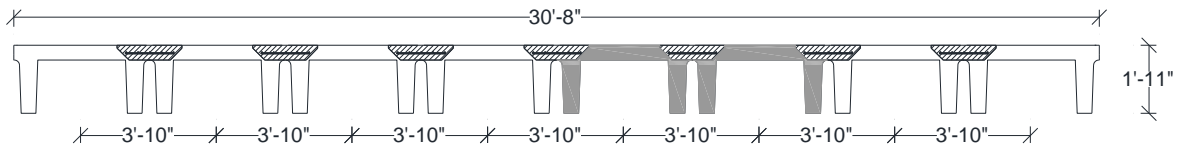

a. Cross-section of Two-Lane Double-Tee Bridges with Continuous Joints

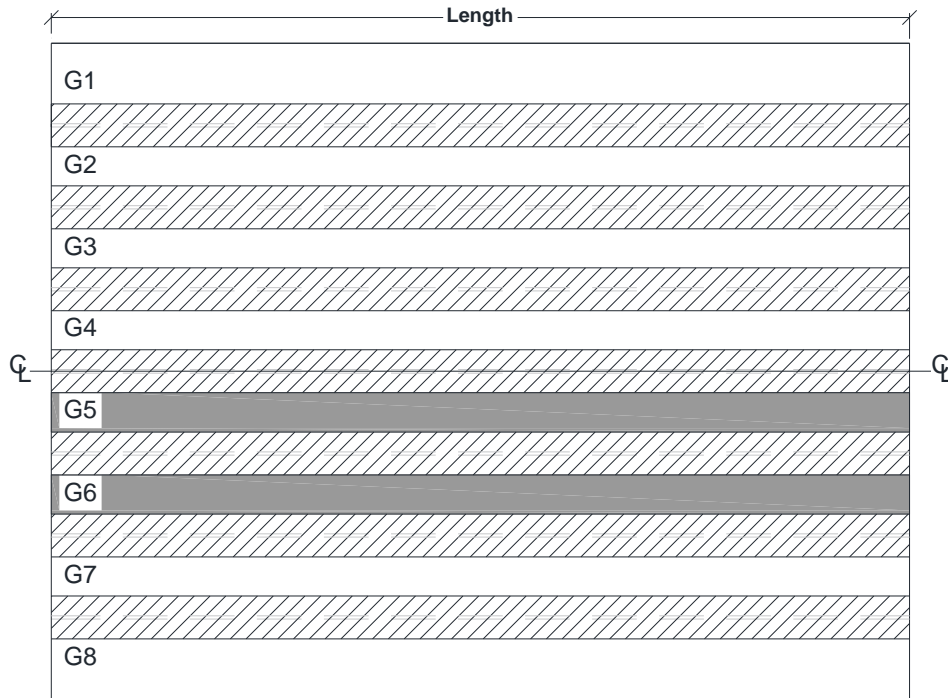


b. Plan view of Rehabilitated Double-Tee Bridges

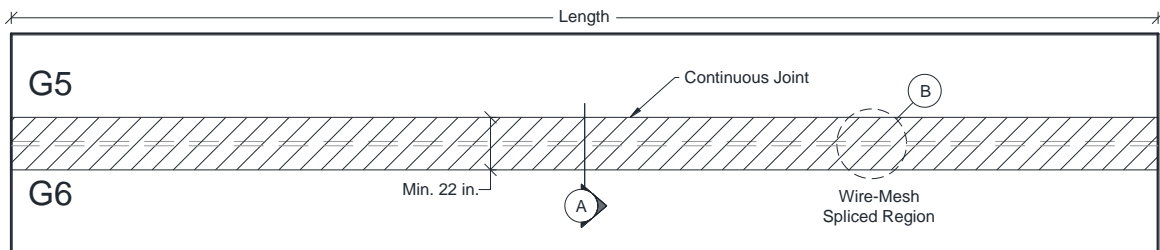


c. Dimensions for Rehabilitated Longitudinal Joint Detailing


Figure 9-3. Geometry Requirements for Proposed Continuous Joint Rehabilitation Method

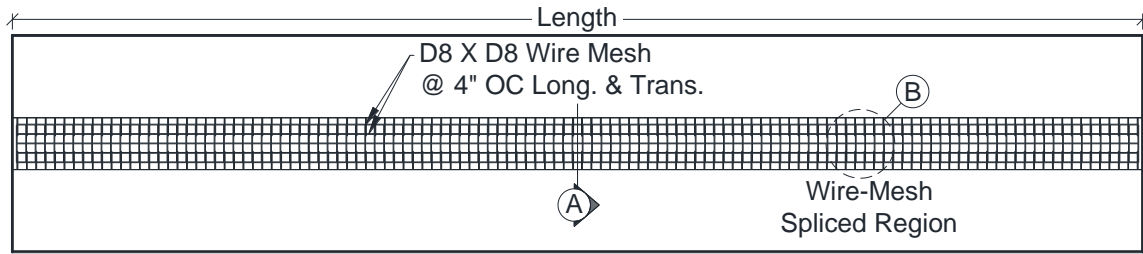

a. Continuous Joint Reinforcement – Plan View

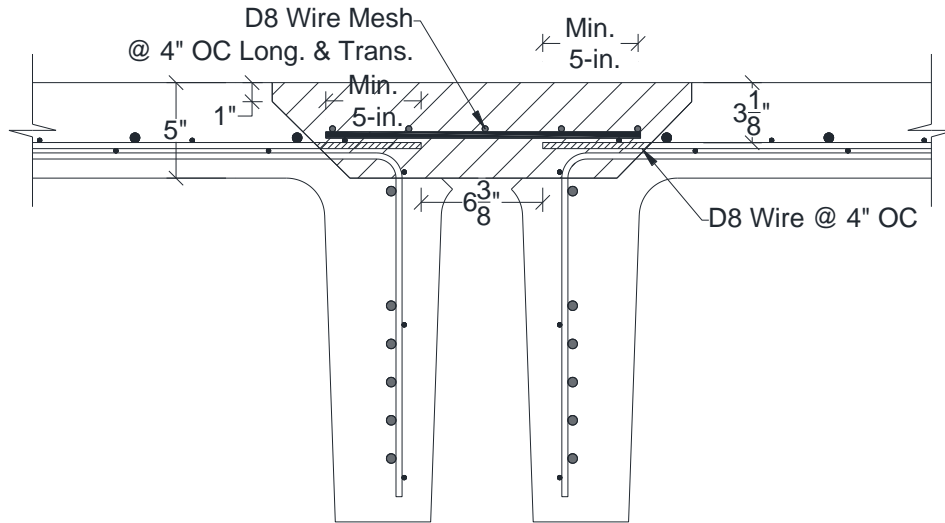

b. Section A – Continuous Joint Detail

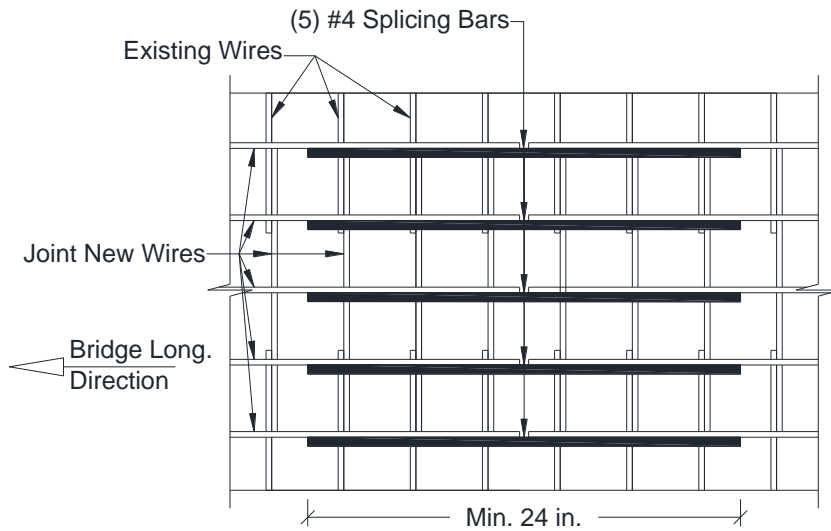

c. Section B – Wire Mesh Splice Detailing

Figure 9-4. Detailing for Proposed Continuous Joint Rehabilitation Method

10 CONCLUSIONS

The girder-to-girder joints of double-tee bridges, the most common type of bridge on South Dakota local roads, are deteriorating due to improper detailing. Experimental and analytical programs were executed in the present study to investigate the feasibility and performance of two rehabilitation methods for the longitudinal joints in double-tee bridges. Based on this study, the following conclusions can be drawn.

- Of 20 rehabilitation alternatives, those with continuous detailing are more durable.
- Thirteen large-scale beam tests showed that at least a 3-in. lap-splice is needed for joints with UHPC, and a 5-in. lap-splice is need for joints with LMC. The minimum splice length ensures bar fracture.
- Finite element analyses showed that the use of pocket detailing is feasible for the rehabilitation of double-tee bridge girder-to-girder joints. The joint geometry was optimized through the analytical study.
- The full-scale bridge test confirmed that the non-shrink grout used in conventional longitudinal joint detailing cracks under the AASHTO Service I limit state loading; therefore, current double-tee joint detailing is inadequate.
- Hammer-chipping was found to be a viable demolition method.
- Findings from the literature indicate that UHPC and LMC are durable materials. Therefore, these materials were included in the present experimental study. However, transverse shrinkage cracks and water leaks were observed in LMC at the continuous joint of the full-scale bridge before testing. The LMC shrinkage cracks were mainly due to a restrained boundary condition. The shrinkage cracks had no effect on the structural performance of the bridge, but it might cause durability issues if this material were incorporated in field. More durable filler materials such as UHPC may be used for continuous detailing. No shrinkage cracks were observed for UHPC.
- Both rehabilitation longitudinal joint detailing methods, pocket and continuous, did not deteriorate through 500,000 cycles of AASHTO Fatigue II loading and 100,000 cycles of AASHTO Fatigue I loading. The rehabilitated bridge test specimen was subjected to a total of 110 years of service loads. The stiffness of the bridge remained constant throughout the fatigue testing.
- The first flexural crack was observed in the stem of the loaded girder of the rehabilitated bridge at 53.8 kips, which was higher than the Service I limit state of 51 kips.
- The rehabilitated bridge load carrying capacity of 113.9 kips was higher than the AASHTO Strength I limit state of 89 kips, indicating sufficient performance for the rehabilitated joints. The strength capacity of the rehabilitated specimen was 1.5 times higher than a conventional reference double-tee bridge test specimen.
- The force-displacement relationship of both girders of the rehabilitated bridge was essentially the same throughout strength testing, indicating monolithic behavior.

- No structural damage or yielding of the reinforcement was observed in both joint rehabilitation details during strength testing.
- The failure mode of the rehabilitated bridge was the crushing of concrete in the deck of both girders at 9.55 in. of displacement in a ductile manner. No damage to rehabilitated joints was observed at the girder failure.
- In comparing the two methods, the rehabilitation cost of the pocket versus continuous joint detailing for a 40-ft long, 30.6 ft wide double-tee bridge is 26% and 53%, respectively, of the superstructure replacement cost of the same bridge.

Overall, both proposed rehabilitation methods are structurally viable. The UHPC pocket alternative is the cheapest and the most durable solution to extending the service life of double-tee bridge longitudinal joints for another 75 years.

11 RECOMMENDATIONS

Based on the findings of this study, the research team offers the following recommendations.

11.1 Recommendation 1: General

Longitudinal joints of prestressed double-tee girder bridges with a girder depth of 23 in. may be rehabilitated using the preparation and construction detailing specified in the following sections.

Experimental and analytical studies were performed only on 23-in. deep double-tee girder bridges because they are more common than 30-in. deep double-tee girder bridges in South Dakota.

11.2 Recommendation 2: Rehabilitation Methods

Both “pocket” and “continuous” detailing should be allowed for the rehabilitation of longitudinal joints of double-tee girder bridges.

Two methods for the rehabilitation of double-tee bridge longitudinal joints can be used in field: (1) “pocket” detailing in which discrete pockets reinforced with steel bars are formed and then are connected together through a longitudinally reinforced shear key, and (b) “continuous” detailing in which a continuous longitudinal joint is reinforced with wire mesh. The use of the pocket detailing method is more economical than the continuous detailing method. The pocket rehabilitation detailing cost is expected to be approximately 30% of double-tee bridge superstructure replacement cost.

11.3 Recommendation 3: Joint Preparation for Rehabilitation

The guidelines as detailed in Sec. 9.1 should be adopted for the preparation of longitudinal joints of double-tee girder bridges to be rehabilitated using either “pocket” or “continuous” detailing.

The joint preparation method described in Sec. 9.1 of the present report was exercised during the rehabilitation of a full-scale 40-ft long double-tee bridge test specimen. A contractor was hired to rehabilitate the bridge longitudinal joint. The proposed method of joint preparation was found simple and practical. The preparation for the pocket joints was faster and less involved compared to the continuous joint preparation.

11.4 Recommendation 4: Pocket Rehabilitation Method

The guidelines as detailed in Sec. 9.2.1 should be adopted for the rehabilitation of longitudinal joints of double-tee girder bridges using “pocket” detailing. Only Ultra-High Performance Concrete (UHPC) should be used as the joint filler material.

The rehabilitation of longitudinal joints of double-tee girder bridges incorporating “pocket” detailing should be performed in accordance to the requirements proposed in Sec. 9.2.1. The full-scale testing of a 40-ft long double-tee bridge in which its longitudinal joint was rehabilitated using UHPC filled pocket detailing showed that this rehabilitation method is viable and can meet all current AASHTO LRFD (2013) requirements. Other cementitious materials such as non-shrink grout, fiber reinforced grout, or Latex Modified Concrete (LMC) should not be used as the joint filler material due to durability issues.

11.5 Recommendation 5: Continuous Rehabilitation Method

The guidelines as detailed in Sec. 9.2.2 should be adopted for the rehabilitation of longitudinal joints of double-tee girder bridges using “continuous” detailing. Only Ultra-High Performance Concrete (UHPC) should be used as the joint filler material.

The rehabilitation of longitudinal joints of double-tee girder bridges incorporating “continuous” detailing should be performed in accordance to the requirements proposed in Sec. 9.2.2. The full-scale testing of a 40-ft long double-tee bridge in which its longitudinal joint was rehabilitated using LMC filled continuous detailing showed that this rehabilitation method is structurally viable meeting all current AASHTO LRFD (2013) requirements but LMC exhibited deep shrinkage cracks with water seepage. Except UHPC, any other cementitious materials such as non-shrink grout, fiber reinforced grout, or LMC should not be used as the joint filler material due to durability issues.

12 RESEARCH BENEFITS

More than 700 double-tee bridges are currently in service on SD local roads. One of the main concerns pertaining to current double-tee bridges is improper detailing of their longitudinal joints, causing fast deterioration of double-tee girders. The only option to fix this problem at the time of this writing is to replace the damaged girders, even though the majority of SD double-tee girders are only 20 to 45 years old.

The cost-effective rehabilitation methods proposed in the present study for the longitudinal joint of double-tee bridges can save millions of dollars for SD local governments and bridge owners, since the rehabilitation cost is only 30% of a bridge superstructure replacement. The lifetime of the bridge girder-to-girder joints can be extended for another 75 years by incorporating the proposed rehabilitation methods.

13 REFERENCES

- American Association of State Highway and Transportation Officials (AASHTO) (2013). "AASHTO LRFD Bridge Design Specifications." Washington, DC.
- ASTM A416 / A416M-16 (2016). "Standard Specification for Low-Relaxation, Seven-Wire Steel Strand for Prestressed Concrete." ASTM International, West Conshohocken, PA.
- ASTM A497 / A497M-07 (2007). "Standard Specification for Steel Welded Wire Reinforcement, Deformed, for Concrete." ASTM International, West Conshohocken, PA.
- ASTM A615 / A615M-16 (2016). "Standard Specification for Deformed and Plain Carbon-Steel Bars for Concrete Reinforcement." ASTM International, West Conshohocken, PA.
- ASTM A706 / A706M-16 (2016). "Standard Specification for Deformed and Plain Low-Alloy Steel Bars for Concrete Reinforcement." ASTM International, West Conshohocken, PA.
- ASTM C39 / C39M-16 (2016). "Standard Test Method for Compressive Strength of Cylindrical Concrete Specimens." ASTM International, West Conshohocken, PA.
- ASTM C109 / C109M-16a (2016). "Standard Test Method for Compressive Strength of Hydraulic Cement Mortars (Using 2-in. or [50-mm] Cube Specimens)." ASTM International, West Conshohocken, PA.
- ASTM C143 / C143M-15a (2015). "Standard Test Method for Slump of Hydraulic-Cement Concrete." ASTM International, West Conshohocken, PA.
- ASTM C231 / C231M-16 (2016) "Standard Test Method for Air Content of Freshly Mixed Concrete by the Pressure Method." ASTM International, West Conshohocken, PA.
- ASTM E8 / E8M-16a (2016). "Standard Test Methods for Tension Testing of Metallic Materials." ASTM International, West Conshohocken, PA.
- Baer, C. (2013). "Investigation of Longitudinal Joints Between Precast Prestressed Deck Bulb Tee Girders Using Latex Modified Concrete." University of South Carolina - Columbia, Department of Civil Engineering, Columbia, SC.
- Barde, A., Parameswaran, S., Chariton, T., Weiss, J., Cohen, M., and Newbolds, S. (2006). "Evaluation of Rapid Setting Cement-Based Materials for Patching and Repair." Report No. FHWA/IN/JTRP/2006-11, Purdue University, School of Civil Engineering, West Lafayette, IN.
- BASF Corporation (2011). "Placement of Latex Modified Concrete." Charlotte, NC.
- Beckemeyer, C. and McPeak, T. (1995). "Rural Road Design, Maintenance, and Rehabilitation Guide." Report No. SD95-16-G2, South Dakota Department of Transportation, Office of Research, Pierre, SD.
- Bohn, L. (2017), "Rehabilitation of Longitudinal Joints in Double-Tee Girder Bridge," MS Thesis, South Dakota State University, 232 pp., available at: <https://openprairie.sdstate.edu/etd/1216/>.

- Champa, J., Gulyas, R., and Wirthlin, G. (1995). "Evaluation of Keyway Grout Test Methods for Precast Concrete Bridges." PCI Journal, Cleveland, OH.
- Dayton Superior Corporation (2015). "Technical Data Sheet: HD-50." Miamisburg, OH.
- Five Star Products, Inc (2015). "Technical Data Sheet: Highway Patch FR." Fairfield, CT.
- French, C., Shield, C., Klaseus, D., Smith, M., Ericksson, W., and Ma, Z. (2011). "Cast-in-Place Concrete Connection for Precast Deck Systems." National Cooperative Highway Research Program (NCHRP), Project No. 173, DOI: 10.17226/14556.
- Graybeal, B. (2010). "Behavior of Field-Cast Ultra-High Performance Concrete Bridge Deck Connections Under Cyclic and Static Structural Loading." FHWA Publication No. FHWA-HRT-11-023, Office of Infrastructure Research & Development, Federal Highway Administration, Mclean, VA.
- Graybeal, B. (2014). "Design and Construction of Field-Cast UHPC Connections." FHWA Publication No. FHWA-HRT-14-084, Office of Infrastructure Research & Development, Federal Highway Administration, Mclean, VA.
- Haber, Z. and Graybeal, B. (2014). "Experimental Evaluation of Prefabricated Deck Panel Connections." Office of Infrastructure Research & Development, Federal Highway Administration, Mclean, VA.
- Headed Reinforcement Corporation (2014). "HRC 555 Headed Reinforcing Bars." International Code Council – Evaluation Service Report No. ESR-2935, Fountain Valley, CA.
- Jones, H. (2001). "Lateral Connections for Double Tee Bridges." Report No. FHWA/TX-01/1856-2, Texas Transportation Institute, Texas A&M University, Austin, TX.
- Jones, J., Ryan, K., and Saiidi, M. (2016). "Toward Successful Implementation of Prefabricated Deck Panels to Accelerate the Bridge Construction Process," Center For Civil Engineering Earthquake Research, Report No. CCEER-16-05, Department Of Civil and Environmental Engineering, University of Nevada, Reno, NV
- Konrad, M. (2014). "Precast Bridge Girder for Improved Performance." M.S. Thesis, South Dakota State University, Department of Civil and Environmental Engineering, Brookings, SD.
- Marsh, M., Wernli, M., Garrett, B., Stanton, J., Eberhard, M., and Weinert, M. (2011). "Application of Accelerated Bridge Construction Connection in Moderate-to-High Seismic Regions." NCHRP Report No. 698, Bergerabam; University of Washington, Seattle, WA.
- Mingo, M. (2016). "Precast Full-Depth Panels on Inverted Bulb-tee Bridge Girders." M.S. Thesis, South Dakota State University, Department of Civil Engineering, Brookings, SD.
- Pierce, L., Uhlmeyer, J., Weston, J., Lovejoy, J., and Mahoney, J. (2002). "Ten-Year Performance of Dowel Bar Retrofit - Application, Performance, and Lessons Learned." Washington State Department of Transportation, Olympia, WA.

- SAP2000. (2016). Computers and Structures, Inc., Version 18, Berkeley, CA.
- South Dakota Department of Transportation (SDDOT) (2004). "Standard Specifications for Roads and Bridges." SDDOT, Pierre, SD.
- Swenty, M., and Graybeal, B. (2013). "Material Characterization of Field-Cast Connection Grouts." Report No. FHWA-HRT-13-041, Office of Infrastructure Research & Development, Federal Highway Administration, Mclean, VA.
- Wehbe, N. and Konrad, M. (2016). "Precast Bridge Girder Detail for Improved Performance," Report No. SD2013-01-F, South Dakota Department of Transportation, Office of Research, Pierre, SD.
- Wehbe, N., Konrad, M., and Breyfogle, A. (2016). "Joint Detailing Between Double Tee Bridge Girders for Improved Serviceability and Strength." Transportation Journal of the Transportation Research Board, No. 2592, Transportation Research Board, Washington, D.C, pp. 108-106.
- Wenzlick, J. (2002). "Hydrodemolition and Repair of Bridge Decks." Report No. RDT02-002, Missouri Department of Transportation, Jefferson City, MO.
- Wenzlick, J. (2006). "Evaluation of Very High Strength Latex Modified Concrete Overlays." Report No. OR06-004, Missouri Department of Transportation, Jefferson City, MO.