



USE OF SIMULATED HIGHWAY UNDERPASS CROSSING STRUCTURES BY FLAT-TAILED HORNED LIZARDS (*PHRYNOSOMA MCALLII*)

Final Report 594

Prepared by:

Mikele L. Painter and Michael F. Ingraldi
Arizona Game and Fish Department
Research Branch
2221 West Greenway Road
Phoenix, Arizona 85023

May 2007

Prepared for:

Arizona Department of Transportation
206 South 17th Avenue
Phoenix, Arizona 85007
In cooperation with
U.S. Department of Transportation
Federal Highway Administration

DISCLAIMER

The contents of this report reflect the views of the authors who are responsible for the facts and the accuracy of the data presented herein. The contents do not necessarily reflect the official views or policies of the Arizona Department of Transportation or the Federal Highway Administration. This report does not constitute a standard, specification, or regulation. Trade or manufacturers' names which may appear herein are cited only because they are considered essential to the objectives of the report. The U.S. Government and the State of Arizona do not endorse products or manufacturers.

Technical Report Documentation Page

| | | | | | |
|---|---|-----------------------------|---|---|-----------------------|
| 1. Report No. FHWA-AZ-07-594 | | 2. Government Accession No. | | 3. Recipient's Catalog No. | |
| 4. Title and Subtitle USE OF SIMULATED HIGHWAY UNDERPASS CROSSING STRUCTURES BY FLAT-TAILED HORNED LIZARDS (<i>PHRYNOSOMA MCALLII</i>) | | | | 5. Report Date May 2007 | |
| | | | | 6. Performing Organization Code | |
| 7. Author Mikele L. Painter and Michael F. Ingraldi | | | | 8. Performing Organization Report No. | |
| 9. Performing Organization Name and Address Arizona Game and Fish Department Research Branch 2221 W. Greenway Road Phoenix, Arizona 85023 | | | | 10. Work Unit No. | |
| | | | | 11. Contract or Grant No. JPA 05-017T / KR05-0494TRN | |
| 12. Sponsoring Agency Name and Address Arizona Department of Transportation 206 S. 17th Avenue Phoenix, Arizona 85007 ADOT Project Manager: Estomih (Tom) Kombe | | | | 13. Type of Report & Period Covered FINAL REPORT, June 2005 – February 2007 | |
| | | | | 14. Sponsoring Agency Code | |
| 15. Supplementary Notes Prepared in cooperation with the U.S. Department of Transportation, Federal Highway Administration | | | | | |
| 16. Abstract The flat-tailed horned lizard (<i>Phrynosoma mcallii</i>) occupies a restricted range in the Lower Sonoran Desert of southwest Arizona, southeast California, and adjacent land in Mexico. Because they exhibit behavior patterns that include basking and remaining motionless when danger approaches, flat-tailed horned lizards are particularly susceptible to mortality on roads. Therefore, roads and new road construction are recognized as threats influencing the long-term persistence of this species. The propensity for flat-tailed horned lizards to use culverts as road crossing structures to avoid vehicle-caused mortality is unknown. From 2005-2006 we studied flat-tailed horned lizard use of a variety of simulated road crossing structures. The study objectives were to 1) determine if flat-tailed horned lizards will pass through culverts of sizes commonly used in road construction, and 2) compare and describe the characteristics of culverts used by flat-tailed horned lizards to those not used. We built a testing facility with six culverts of three dimensions and two interior lighting options. All culverts were 40 feet long; the three types included 24-inch diameter steel culverts, 36-inch diameter steel culverts, and 4-foot tall by 8-foot wide box culverts. One of each type of culvert was lit with skylights, and one of each type of culvert had only natural light from the ends. Light and temperature conditions in the culverts were evaluated during the study. Out of 54 flat-tailed horned lizards placed in the testing facility, we observed 12 complete crossings. The 36-inch diameter culvert without skylights was used five times. The 24-inch diameter culvert with skylights was not used, and other culvert designs were each used once or twice. Results indicated that flat-tailed horned lizards can use culverts as road crossing structures, but the evidence did not reveal a strong selection for or against any culvert type. Recommendations for employing appropriate road crossing structures are discussed. | | | | | |
| 17. Key Words Arizona, culvert, highway crossing structure, herpetofauna, horned lizard, wildlife mitigation, roadway crossing | | | 18. Distribution Statement Document is available to the U.S. Public through the National Technical Information Service, Springfield, Virginia, 22161 | | 23. Registrant's Seal |
| 19. Security Classification Unclassified | 20. Security Classification Unclassified | 21. No. of Pages 38 | 22. Price | | |

SI* (MODERN METRIC) CONVERSION FACTORS

| APPROXIMATE CONVERSIONS TO SI UNITS | | | | | APPROXIMATE CONVERSIONS FROM SI UNITS | | | | |
|---|-------------------------------|----------------------------|--------------------------------|-------------------|--|--------------------------------|-------------|-------------------------------|---------------------|
| Symbol | When You Know | Multiply By | To Find | Symbol | Symbol | When You Know | Multiply By | To Find | Symbol |
| <u>LENGTH</u> | | | | | <u>LENGTH</u> | | | | |
| in | inches | 25.4 | millimeters | mm | mm | millimeters | 0.039 | inches | in |
| ft | feet | 0.305 | meters | m | m | meters | 3.28 | feet | ft |
| yd | yards | 0.914 | meters | m | m | meters | 1.09 | yards | yd |
| mi | miles | 1.61 | kilometers | km | km | kilometers | 0.621 | miles | mi |
| <u>AREA</u> | | | | | <u>AREA</u> | | | | |
| in ² | square inches | 645.2 | square millimeters | mm ² | mm ² | Square millimeters | 0.0016 | square inches | in ² |
| ft ² | square feet | 0.093 | square meters | m ² | m ² | Square meters | 10.764 | square feet | ft ² |
| yd ² | square yards | 0.836 | square meters | m ² | m ² | Square meters | 1.195 | square yards | yd ² |
| ac | acres | 0.405 | hectares | ha | ha | hectares | 2.47 | acres | ac |
| mi ² | square miles | 2.59 | square kilometers | km ² | km ² | Square kilometers | 0.386 | square miles | mi ² |
| <u>VOLUME</u> | | | | | <u>VOLUME</u> | | | | |
| fl oz | fluid ounces | 29.57 | milliliters | mL | mL | milliliters | 0.034 | fluid ounces | fl oz |
| gal | gallons | 3.785 | liters | L | L | liters | 0.264 | gallons | gal |
| ft ³ | cubic feet | 0.028 | cubic meters | m ³ | m ³ | Cubic meters | 35.315 | cubic feet | ft ³ |
| yd ³ | cubic yards | 0.765 | cubic meters | m ³ | m ³ | Cubic meters | 1.308 | cubic yards | yd ³ |
| NOTE: Volumes greater than 1000L shall be shown in m ³ . | | | | | | | | | |
| <u>MASS</u> | | | | | <u>MASS</u> | | | | |
| oz | ounces | 28.35 | grams | g | g | grams | 0.035 | ounces | oz |
| lb | pounds | 0.454 | kilograms | kg | kg | kilograms | 2.205 | pounds | lb |
| T | short tons (2000lb) | 0.907 | megagrams (or "metric ton") | mg (or "t") | mg | megagrams (or "metric ton") | 1.102 | short tons (2000lb) | T |
| <u>TEMPERATURE (exact)</u> | | | | | <u>TEMPERATURE (exact)</u> | | | | |
| °F | Fahrenheit temperature | 5(F-32)/9 or (F-32)/1.8 | Celsius temperature | °C | °C | Celsius temperature | 1.8C + 32 | Fahrenheit temperature | °F |
| <u>ILLUMINATION</u> | | | | | <u>ILLUMINATION</u> | | | | |
| fc | foot candles | 10.76 | lux | lx | lx | lux | 0.0929 | foot-candles | fc |
| fl | foot-Lamberts | 3.426 | candela/m ² | cd/m ² | cd/m ² | candela/m ² | 0.2919 | foot-Lamberts | fl |
| <u>FORCE AND PRESSURE OR STRESS</u> | | | | | <u>FORCE AND PRESSURE OR STRESS</u> | | | | |
| lbf | poundforce | 4.45 | newtons | N | N | newtons | 0.225 | poundforce | lbf |
| lbf/in ² | poundforce per square inch | 6.89 | kilopascals | kPa | kPa | kilopascals | 0.145 | poundforce per square inch | lbf/in ² |

SI is the symbol for the International System of Units. Appropriate rounding should be made to comply with Section 4 of ASTM E380

TABLE OF CONTENTS

| | |
|---|----|
| I. EXECUTIVE SUMMARY | 1 |
| II. INTRODUCTION..... | 3 |
| III. METHODS | 5 |
| A. STUDY SITE..... | 5 |
| B. FACILITY CONSTRUCTION..... | 6 |
| C. MONITORING FLAT-TAILED HORNED LIZARD USE OF EXPERIMENTAL CULVERTS..... | 9 |
| D. MEASURING TEMPERATURE AND LIGHT INTENSITY | 11 |
| E. ANALYSIS | 12 |
| IV. RESULTS | 15 |
| A. FLAT-TAILED HORNED LIZARD USE OF EXPERIMENTAL CULVERTS | 15 |
| B. TEMPERATURE AND LIGHT INTENSITY | 18 |
| V. CONCLUSIONS..... | 21 |
| VI. RECOMMENDATIONS..... | 23 |
| VII. BIBLIOGRAPHY | 25 |
| APPENDIX A. RECORDS AND INTERPRETATIONS OF FLAT-TAILED HORNED LIZARD REMOTE TELEMETRY DATA | 27 |
| APPENDIX B. SURVIVAL DATA AND FATE OF FLAT-TAILED HORNED LIZARDS..... | 31 |

LIST OF FIGURES

| | |
|---|----|
| Figure 1. Figure 1. Flat-tailed horned lizard study site from 2005-2006..... | 5 |
| Figure 2. Layout of the testing facility (not to scale)..... | 7 |
| Figure 3. Soil from the site distributed through the 36-in diameter culvert without skylights..... | 8 |
| Figure 4. Entrance of the 4-ft by 8-ft box culvert with a skylight (upper right) and headwalls (dark brown) | 8 |
| Figure 5. Skylights positioned on a 24-in diameter culvert..... | 8 |
| Figure 6. Flat-tailed horned lizard with a radio telemetry transmitter attached..... | 9 |
| Figure 7. Flat-tailed horned lizard exhibiting typical hiding behavior while carrying a radio telemetry transmitter. | 10 |

LIST OF TABLES

| | |
|--|----|
| Table 1. Description of real road culverts selected for temperature comparison to simulated road crossing structures | 12 |
| Table 2. Information on each flat-tailed horned lizard used in the simulated road crossing structure experiment (2005-2006)..... | 16 |
| Table 3. Summary of flat-tailed horned lizard use of simulated road crossing structures (2005-2006). | 17 |
| Table 4. Light intensity and temperature discrepancies at the testing facility (Jun-Sep) | 18 |
| Table 5. Games-Howell test results (P-values) of multiple comparisons among temperature discrepancies recorded at simulated culverts | 18 |

ACKNOWLEDGEMENTS

The Arizona Department of Transportation (ADOT) and the Federal Highway Administration (FHWA) provided funding for this project. The research team thanks the following Arizona Game and Fish Department (AGFD) Research Branch personnel for their time and effort during this project: Dennis Abbate, Mylea Bayless, Scott Blackman, Caley Boone, R.J. Genoa, David Grandmaison, Zach Hurst, Sarah Karasz, Shawn Lowery, Ron Mixan, Eddie Moreno, Sarah Newell, Steve Partridge, Beatriz Vizcarra, and Renee Wilcox. Ron Pearce provided administrative support from the Marine Corps Air Station Range Management Department. Bryan Morrill (MCASRMD) and Lin Piest (AGFD, Yuma) helped enormously with each stage of the project, including development, construction, and implementation. The research team also thanks Steve Thomas (FHWA) for finding the funds for this important project, and Dr. Tom Kombe (ADOT) for his administrative contributions. Ray Schweinsburg (AGFD) administered our grant and provided valuable editorial input.

The Arizona Game and Fish Department prohibits discrimination on the basis of race, color, sex, national origin, age and disability in its programs and activities. If anyone believes they have been discriminated against in any of AGFD's programs or activities, including its employment practices, the individual may file a complaint alleging discrimination directly with AGFD Deputy Director, 2221 W. Greenway Rd., Phoenix, AZ 85023, (602) 789-3290 or US Fish and Wildlife Service, 4040 N. Fairfax Dr., Ste. 130, Arlington, VA 22203.

Persons with a disability may request a reasonable accommodation, such as a sign language interpreter, or this document in an alternative format, by contacting the AGFD Deputy Director, 2221 W. Greenway Rd., Phoenix, AZ 85023, (602) 789-3290 or by calling TTY at 1-800-367-8939. Requests should be made as early as possible to allow sufficient time to arrange for accommodation.

I. EXECUTIVE SUMMARY

The flat-tailed horned lizard (*Phrynosoma mcallii*) occupies a restricted range in the Lower Sonoran Desert of southwest Arizona, southeast California, and adjacent land in Mexico. Because they exhibit behavior patterns that include basking and remaining motionless when danger approaches, flat-tailed horned lizards are particularly susceptible to mortality on roads. More importantly, highways fragment areas of habitat and isolate segments of lizard populations. Depending on the size of the isolated habitat patches, these populations may be non-viable without connections to the larger population. Therefore, roads and new road construction are recognized as threats influencing the long-term persistence of this species.

The propensity for flat-tailed horned lizards to use culverts as road crossing structures to avoid vehicle-caused mortality is unknown. From 2005-2006, Arizona Game and Fish Department researchers studied flat-tailed horned lizard use of a variety of simulated road crossing structures. The study objectives were to 1) determine if flat-tailed horned lizards will pass through culverts of sizes commonly used in road construction, and 2) compare and describe the characteristics of culverts used by flat-tailed horned lizards to those not used. The research team built a testing facility south of Yuma, Arizona, with six culverts of three dimensions and two interior lighting options. All culverts were 40 feet long; the three types included 24-inch diameter steel culverts, 36-inch diameter steel culverts, and 4-foot tall by 8-foot wide box culverts. One of each type of culvert was lit with skylights, and one of each type of culvert had only natural light from the ends. Light and temperature conditions in the culverts were evaluated during the study. Out of 54 flat-tailed horned lizards placed in the testing facility, 12 complete crossings were observed. The 36-inch diameter culvert without skylights was used five times. The 24-inch diameter culvert with skylights was not used, and other culvert designs were each used once or twice. Results indicated that flat-tailed horned lizards can use culverts as road crossing structures, but the evidence did not reveal a strong selection for or against any culvert type.

Because the 24-inch diameter culverts were used less frequently than the larger culverts and they seemed more susceptible to movement of soil, the research team tentatively recommends against using these culverts as standard road crossing structures for flat-tailed horned lizards. While the 36-inch diameter and the 4-foot by 8-foot box culverts were not immune to movement of sandy soil, they were not as vulnerable as the smaller culverts. Although the 36-inch diameter culvert may be the best option, either of the larger styles could work as a crossing structure, as long as fencing is used to funnel animals toward the culvert, it remains passable, preferably holds some soil on the floor, and allows some daylight through its length.

Other issues to consider in designing appropriate road crossing structures include: regular maintenance (i.e., maintaining substrate in culverts and ready access to culvert entrances), how many to install, where to install them, position under the road, and topography of the crossing site. Although this study showed that in an experimental situation flat-tailed horned lizards are capable of moving through culverts, they may exhibit different reactions to culverts under normal circumstances in their own territories or during typical dispersal. To further test road crossing structures as a viable mitigation measure for flat-tailed horned lizards, use of actual culverts under roads (with exclusion fencing) should be documented for this species in situ.

II. INTRODUCTION

The flat-tailed horned lizard (*Phrynosoma mcallii*) is a small cryptic lizard restricted to the western Sonoran Desert in southeast California, southwest Arizona, and adjacent land in Mexico. It is commonly found below 820 feet in areas with flat to modest (< 3%) slopes. The flat-tailed horned lizard was proposed for threatened species listing by the U.S. Fish and Wildlife Service (Service) in 1993. The proposal was subsequently withdrawn in 1997 when it was determined that population trend estimates were ambiguous, and threats (i.e., habitat loss/degradation) to the species did not warrant listing. In 1997, flat-tailed horned lizards gained protective status on public lands under a conservation agreement signed by several state and federal agencies. This conservation agreement implements the *Flat-tailed Horned Lizard Rangewide Management Strategy* (Flat-tailed Horned Lizard Interagency Coordinating Committee 2003). On 7 December 2005 the Service announced reinstatement of the 1993 proposed rule, but again withdrew it on 28 June 2006 (71 FR 36745).

In response to increasing transportation demands in southwestern Arizona, the Arizona Department of Transportation (ADOT) is developing plans to build new highways and improve existing highways within flat-tailed horned lizard habitat. The Rangewide Management Strategy recognizes roads and new road construction as threats influencing the long-term persistence of this species. Since flat-tailed horned lizards exhibit behaviors that include basking and remaining motionless when danger approaches, they are particularly susceptible to mortality on roads (Flat-tailed Horned Lizard Interagency Coordinating Committee 2003). More importantly, highways fragment areas of habitat and isolate segments of wildlife populations. Depending on the size of the isolated habitat patches, these populations may be non-viable without connections to the larger population (Trombulak and Frissell 2000). The Rangewide Management Strategy stipulates the installation of effective culverts to mitigate road effects and maintain connectivity between flat-tailed horned lizard populations bisected by paved roads proposed or authorized by signatories to the conservation agreement. It also states that the Flat-tailed Horned Lizard Interagency Coordinating Committee shall provide a culvert design. To date, there has been little information to guide this effort.

Highway crossing structures can mitigate some roadway effects on wildlife, but only if the target species use them (Ng et al. 2004). Road permeability can be improved for lizards and other wildlife by installing culverts as crossing structures (Yanes et al. 1995, Ascensão and Mira 2007). Culverts accompanied by proper exclusion fencing further improve connectivity between road-fragmented habitat patches and decrease roadway mortality (Dodd et al. 2004, Aresco 2005). Some animals exhibit aversion to certain types of crossing structures and may not use a culvert if it is not suitably designed (Rodriguez et al. 1996, Ng et al. 2004). Use may be influenced by the culvert's internal temperature, lighting, or overall width (Ruediger 2001).

The propensity for flat-tailed horned lizards to use culverts as road crossing structures is unknown. To determine if culverts can mitigate road effects on flat-tailed horned lizards, it is imperative to determine crossing structure parameters that are suitable for the species. The purpose of this study was to test flat-tailed horned lizard use of several different simulated road-crossing structures, and assist decisions regarding mitigation of highway construction and maintenance within flat-tailed horned lizard habitats.

This project was designed to test flat-tailed horned lizard use of commonly employed road crossing structures and provide information that can be applied to road design and maintenance questions. The project addressed the following objectives:

- Determine if flat-tailed horned lizards will pass through culverts of sizes commonly used in road construction.
- Compare and describe the characteristics of culverts used by flat-tailed horned lizards to those not used.

III. METHODS

A. STUDY SITE

The study site was located approximately 10 miles south of Yuma, Arizona on the Barry M. Goldwater Range (Figure 1). The biotic community is classified as the Lower Colorado River Valley subdivision of the Sonoran Desert. Dominant vegetation includes creosote bush (*Larrea tridentata*), white bursage (*Ambrosia dumosa*), and big galleta (*Pleuraphis rigida*). Topography is gently rolling with broad dunes of sandy loam, and elevation ranges from 100-400 feet above sea level (Brown 1994). Mean summer (June-September) temperature and rainfall are 90 degrees Fahrenheit and 3/10 inches, respectively (TWC 2007).

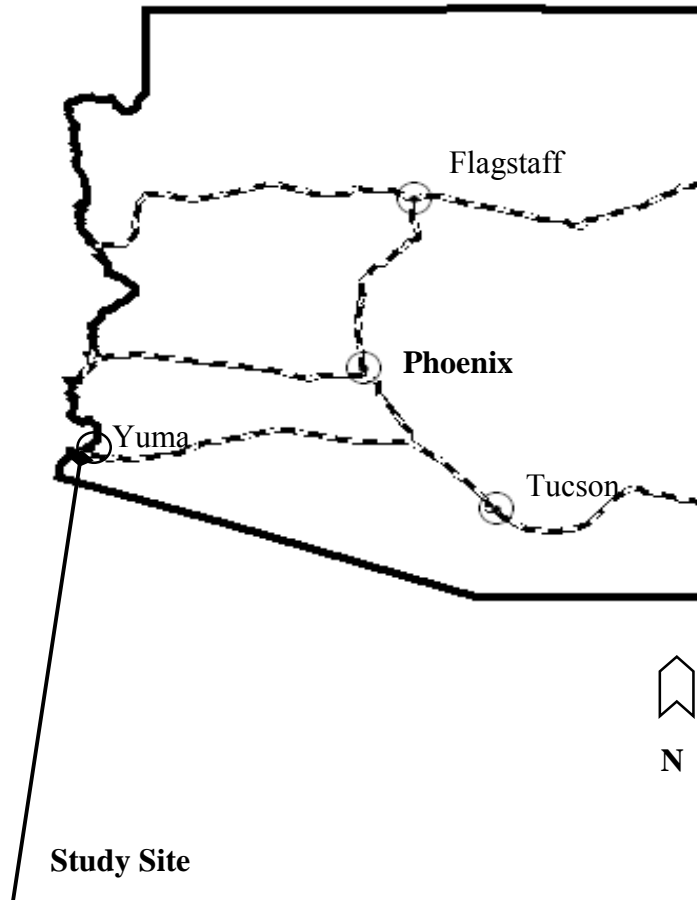


Figure 1. Flat-tailed horned lizard study site from 2005-2006

B. FACILITY CONSTRUCTION

In 2005 the research team built a facility to test potential use of highway culverts currently used by ADOT to control water flow and erosion. The testing facility (Figure 2) was designed as a hexagon (100 feet/side, 6/10 acre) constructed with ¼-inch mesh hardware cloth 36 inches tall, buried 6 inches and held up by ¼-inch rebar. Midway on each side of the hexagon, we installed a 40-foot long culvert connected to a 10-foot by 10-foot hardware cloth peripheral enclosure. Ground inside the fenced area was not disturbed to preserve natural characteristics of the vegetation and soil. The length of culverts used in this study was similar to that of culverts used under typical two-lane roads. Four-lane roads typically have an open median between the opposing traffic directions. To maintain even substrate conditions throughout the testing facility, sand was distributed inside each culvert to thoroughly cover the floor 1-3 inches deep (Figure 3). The R-value (insulation coefficient) of a road (asphalt and gravel fill) was estimated to be approximately 22, so each culvert was covered with approximately 18-24 inches of soil and/or rigid foam insulation (R-Tech expanded polystyrene; Insulfoam, Tacoma, Washington, USA) to simulate thermal properties of an actual culvert under a road.

The testing facility included three types of culverts and two interior lighting options. Culvert types included 24-inch diameter galvanized steel culverts, 36-inch diameter galvanized steel culverts, and 4-foot tall by 8-foot wide box culverts. The steel culverts were the same as those in use by ADOT. The box culverts were constructed of ¾-inch plywood and framed with 2-inch by 4-inch wood posts (Figure 4). Box culverts were designed to mimic those made of concrete in use by ADOT. Each culvert received one of two lighting options: light or dark. The “light” culverts were lit inside with skylights; the “dark” culverts received only natural light from the ends. For the skylight option, at least one 12-inch tubular skylight was installed midway into one of each type of culvert. Because the 24-inch and 36-inch culverts were much darker than the box culverts, they were fitted with two additional skylights. In 2005, sunlight was directed into the mouth of these crossing structures with 22-inch flexible tubular skylights suspended from the top half of the culvert openings. These terminal skylights reduced the entrance diameter of these culverts by one-third to one-half. Interior lighting conditions were improved in 2006 by removing the terminal skylights, and installing two 10-inch tubular skylights, 10 feet away on either side of the midway skylight (Figure 5).

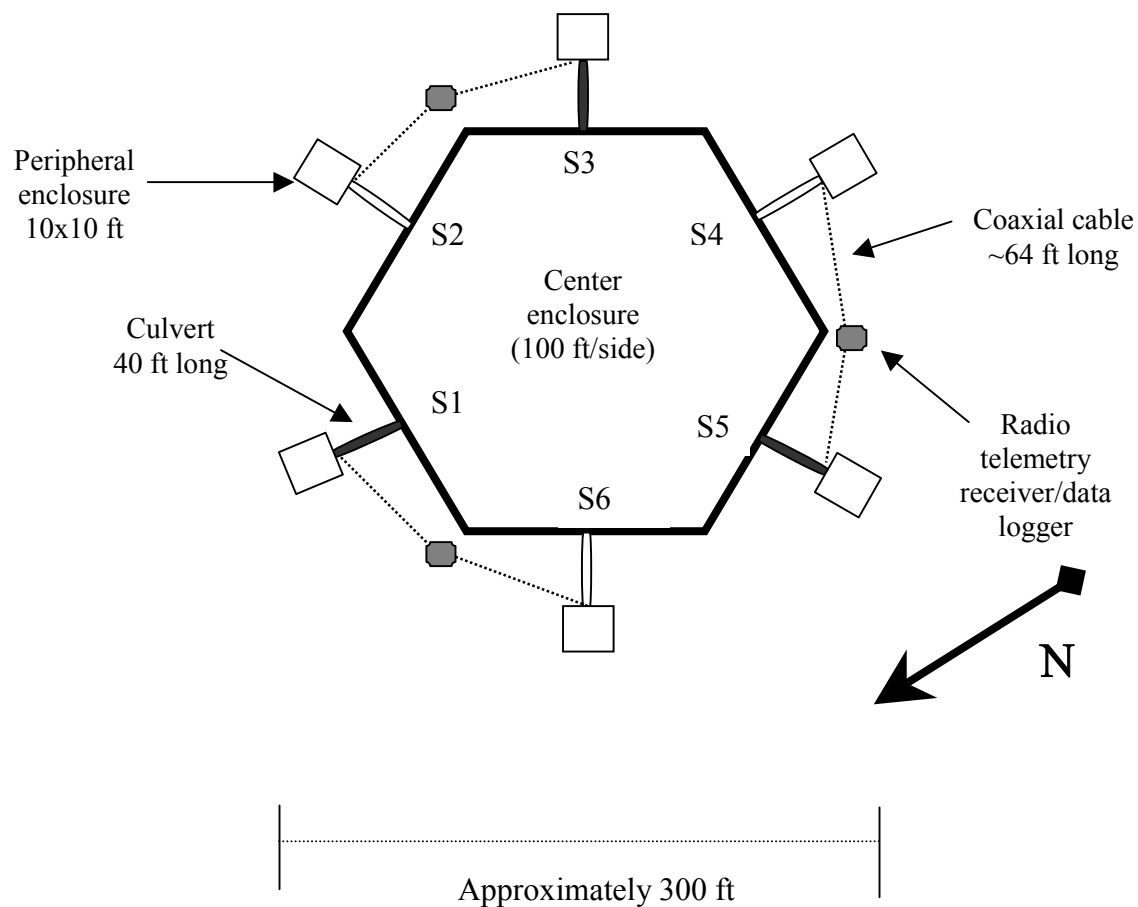


Figure 2. Layout of the testing facility (not to scale)

Notes: Total dimensions of the facility were approximately 300 feet by 300 feet. Each enclosure was constructed of 36-inch hardware cloth buried approximately 6 inches and held up by 1/4-inch rebar. The crossing structures (S1 –S6) were constructed as follows: S2 and S5 were 24-inch culvert piping; S3 and S6 were 36-inch culvert piping; and S1 and S4 were 4-foot tall by 8-foot wide simulated box culvert (constructed of 3/4-inch plywood). S2, S4, and S6 had skylights illuminating the crossing structures internally. All culverts had approximately 18-24 inches of soil or comparable insulation covering each structure. Three radio telemetry receiver-data loggers each operated two antennas of coaxial cable.



Figure 3. Soil from the site distributed through the 36-in diameter culvert without skylights.



Figure 4. Entrance of the 4-ft by 8-ft box culvert with a skylight (upper right) and headwalls (dark brown).



Figure 5. Skylights positioned on a 24-in diameter culvert.

Notes: In the background is the main enclosure. In the left foreground is the small peripheral pen that prevents flat-tailed horned lizards from escaping if they walk through the culvert. Plywood headwalls minimize sand loss at the ends.

C. MONITORING FLAT-TAILED HORNED LIZARD USE OF EXPERIMENTAL CULVERTS

From September through October 2005 and June to September 2006, flat-tailed horned lizards were captured from approved locations on the Barry M. Goldwater Range and adjoining Bureau of Reclamation land. The research team recorded capture coordinates (UTM, NAD 1927), sex, and length (2005, total length; 2006 snout-to-vent length) for each individual. Only lizards ≥ 1 year old were used in the study. Either a 0.36-gram or a 0.77-gram radio transmitter (models LB-2N or BD-2, respectively; Holohil Systems Ltd., Carp, Ontario, Canada) was affixed on the back of each individual with Dap brand silicon aquarium sealant. After covering the tags with sealant, they were dusted with sand for camouflage. Each individual also received a unique identification mark on the belly and tail with black permanent marker. To ensure attachment and tag performance, tags were activated and affixed the night before releasing the flat-tailed horned lizards into the testing facility (Figures 6 and 7).



Figure 6. Flat-tailed horned lizard with a radio telemetry transmitter attached.

Notes: The larger rod on the left side of the lizard's back is a radio frequency identification transponder that we tested unsuccessfully in 2005. The traditional radio telemetry transmitter (Holohil model LB-2N) is on the right side of the lizards back, with the thin wire projecting posteriorly. Most lizards only carried the telemetry transmitter.



Figure 7. Flat-tailed horned lizard exhibiting typical hiding behavior while carrying a radio telemetry transmitter.

Anywhere from six to eight flat-tailed horned lizards were in the testing facility at any one time. In 2005 the research team experimented with radio frequency identification (RFID) transponders, but the system failed to work at the study site (Painter and Ingraldi 2005). In 2006 only traditional radio telemetry equipment was used to monitor lizard movements.

All flat-tailed horned lizards were released in the morning, in the center of the main enclosure where all six culverts were equally available for selection. Because the testing facility contained several active ant nests, supplemental food was not provided. The research team monitored movement (i.e., use of each crossing structure) of each individual lizard for 10 days. After 10 days, or death of an individual in the testing facility, animals were replaced with new individuals. General location and status of each animal was determined with handheld receivers at least every third day. If an animal was lost, circumstances of the loss were noted. After 10 days in the testing facility, surviving individuals were taken out, their tags removed, and released at their point of capture. Animals originally found on a road were released approximately 100 yards from their capture point.

Because the RFID remote detection system failed to work during 2005, location and status of each animal was determined with handheld receivers once every day. If an animal was found in a terminal pen, the type of culvert was noted and that event counted as one crossing. In 2006, the research team used radio telemetry equipment with stationary scanning receiver-data loggers (model R4500S; Advanced Telemetry Systems, Inc., Isanti, Minnesota, USA) to remotely detect and record flat-tailed horned lizard movement through the culverts, in addition to checking lizard status approximately every

third day with handheld receivers. At the rim of the exit (i.e., distal end) of each crossing structure, a radio telemetry antenna was buried just under the sand to detect flat-tailed horned lizards as they passed out of the culvert. Each receiver monitored two culverts. When a receiver detected a signal, it logged the antenna, time, frequency, and signal strength. Data were downloaded to a laptop computer in the field.

D. MEASURING TEMPERATURE AND LIGHT INTENSITY

In 2005 one data logger (Hobo® pendant temp/light data logger; Onset Computer Corporation, Bourne, Massachusetts, USA) was placed on the floor about 15 feet inside the distal end of each crossing structure to measure light intensity and temperature inside the culverts every 15 minutes. In 2006 temperature and light intensity data collection was modified by placing a data logger on the floor midway inside each culvert to take readings inside the culverts every 60 minutes. In both years, one data logger was placed outside the culverts to record ambient environmental conditions. These data loggers were in place for the duration of the field season. To compare conditions between the simulated crossing structures and culverts actually installed under roadways by ADOT, temperatures outside and inside three real culverts similar to those in the testing facility were also sampled in 2006 (Table 1). Sampled culverts were located under highway US-95, approximately 23 miles north of the study site. Real culverts installed for water flow typically passed under the road at an angle, were installed as a pair, and/or were located down in a wash. For general comparison, the research team found such dissimilarities acceptable. Samples were collected over a 24-hour period at each of the three real culverts. Data loggers were checked to ensure they measured within 2 degrees Fahrenheit of each other.

Table 1. Description of real road culverts selected for temperature comparison to simulated road crossing structures.

| | | | |
|---------------------------------------|--|--|--|
| Culvert Width | 24-in diameter | 36-in diameter | 4-ft tall x 8-ft wide |
| Date placed | 9/12/2006 | 9/14/2006 | 9/16/2006 |
| Time placed | 14:00 | 16:40 | 11:50 |
| Date retrieved | 9/14/2006 | 9/16/2006 | 9/18/2006 |
| Time retrieved | 16:14 | 11:13 | 07:30 |
| Approximate length (ft) | 68 | 89 | 36 |
| Alignment | E-W | NW-SE | E-W |
| Mean temperature difference (°F ± SD) | -2.9 ± 7.1 | -2.6 ± 8.1 | -5.9 ± 8.2 |
| Comments | Logger placed on sand in metal culvert; mouth a bit elevated above the ground outside; not in a wash and hasn't seen water in a long time. | Two metal culverts in a shallow wash, side by side with about 12 inches of dirt between; logger placed on sand and rocks inside north pipe; it funnels water but was mostly dry at the time. | Double side-by-side concrete box culvert in a shallow wash; logger placed on sandy gravel in the north box; box funnels water, but it was dry at the time. |

Notes: By subtracting culvert temperature from ambient temperature, mean temperature difference and range were determined for comparison with simulated culverts.

E. ANALYSIS

Flat-tailed horned lizard use of each of the six culvert types was summarized as a count of the number of times a lizard crossed through to a terminal pen. The number of crossings confirmed visually added to the number of likely crossings detected only by the remote telemetry units. For a description of what the research team considered a “likely crossing,” see Appendix A. Low numbers of observations precluded reliable statistical analysis of lizard crossings.

After the 2005 field season, it was discovered that the 24-inch and 36-inch diameter culverts did not mimic real culvert conditions because the bulky skylights attached to the ends blocked more light than they directed into the culvert interior (Painter and Ingraldi 2005). Because interior lighting and probably airflow in these culverts likely did not accurately mimic real culvert conditions, 2005 light intensity and temperature data were dropped from final analyses.

In 2006, mean light intensity measurements were compared among all culverts and ambient values. Temperature measurements were used to calculate the disparity between ambient and internal culvert temperature, and then the season-long means from the six simulated culverts were compared. A subset of the temperature discrepancies from the simulated culverts was also compared to that of the real culverts under highway AZ-95. The subset was determined by including only measurements from the simulated culverts that were taken in the same 24-hour period as that of the real culverts. Each test was conducted with a one-way ANOVA, and because equal variances could not be assumed, multiple comparisons were conducted with a Games-Howell post hoc test. All tests were considered significant at $\alpha = 0.05$ (SPSS for Windows, Version 11.5, 2002).

There was one problem with light and temperature data collection in 2006; the data logger in the simulated 24-inch diameter dark culvert was buried by windblown sand at some point in the field season. This situation was not discovered until the end of the season. Light intensity recordings indicated that it was mostly covered by 11 July 2006, so that data set was truncated, and mean temperature difference of the simulated 24-inch diameter dark culvert was not compared to that of the real 24-inch diameter culvert.

IV. RESULTS

A. FLAT-TAILED HORNED LIZARD USE OF EXPERIMENTAL CULVERTS

Arizona Game and Fish Department biologists monitored movements of 54 flat-tailed horned lizards (34 males and 20 females) in the testing facility and observed 12 complete crossings (Table 2). Proportionally, there was little difference in use between the sexes; 23% (eight) of the males used culverts and 20% (four) of the females used culverts. All crossing structures except the 24-inch diameter culvert with a skylight were used at least once (Table 3). Dark culverts were used more frequently (nine crossings) than culverts with skylights (three crossings). The 36-inch diameter culverts were used most frequently (six crossings), and the 24-inch diameter culverts were used least frequently (two crossings). No individual flat-tailed horned lizard used more than one culvert.

From September through October 2005, at least two of 12 flat-tailed horned lizards made complete crossings through culverts. From June through September 2006, 42 flat-tailed horned lizards were monitored in the testing facility. The research team visually confirmed that six individuals used culverts, and remote telemetry data indicated another four individuals likely used culverts. During both years, tracks of other species were found in the culverts, including snakes, ground squirrels, beetles, roadrunners, passerines, and lizards with long tails.

Not all flat-tailed horned lizards survived 10 days. In 2005, one individual shed its skin with the transmitter and was lost in the testing facility; a raptor killed another individual. In 2006 predation in the testing facility became a problem. Predators (e.g., ground squirrels, roadrunners, shrikes, or raptors) killed at least 20 flat-tailed horned lizards. Telemetry signals of another 15 individuals were lost, which was likely a result of raptors carrying the lizards far away. One individual died of exposure when its transmitter wire snagged on a stick. Approximate end dates and apparent fates are listed in Appendix B. Exact survival times were not measured, because the majority of animals were not visually checked every day.

Table 2. Information on each flat-tailed horned lizard used in the simulated road crossing structure experiment (2005-2006).

| ID # | Sex | Release date | Culvert use | Culvert width and lighting | Detection method |
|------|-----|--------------|-------------|----------------------------|--------------------------|
| A | M | 22-Sep-05 | Yes | 4-ft x 8-ft light | Visual |
| B | M | 22-Sep-05 | Unknown | | |
| C | M | 22-Sep-05 | Yes | 24-in dark | Visual |
| D | M | 22-Sep-05 | Unknown | | |
| E | M | 22-Sep-05 | Unknown | | |
| F | M | 22-Sep-05 | Unknown | | |
| 2A | M | 11-Oct-05 | Inside 36D | | |
| 2B | M | 11-Oct-05 | Unknown | | |
| 2C | F | 11-Oct-05 | Unknown | | |
| 2D | M | 11-Oct-05 | Unknown | | |
| 2E | F | 11-Oct-05 | Unknown | | |
| 2F | M | 11-Oct-05 | Unknown | | |
| A1 | M | 10-Jun-06 | Unlikely | | |
| A2 | M | 10-Jun-06 | Unlikely | | |
| A3 | F | 10-Jun-06 | Unlikely | | |
| A4 | F | 10-Jun-06 | Unlikely | | |
| A5 | F | 10-Jun-06 | Unlikely | | |
| A6 | F | 10-Jun-06 | Unlikely | | |
| 2B | F | 12-Jul-06 | Unlikely | | |
| 4B | M | 12-Jul-06 | Unlikely | | |
| MC1 | M | 12-Jul-06 | Unlikely | | |
| MC3 | M | 12-Jul-06 | Unlikely | | |
| MC5 | M | 12-Jul-06 | Yes | 4-ft x 8-ft light | Remote receiver |
| MC13 | F | 14-Jul-06 | Unlikely | | |
| MC27 | M | 5-Aug-06 | Unlikely | | |
| MC28 | M | 5-Aug-06 | Unlikely | | |
| MC26 | F | 5-Aug-06 | Unlikely | | |
| MC29 | F | 5-Aug-06 | Unlikely | | |
| MC30 | F | 6-Aug-06 | Yes | 36-in dark | Visual & remote receiver |
| MC33 | F | 8-Aug-06 | Yes | 36-in dark | Remote receiver |
| MC47 | M | 18-Aug-06 | Unlikely | | |
| MC42 | M | 18-Aug-06 | Unlikely | | |
| MC46 | F | 18-Aug-06 | Unlikely | | |
| MC45 | M | 18-Aug-06 | Unlikely | | |
| MC43 | M | 18-Aug-06 | Unlikely | | |
| MC44 | M | 18-Aug-06 | Yes | 24-in dark | Visual & remote receiver |
| MC48 | M | 30-Aug-06 | Yes | 4-ft x 8-ft dark | Visual & remote receiver |
| MC49 | M | 30-Aug-06 | Unlikely | | |
| MC50 | F | 30-Aug-06 | Yes | 36-in dark | Remote receiver |
| MC54 | M | 30-Aug-06 | Unlikely | | |
| MC51 | M | 30-Aug-06 | Yes | 36-in dark | Remote receiver |

Continued.

Table 2 (continued).

| ID # | Sex | Release date | Culvert use | Culvert width and lighting | Detection method |
|------|-----|--------------|-------------|----------------------------|--------------------------|
| MC55 | M | 30-Aug-06 | Unlikely | | |
| MC52 | F | 30-Aug-06 | Unlikely | | |
| MC53 | M | 30-Aug-06 | Unlikely | | |
| MC56 | M | 4-Sep-06 | Unlikely | | |
| MC57 | F | 4-Sep-06 | Unlikely | | |
| MC58 | M | 4-Sep-06 | Yes | 4-ft x 8-ft dark | Visual & remote receiver |
| MC59 | F | 5-Sep-06 | Unlikely | | |
| MC60 | F | 7-Sep-06 | Unlikely | | |
| MC61 | F | 7-Sep-06 | Yes | 36-in dark | Visual & remote receiver |
| MC62 | M | 7-Sep-06 | Yes | 36-in light | Visual & remote receiver |
| MC63 | M | 11-Sep-06 | Unlikely | | |
| MC64 | F | 11-Sep-06 | Unlikely | | |
| MC65 | M | 11-Sep-06 | Unlikely | | |

Notes: Release Date: date the animal was released in the testing facility.

Culvert Use: Yes = crossed all the way through a culvert, Unknown = never observed using a culvert, Unlikely = probably did not use any culverts because the remote telemetry detection system did not record a strong signal from their transmitter, or Inside 36D = found inside the 36-in diameter dark culvert.

Detection methods: Visual = lizard visually observed in the terminal pen of a culvert, Remote receiver = remote receiver detected a crossing, or Visual & remote receiver = lizard was visually observed in terminal pen and the remote receiver detected the crossing.

Table 3. Summary of flat-tailed horned lizard use of simulated road crossing structures (2005-2006).

| Culvert width and lighting | 2005 visual detections | 2006 remote detections only | 2006 remote detections verified visually | Total crossings |
|----------------------------|------------------------|-----------------------------|--|-----------------|
| 24-in dark | 1 | 0 | 1 | 2 |
| 24-in light | 0 | 0 | 0 | 0 |
| 36-in dark | 0 | 3 | 2 | 5 |
| 36-in light | 0 | 0 | 1 | 1 |
| 4-ft x 8-ft dark | 0 | 0 | 2 | 2 |
| 4-ft x 8-ft light | 1 | 1 | 0 | 2 |
| Sum | 2 | 4 | 6 | 12 |

Notes: In 2005, only visual observations of crossings were noted. In 2006, some crossings were detected only with remote telemetry receivers; some were also verified with visual observations.

B. TEMPERATURE AND LIGHT INTENSITY

For all simulated culverts, light intensity inside was considerably dimmer than ambient light intensity (Table 4). Of the two lighting options at the testing facility, the interior of all culverts with skylights was brighter than the interior of all culverts without skylights. Each culvert differed from ambient light intensity and that inside all other culverts (ANOVA: $F_{6, 8158} = 583.42$, $P \leq 0.001$; post hoc: all $P \leq 0.017$).

Among the simulated culvert temperature discrepancies (Table 4), within same-size pairs generally did not differ, but among-size comparisons were generally significantly different ($F_{5, 12700} = 97.73$, $P \leq 0.001$). The only exception was the 24-inch dark culvert, which differed from its same-size partner, and did not differ from either of the 4-foot by 8-foot box culverts (Tables 4 and 5).

Table 4. Light intensity and temperature discrepancies at the testing facility (Jun-Sep).

| Culvert width and lighting | Mean light intensity (Lumens/square foot \pm SD) | Mean temperature discrepancy ($^{\circ}$ F \pm SD) |
|----------------------------|--|---|
| Ambient | 2549.8 \pm 3437.8 | - |
| 24-in dark | 1.2 \pm 0.5 | * 3.4 \pm 8.3 |
| 24-in light | 85.5 \pm 104.7 | -0.2 \pm 6.6 |
| 36-in dark | 14.9 \pm 95.3 | 1.5 \pm 6.6 |
| 36-in light | 100.1 \pm 121.7 | 1.5 \pm 5.8 |
| 4-ft x 8-ft dark | 34.1 \pm 14.4 | 3.0 \pm 4.5 |
| 4-ft x 8-ft light | 116.8 \pm 76.5 | 2.7 \pm 5.1 |

Notes: SD stands for ‘Standard Deviation. Light intensity was averaged over all daylight hours. Mean temperature discrepancy and range was determined by subtracting culvert temperature from ambient temperature. * Conditions inside the 24-inch dark culvert were only averaged through 11 July 2006, because the data logger was likely buried by windblown sand after that point.

Table 5. Games-Howell test results (P-values) of multiple comparisons among temperature discrepancies recorded at simulated culverts.

| Culvert width and lighting | 24-in light | 36-in dark | 36-in light | 4-ft x 8-ft dark | 4-ft x 8-ft light |
|----------------------------|-------------|------------|--------------|------------------|-------------------|
| 24-in dark | 0.000 | 0.000 | 0.000 | 0.830 | 0.264 |
| 24-in light | ----- | 0.000 | 0.000 | 0.000 | 0.000 |
| 36-in dark | ----- | ----- | 1.000 | 0.000 | 0.000 |
| 36-in light | ----- | ----- | ----- | 0.000 | 0.000 |
| 4-ft x 8-ft dark | ----- | ----- | ----- | ----- | 0.311 |

Notes: Bold text denotes a significant difference between means ($\alpha = 0.05$). The notable comparison here is the two 24-inch culverts differed from one another, while the other same-size pairs did not. Even in a separate comparison between the 24-inch culverts using data from both sets through 11 July 2006, the means differed ($F_{1, 1500} = 21$, $P \leq 0.001$).

Temperature discrepancy comparisons between real and simulated culverts during a 24-hour period showed few differences ($F_{7, 745} = 4.76$; $P \leq 0.001$). On average, the temperature discrepancy of the 4-foot by 8-foot real concrete box culvert was 2-4 degrees Fahrenheit more than that of other culverts. Mean temperature discrepancy of the 4-foot by 8-foot real concrete box culvert differed significantly from that of the simulated dark box culvert ($P \leq 0.001$), the simulated light box culvert ($P = 0.001$), the simulated 24-inch light culvert ($P = 0.001$), the real 24-inch culvert ($P = 0.004$), and the real 36-inch culvert ($P = 0.005$). Mean temperature discrepancy among all other real and simulated culverts did not differ (all $P \geq 0.129$).

V. CONCLUSIONS

Although natural conditions inside the testing facility were preserved as much as possible, the research team acknowledges that the response of each flat-tailed horned lizard to being placed in a foreign environment likely influenced their behavior. Normal daily home range movements, migration, dispersal, or breeding behavior may affect an animal's propensity to use culverts as actual road crossing structures. The observed low crossing rate could have been affected by each individual's reaction to unfamiliar surroundings, the high density of animals inside the testing facility, presence of predators, or other factors we did not measure. As the purpose of this study was not focused on absolute crossing rates, but rather on whether flat-tailed horned lizards would use culverts and if so what types, the research team agrees that the collected data met the defined objectives.

Flat-tailed horned lizards can use culverts as road crossing structures, but the evidence did not reveal a strong selection for or against any culvert type because each size of culvert was used and both lighting options were used (Table 3). However, the 36-inch culverts were used slightly more often than the other sizes, and we observed no use of the 24-inch culvert with skylights. It is possible that more crossings occurred undetected, especially in 2005 when we relied solely on periodic visual monitoring. Lizards may prefer to use culverts of an intermediate size. Smith (2003) found that herpetofauna in Florida used culverts most frequently when they were ≥ 59 inches wide and 23-59 inches high.

Although mean temperature discrepancy was not the same among all culverts, they were reasonably close, and all averaged less than 5 degrees Fahrenheit different from ambient conditions. Unless temperature inside a culvert is drastically different from that outside, the research team foresees no issues with temperature dissuading flat-tailed horned lizard use. Lighting inside the 40-foot long experimental culverts may not have affected lizard selection of culverts, but dark culverts were used slightly more than culverts with skylights. Culverts longer than 40 feet were not tested in this study, so poor lighting could be a problem with extremely long culverts, where the center of a small diameter culvert would be very dark.

Flat-tailed horned lizards did not seem averse to entering culverts. In 2005, at the end of the summer when lizards were starting to spend more time underground, one individual was found buried in the sand and mildly torpid a few feet inside the entrance of the 36-inch diameter dark culvert. In 2006, three flat-tailed horned lizards (MC44, MC50, and MC51) were found lingering inside either the 24-inch diameter dark culvert or the 36-inch diameter dark culvert several hours before passing all the way through. Lizards may also use culverts as thermoregulatory microhabitat or hiding cover since they provide vertical structure (e.g., Rodriguez et al., 1996).

Although we did not test whether substrate inside a culvert affects selection, it may be important for encouraging use, especially in corrugated metal culverts that are slick and uneven and very different from natural sand or rock. Lesbarreres et al. (2004) found that amphibians select culverts lined with soil as opposed to those of bare concrete. The same idea of substrate influence may be true for flat-tailed horned lizards.

Characteristics of some culverts changed as time passed. Although light intensity and visibility from entrance to exit was excellent in the box culverts, strong winds inevitably swept the sandy soil away from the ends of the culverts, revealing the smooth wood beneath. If the box culverts had been built 1 or 2 feet into the ground and leveled with soil, they may have resisted the scouring action of the wind. The real concrete box culvert also had no soil at the ends, but this was likely due to effects of water flow instead of wind. The 24-inch diameter culverts seemed particularly susceptible to movement of the sandy soil. They began filling in with sand quicker than the other culverts, restricting visibility from entrance to exit. At the real 24-inch diameter culvert, soil had eroded away from around the ends, leaving the openings above ground level, rendering it useless as a crossing structure for flat-tailed horned lizards.

VI. RECOMMENDATIONS

Because the 24-inch diameter culverts were used less frequently than the larger culverts and they seemed more susceptible to movement of soil, the research team tentatively recommends against using these culverts as standard road crossing structures for flat-tailed horned lizards. While the 36-inch diameter and the 4-foot by 8-foot box culverts were not immune to movement of sandy soil, they were not as vulnerable as the smaller culverts. Although the 36-diameter culvert may be the best option, either of the larger styles could work as a crossing structure, as long as fencing is used to funnel animals toward the culvert, it remains passable, preferably holds some soil on the floor, and allows some daylight through its length.

Other issues to consider in designing appropriate road crossing structures include: regular maintenance (i.e., maintaining substrate in culverts and ready access to culvert entrances), how many to install, where to install them, position under the road, and topography of the crossing site. Although this study showed that in an experimental situation flat-tailed horned lizards are capable of moving through culverts, they may exhibit different reactions to culverts under normal circumstances in their own territories or during typical dispersal. To further test road crossing structures as a viable mitigation measure for flat-tailed horned lizards, use of actual culverts under roads (with exclusion fencing) should be documented for this species in situ.

VII. BIBLIOGRAPHY

- Aresco, M. J. 2005. Mitigation measures to reduce highway mortality of turtles and other herpetofauna at a north Florida lake. *Journal of Wildlife Management* 69:549-560.
- Ascensão, F., and A. Mira. 2007. Factors affecting culvert use by vertebrates along two stretches of road in southern Portugal. *Ecological Research* 22:57-66.
- Brown, D. E., editor. 1994. Biotic communities: southwestern United States and northwestern Mexico. University of Utah Press, Salt Lake City, Utah, USA.
- Dodd, C. K. Jr., W. J. Barichivich, and L. L. Smith. 2004. Effectiveness of a barrier wall and culverts in reducing wildlife mortality on a heavily traveled highway in Florida. *Biological Conservation* 118:619-631.
- Flat-tailed Horned Lizard Interagency Coordinating Committee. 2003. Flat-tailed horned lizard rangewide management strategy, 2003 revision. Available at Arizona Ecological Services Field Office home page. <<http://www.fws.gov/southwest/es/arizona/>>. Accessed 6 Feb 2007.
- Lesbarreres, D, T. Lode, and J. Merilae. 2004. What type of amphibian tunnel could reduce road kills? *Oryx* 38:220-223.
- Ng, S. J., J. W. Dole, R. M. Sauvajot, S. P. D. Riley, and T. J. Valone. 2004. Use of highway undercrossings by wildlife in southern California. *Biological Conservation* 115:499-507.
- Painter, M. L., and M. F. Ingraldi. 2005. Use of simulated highway underpass crossing structures by flat-tailed horned lizards (*Phrynosoma mcallii*). Progress report, Research Branch, Arizona Game and Fish Department, Flagstaff, Arizona.
- Rodriguez, A., G. Crema, and M. Delibes. 1996. Use of non-wildlife passages across a high speed railway by terrestrial vertebrates. *Journal of Applied Ecology* 33:1527-1540.
- Ruediger, B. 2001. High, wide, and handsome: designing more effective wildlife and fish crossings for roads and highways. Pages 509-516 *in* Proceedings of the International Conference on Ecology and Transportation. Center for Transportation and the Environment, 24-28 September 2001, Keystone, Colorado, USA. Also available at: eScholarship Repository, University of California. <<http://repositories.cdlib.org/jmie/roadecco/Reudiger2001a>>. Accessed 26 Feb 2007.
- Smith, D. J. 2003. Monitoring wildlife use and determining standards for culvert design. Final report presented to the Florida Department of Transportation, Contract BC354-34. University of Florida, Gainesville, Florida. Available at <http://www.dot.state.fl.us/research-center/Completed_Proj/Summary_EMO/FDOT_BC354_34_rpt.pdf>. Accessed 12 Mar 2007.
- SPSS for Windows 2002. Version 11.5. SPSS, Chicago, Illinois, USA.
- The Weather Channel [TWC]. 2007. TWC Interactive home page. <<http://www.weather.com>>. Accessed 22 Jan 2007.

Trombulak, S. C., and C. A. Frissell. 2000. Review of ecological effects of roads on terrestrial and aquatic communities. *Conservation Biology* 14:18-30.


Yanes, M., J. M. Velasco, and F. Suárez. 1995. Permeability of roads and railways to vertebrates: the importance of culverts. *Biological Conservation* 71:217-222.

APPENDIX A. RECORDS AND INTERPRETATION OF FLAT-TAILED HORNED LIZARD REMOTE TELEMTRY DATA

Appendix A lists the guidelines used in determining if remote telemetry data indicated a flat-tailed horned lizard crossed through a simulated road crossing structure. The complete set of remote telemetry data is on file at the Arizona Game and Fish Department, and is available upon request (Research Branch, AGFD, 2221 W. Greenway Rd., Phoenix, AZ 85023; 602-942-3000).

We established basic guidelines for interpreting remote telemetry data by evaluating the signal patterns recorded during visually confirmed crossing events. An example is presented on the next page. If a flat-tailed horned lizard successfully crossed through a culvert to the terminal pen, the following general patterns were usually (but not always) evident in the antenna and signal strength data:

- The data file had several hundred to a few thousand detections for a single frequency.
- The data file had many (e.g., > 40 or 50) detections at an identified antenna within a few minutes or hours. Detections without an identified antenna were not convincing.
- A dominant antenna was identified repeatedly in the section where lots of detections were recorded in a few minutes or hours. The dominant antenna was the one with a signal strength $\gg 100$, at the same time the subordinate antennas recorded a signal strength $\ll 100$ (if at all).
- The increase/decrease in signal strength was more or less steady over time as the lizard walked past the antenna. A convincing signal pattern would not jump instantly or repeatedly from a weak signal (e.g., 60-70) to a strong signal (e.g., >115).

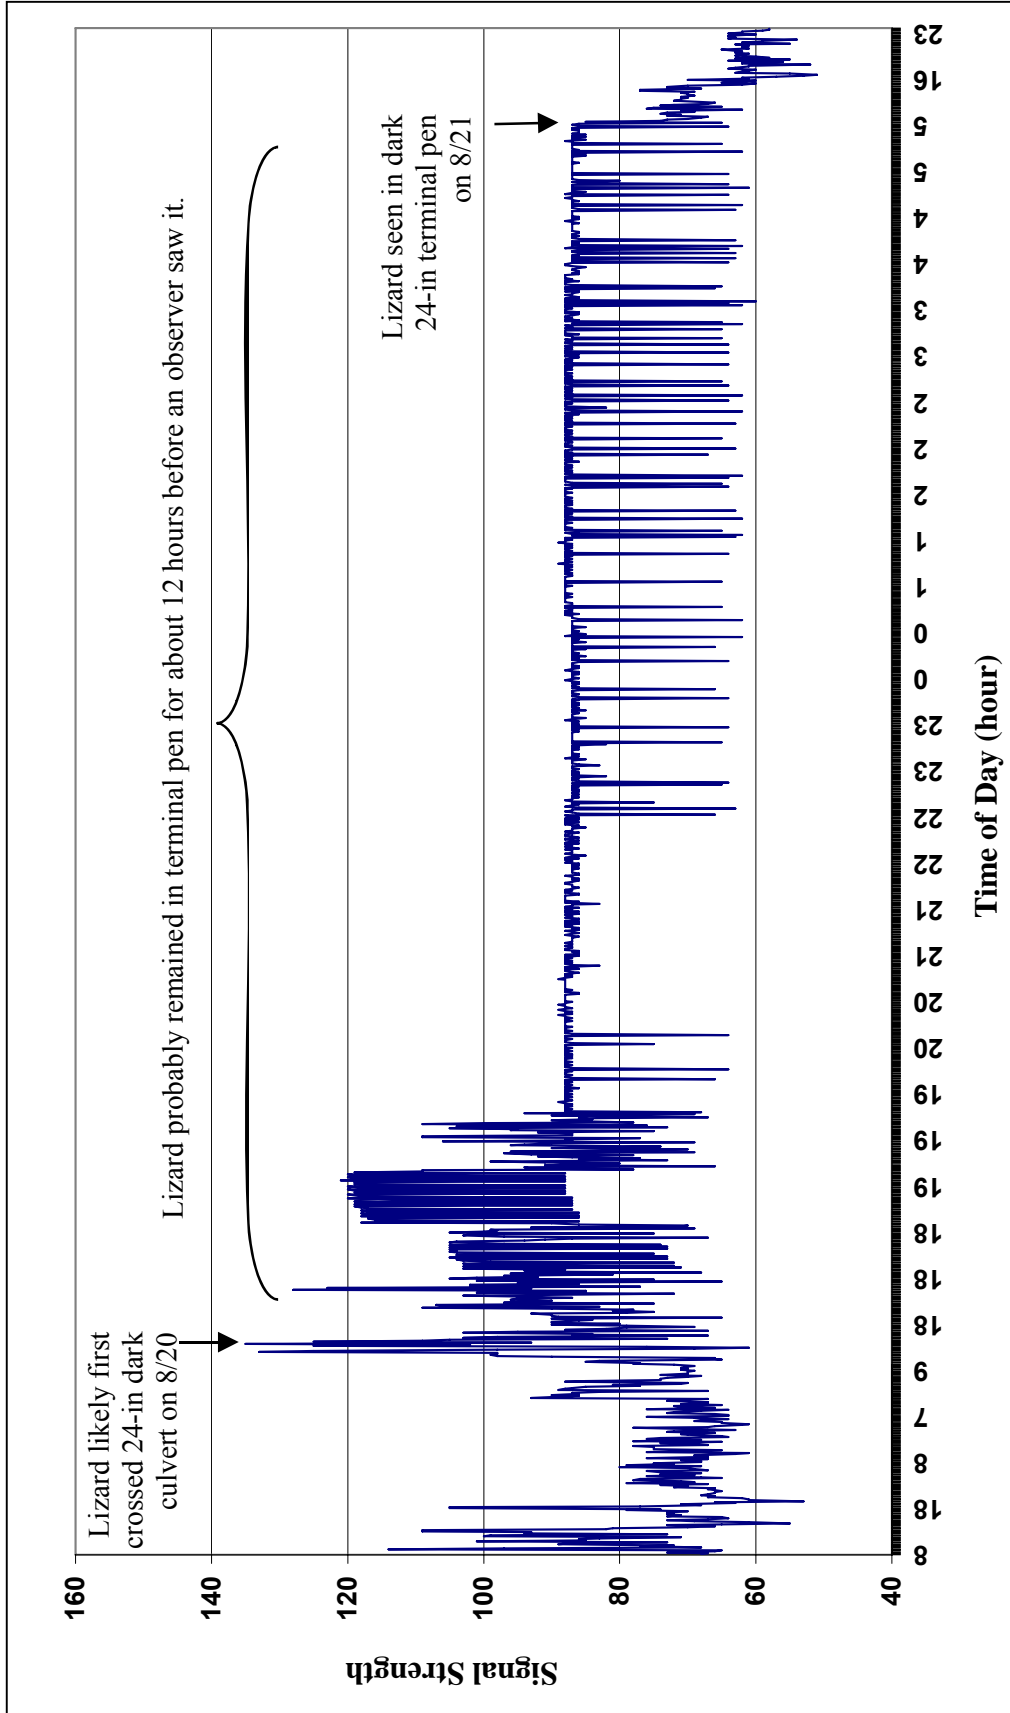

Appendix A (contd). Example of signal strength recorded by a remote telemetry receiver (Flat-tailed horned lizard Male MC44). This example includes all the detections of frequency 150.410-411 on receiver R2678, which monitored the dark 24-in diameter metal culvert and the lit 4-ft x 8-ft box culvert from 18-30 August 2006. The strong signals from the 24-in culvert dominate and cluster at the top of the line. After the lizard was seen in the terminal pen, he was moved back to the main pen, and the signal faded accordingly.

**APPENDIX B. SURVIVAL DATA AND FATE OF FLAT-TAILED
HORNED LIZARDS**

| ID # | Release date | Approximate end date | Apparent fate |
|------|--------------|----------------------|------------------|
| A | 22-Sep-05 | 2-Oct-05 | Lived |
| B | 22-Sep-05 | 2-Oct-05 | Lived |
| C | 22-Sep-05 | 2-Oct-05 | Lived |
| D | 22-Sep-05 | 2-Oct-05 | Lived |
| E | 22-Sep-05 | 23-Sep-05 | Shed transmitter |
| F | 22-Sep-05 | 2-Oct-05 | Lived |
| 2A | 11-Oct-05 | 22-Oct-05 | Lived |
| 2B | 11-Oct-05 | 15-Oct-05 | Predator |
| 2C | 11-Oct-05 | 22-Oct-05 | Lived |
| 2D | 11-Oct-05 | 22-Oct-05 | Lived |
| 2E | 11-Oct-05 | 22-Oct-05 | Lived |
| 2F | 11-Oct-05 | 22-Oct-05 | Lived |
| A1 | 10-Jun-06 | < 21-Jun-06 | Predator |
| A2 | 10-Jun-06 | < 21-Jun-06 | Predator |
| A3 | 10-Jun-06 | 20-Jun-06 | Predator |
| A4 | 10-Jun-06 | < 21-Jun-06 | Predator |
| A5 | 10-Jun-06 | < 21-Jun-06 | Predator |
| A6 | 10-Jun-06 | < 21-Jun-06 | Predator |
| 2B | 12-Jul-06 | 14-Jul-06 | Predator |
| 4B | 12-Jul-06 | 14-Jul-06 | No signal |
| MC1 | 12-Jul-06 | 14-Jul-06 | No signal |
| MC3 | 12-Jul-06 | 23-Jul-06 | Lived |
| MC5 | 12-Jul-06 | 21-Jul-06 | No signal |
| MC13 | 14-Jul-06 | 18-Jul-06 | Predator |
| MC26 | 5-Aug-06 | 17-Aug-06 | Lived |
| MC27 | 5-Aug-06 | 7-Aug-06 | No signal |
| MC28 | 5-Aug-06 | 16-Aug-06 | Died intact |
| MC29 | 5-Aug-06 | 7-Aug-06 | No signal |
| MC30 | 6-Aug-06 | 14-Aug-06 | Predator |
| MC33 | 8-Aug-06 | 9-Aug-06 | Predator |
| MC42 | 18-Aug-06 | 20-Aug-06 | Predator |
| MC43 | 18-Aug-06 | 22-Aug-06 | No signal |
| MC44 | 18-Aug-06 | 22-Aug-06 | Predator |
| MC45 | 18-Aug-06 | 22-Aug-06 | Predator |
| MC46 | 18-Aug-06 | 19-Aug-06 | No signal |
| MC47 | 18-Aug-06 | 20-Aug-06 | No signal |
| MC48 | 30-Aug-06 | 1-Sep-06 | No signal |
| MC49 | 30-Aug-06 | 1-Sep-06 | Predator |
| MC50 | 30-Aug-06 | 8-Sep-06 | Lived |
| MC51 | 30-Aug-06 | 1-Sep-06 | No signal |

Continued.

Appendix B (contd).

| ID # | Release date | Likely end date | Fate |
|------|--------------|-----------------|-----------|
| MC52 | 30-Aug-06 | 1-Sep-06 | Predator |
| MC53 | 30-Aug-06 | 1-Sep-06 | Predator |
| MC54 | 30-Aug-06 | 2-Sep-06 | No signal |
| MC55 | 30-Aug-06 | 31-Aug-06 | Predator |
| MC56 | 4-Sep-06 | 6-Sep-06 | No signal |
| MC57 | 4-Sep-06 | 5-Sep-06 | Predator |
| MC58 | 4-Sep-06 | 13-Sep-06 | Lived |
| MC59 | 5-Sep-06 | 14-Sep-06 | Lived |
| MC60 | 7-Sep-06 | 16-Sep-06 | Lived |
| MC61 | 7-Sep-06 | 13-Sep-06 | Predator |
| MC62 | 7-Sep-06 | 13-Sep-06 | No signal |
| MC63 | 11-Sep-06 | 13-Sep-06 | No signal |
| MC64 | 11-Sep-06 | 12-Sep-06 | Predator |
| MC65 | 11-Sep-06 | 12-Sep-06 | No signal |