



MISSOURI
S&T

CENTER FOR INFRASTRUCTURE ENGINEERING STUDIES



Interpretation of Echo Sounding and Sub-bottom Profiling Data Mark Twain Bridge A-3798, MoDOT Route 107

by

Thomas M. Petry



**UTC
R175**

**A University Transportation Center Program
at Missouri University of Science & Technology**

Disclaimer

The contents of this report reflect the views of the author(s), who are responsible for the facts and the accuracy of information presented herein. This document is disseminated under the sponsorship of the Department of Transportation, University Transportation Centers Program and the Center for Infrastructure Engineering Studies UTC program at the University of Missouri - Rolla, in the interest of information exchange. The U.S. Government and Center for Infrastructure Engineering Studies assumes no liability for the contents or use thereof.

Technical Report Documentation Page

1. Report No. UTC R175	2. Government Accession No.	3. Recipient's Catalog No.	
4. Title and Subtitle Interpretation of Echo Sounding and Sub-bottom Profiling Data Mark Twain Bridge A-3798, MoDOT Route 107	5. Report Date February 2008		
	6. Performing Organization Code		
7. Author/s Thomas M. Petry	8. Performing Organization Report No. 00013030		
9. Performing Organization Name and Address Center for Infrastructure Engineering Studies/UTC program Missouri University of Science & Technology 223 Engineering Research Lab Rolla, MO 65409	10. Work Unit No. (TRAIS)		
	11. Contract or Grant No. DTRS98-G-0021		
12. Sponsoring Organization Name and Address U.S. Department of Transportation Research and Special Programs Administration 400 7 th Street, SW Washington, DC 20590-0001	13. Type of Report and Period Covered Final		
	14. Sponsoring Agency Code		
15. Supplementary Notes			
16. Abstract The project consists of essentially doing what is outlined in the objective above. In addition, MoDOT will be responsible for choosing the 30 soils and 5 base materials to be tested, for doing initial property tests on them, and delivering them to UMR. UMR will mold and test the specimens discussed in the objective. In addition, UMR will measure water activity properties of each specimen, investigating how new instruments may be useable in the field during subgrade evaluations to be done in future research. Finally, the data from testing during this project will be entered into Dr. Han's program, usable in predicting resilient moduli and water contents, along with further calibration of this program with Missouri soils. The following graph and explanation of tasks describe the processes to be followed and their timing.			
17. Key Words Subgrades, Pavements, Resilient Modulus	18. Distribution Statement No restrictions. This document is available to the public through the National Technical Information Service, Springfield, Virginia 22161.		
19. Security Classification (of this report) unclassified	20. Security Classification (of this page) unclassified	21. No. Of Pages 5	22. Price

Interpretation of Echo Sounding and Sub-bottom Profiling Data Mark Twain Bridge A-3798, MoDOT Route 107

Executive Summary:

Echo sounding data and sub-bottom profiling data were acquired on the water surface in proximity to bridge bents 4-8 (Mark Twain Bridge A-3798, MoDOT Route 107). The echo sounding data imaged the lake bottom and were used to generate contoured maps showing variable depth to the lake bottom. The sub-bottom profiling data imaged the lake bottom but did not image the underlying soil or rock. This is because the talus or alluvium deposits are absent in places and/or heterogeneous and relatively dense.

Two-dimensional (plan view) and three-dimensional images of the lake bottom (Figures 1, 2 and 3) are presented herein as the deliverables.

Summary of Field Work:

Echo sounding data and sub-bottom profiling data were acquired on the water surface in proximity to bridge bents 4-8, using a boat equipped with a GPS antenna.

The echo sounding tool emits a very high frequency pulse of acoustic energy at predetermined time intervals as it is towed along the surface of the water. Some of this acoustic energy is reflected (as an echo) from the lake bottom and returned to the echo sounding tool. Because it emits a high frequency pulse of acoustic energy, the echo sounding tool is not capable of penetrating and/or imaging dense soils or underlying bedrock. At the Mark Twain bridge site it provided accurate water depths only.

The echo sounding tool records the time it takes the acoustic pulse to travel to/from the lake bottom (travel time; **T**). The water depth (depth; **D**) is accurately estimated by dividing the travel time (**T**) by a factor 2 and then multiplying it by the acoustic velocity of water (**V**).

$$D = Tw/2 \times V$$

Two-dimensional and three-dimensional images of the lake bottom were generated on the basis of echo sounding depth estimates. These are presented as Figures 1 and 2, respectively.

The sub-bottom profiling tool emits a much lower frequency pulse of acoustic energy at predetermined time intervals as it is towed along the water surface. Some of this acoustic energy is reflected (as an echo) from the lake bottom. Reflected energy from bedrock will also be recorded if the sub-bottom material is comprised of thin (typically < 30 ft), low-density, fairly uniform soils. If bedrock is imaged, soil thicknesses (**Ds**) can be estimated at each observation location by calculating the two-way travel time through the soil (**Ts**), dividing the resultant by a factor 2, and then multiplying the output by the acoustic velocity of the soil (**Vs**).

$$Ds = Ts/2 \times Vs$$

The reflection from the lake bottom was clearly identified on the sub-bottom profiling data acquired at the Mark Twain bridge site. Unfortunately, we were unable to identify a second reflection from underlying bedrock. There are two most-probable explanations. The first explanation is that bedrock, in many places, is not overlain by soil. The second explanation is that the talus or alluvium, where present, is dense and heterogeneous, and has acoustic properties similar to those of the underlying bedrock.

A map showing variations in soil thickness and/or soil characteristics could not be generated on the basis of the interpretation of the sub-bottom profiling data.

Sub-bottom Features of Significance:

Contoured lake bottom elevations are displayed on Figure 3.

Two significant sub-bottom features are observed on the contoured base map (Figure 3):

1. Bent 4 is located on a steeply dipping (~35 ft drop in elevation over a lateral distance of ~60 ft) sub-bottom surface.
2. The old channel of the North Fork of the Salt River is imaged on the contour map immediately to the south of bent 8.

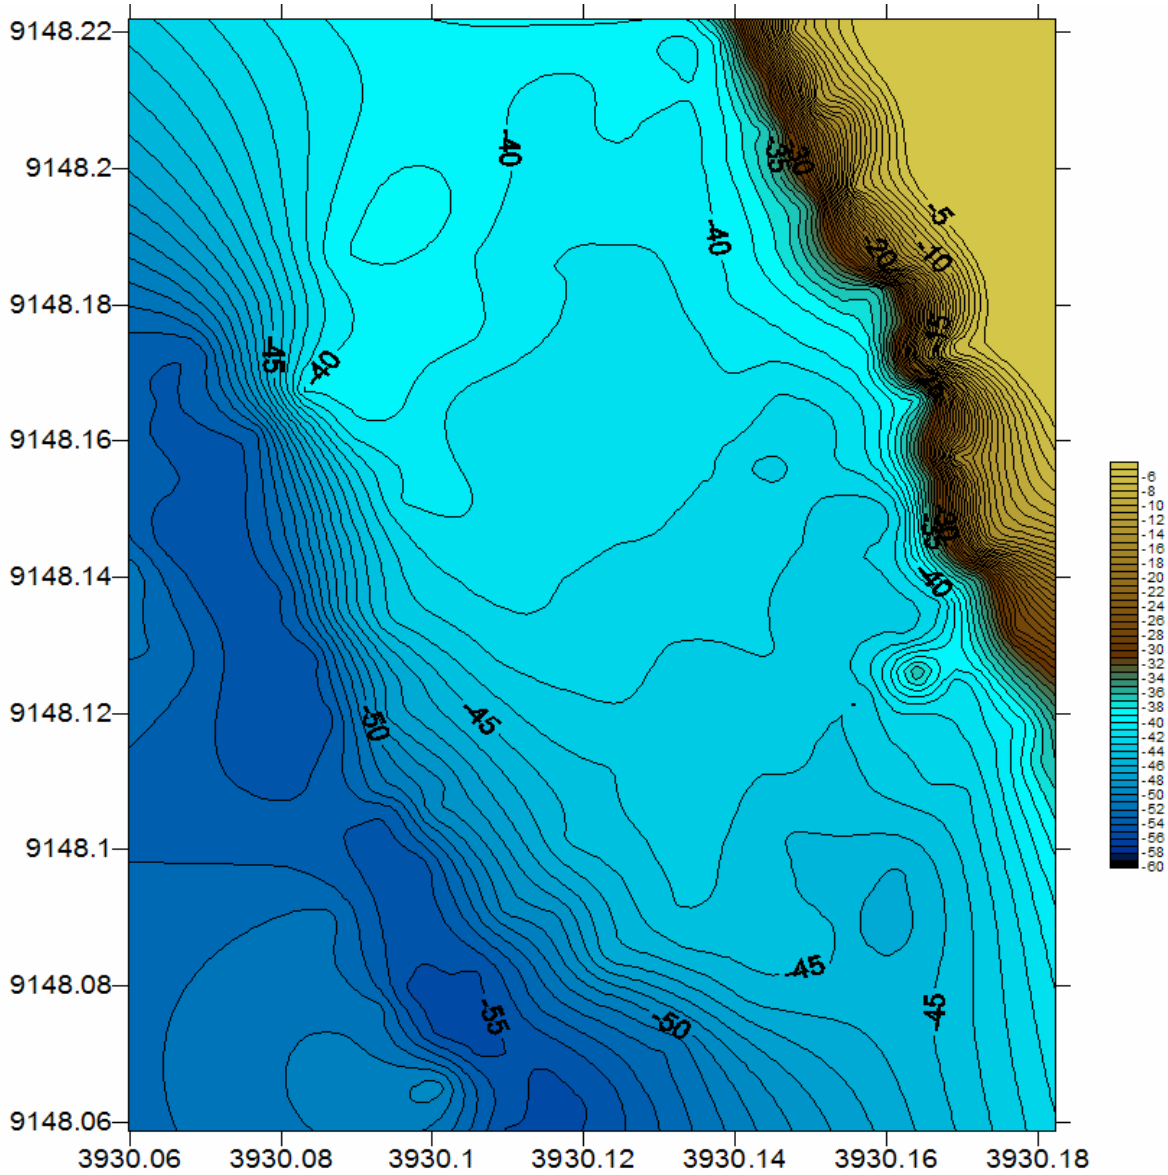


Figure 1: Partial plan view map of the study area showing variable water depths (in feet). Depths were relative to the 601.9 ft water surface elevation recorded on 10/18/06. This contoured map is based on the interpretation of the acquired echo sounding data.

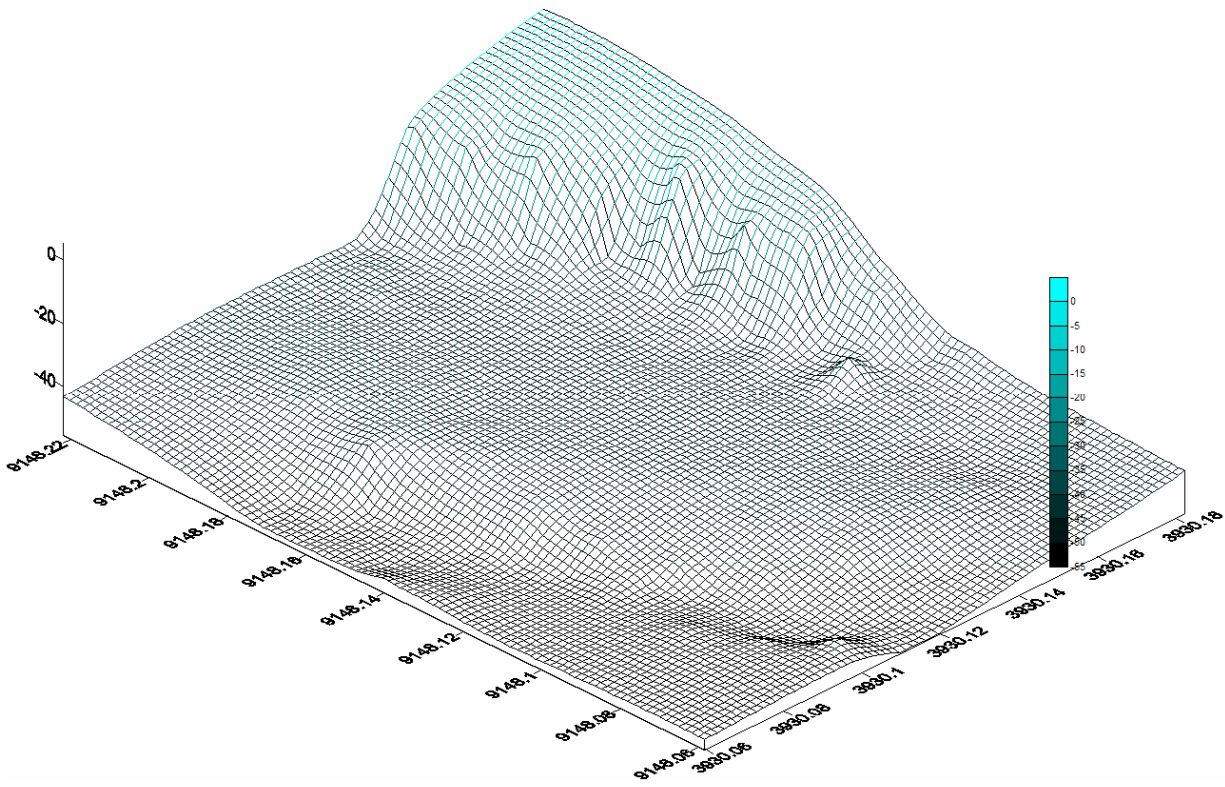


Figure 2: 3-D presentation of Figure 1. Water depths (in feet) are relative to the 601.9 ft water surface elevation recorded on 10/18/06. This contoured map is based on the interpretation of the acquired echo sounding data.

MoDOT Bridge A-3798

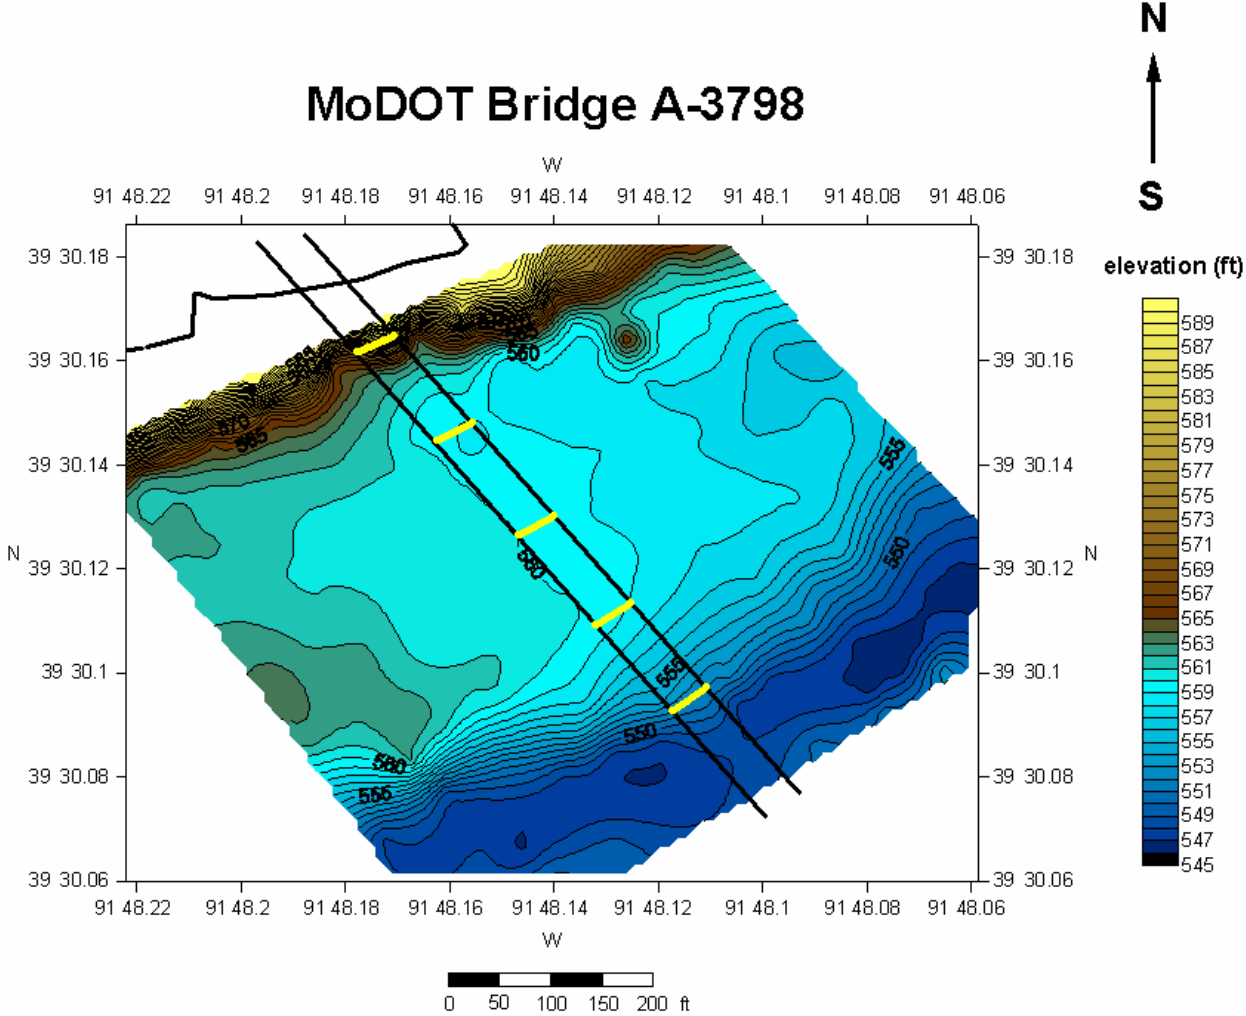


Figure 3: Plan view map of the study area showing elevation of the lake bottom (in feet). This contoured map is based on the interpretation of the acquired echo sounding data.